


MODEL 211.0 up to 1.6.08
 except CODE (809) Model year 2009
 with CODE (813) Voice control system (VCS [SBS])





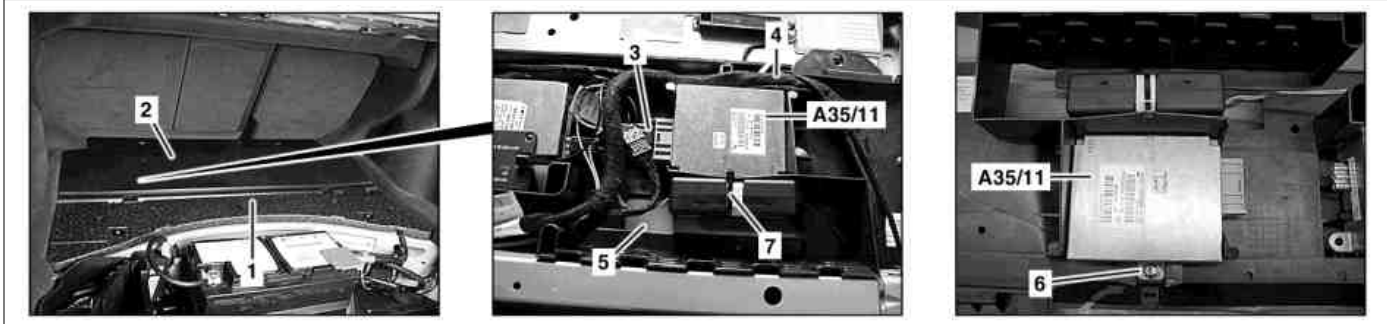

P82.70-4048-07

1 Damping material
 2 Carrier plate cover
 3 Electrical connector

4 Wiring harness
 5 Carrier plate
 6 Screw

7 Cable tie

A35/11 Voice control system control unit

	Remove/install		
	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
1	Remove soundproofing (1)		
2	Remove carrier plate cover (2)		
3	Disconnect electrical connector (3)	 To avoid damaging the fiber optic cable, do not kink fiber optic cable, route over sharp edges or bend in radii smaller than 25 mm.	
4	Cover fiber optic cable	 The fiber optic cable is integrated in electrical connector (3).	AR82.95-P-0005-01A
5	Detach wiring harness (4) from carrier plate (5) and place to one side until bolt (6) is accessible		
6	Remove bolt (6)		
7	Open cable tie (7) and remove voice control system control unit (A35/11) out of the carrier plate (5)	 Installation: Replace cable ties (7).	
8	Install in the reverse order		