

MODEL 211.0 up to 31.5.06
with CODE (521) MB Audio 50 radio USA (without navigation)
with CODE (525) MB Audio 50 APS radio
with CODE (526) COMAND (without navigation)
with CODE (527) COMAND APS (with navigation)
with CODE (528) HIGH Class USA
with CODE (529) HIGH Class Japan
with CODE (530) COMAND APS USA (with navigation system)

MODEL 211.0 as of 1.6.06
with CODE (525) MB Audio 50 APS radio
with CODE (413) Panoramic sliding roof

MODEL 211.0 as of 1.6.06
with CODE (526) COMAND (without navigation)
with CODE (413) Panoramic sliding roof

MODEL 211.0 as of 1.6.06
with CODE (527) COMAND APS (with navigation)
with CODE (413) Panoramic sliding roof

MODEL 211.0 as of 1.6.06
with CODE (529) HIGH Class Japan
with CODE (413) Panoramic sliding roof

2 Telephone antenna line

6 Ground cable

7 Ground cable

8 Self-adhesive felt


2a GPS antenna line

A2/49a1x1 Telephone antenna connector
 (without code (228) Stationary heater)

A2/49a2x1 GPS antenna connector

W6 Ground (left wheel well in luggage compartment)


W7 Ground (right wheel well in luggage compartment)

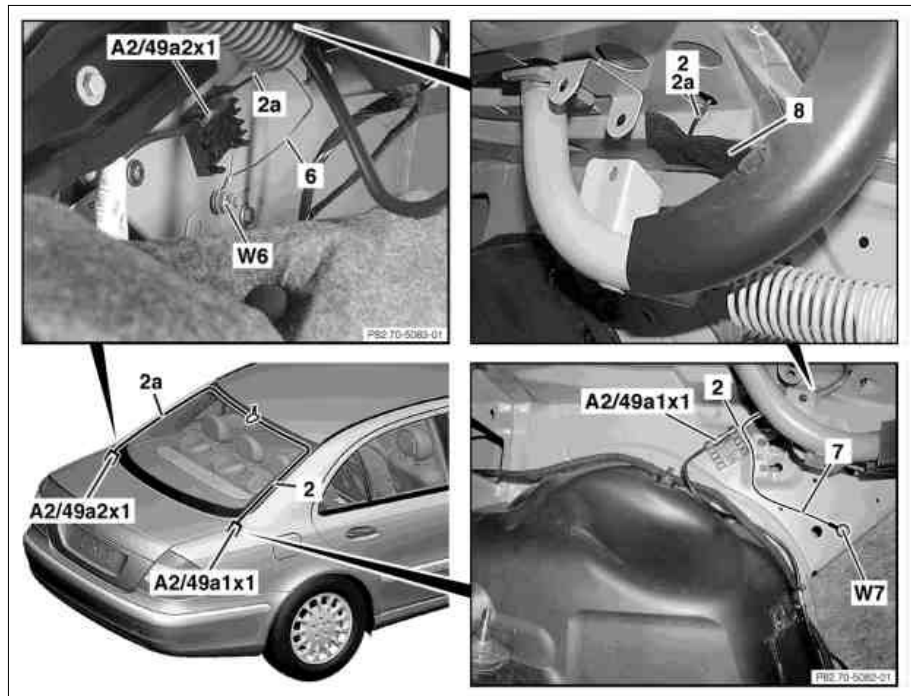

- 1 Right cover
- 2 Telephone antenna line
- 3 Right grommet

- 1a Left cover
- 2a GPS antenna line
- 3a Left grommet

A2/49a2 GPS antenna

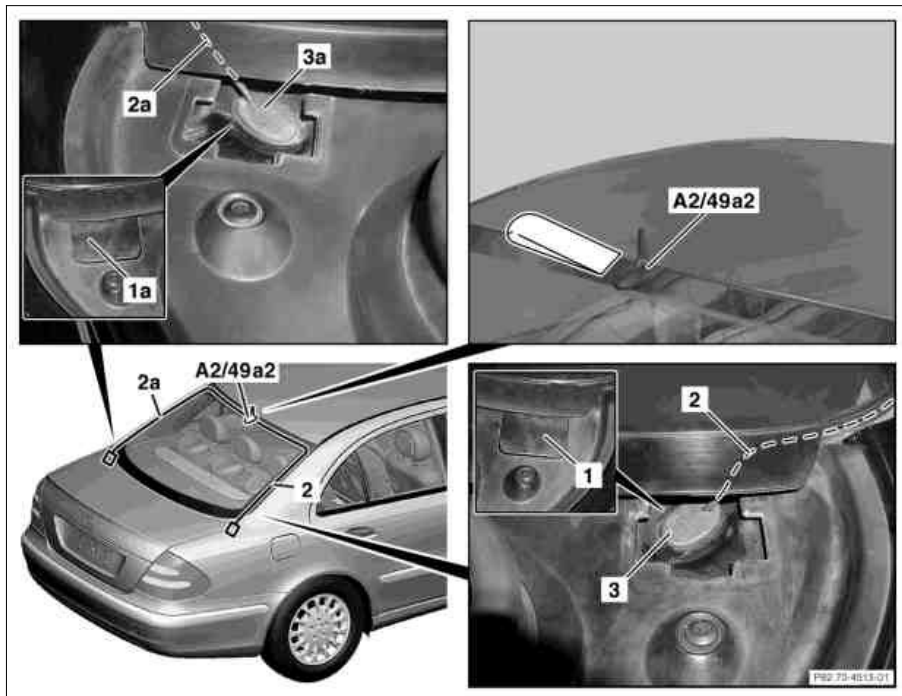


P82.70-5172-06

Vehicles with code (228) stationary heater

- 2 Telephone antenna line
- 7 Ground cable




A2/53 Telephone/cell phone/STH radio remote control antenna splitter (for code (228) Stationary heater)

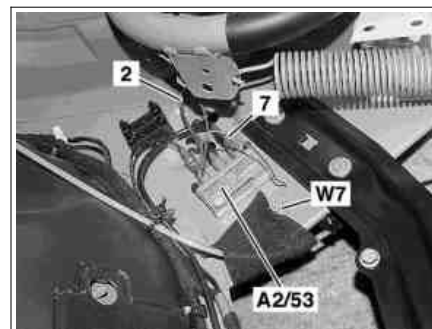
W7 Ground (right wheel well in luggage compartment)




P82.70-5085-01

☒ ☒	Remove/install		
ⓘ	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
1	Remove right and left side lining in luggage compartment	On vehicles with code (287) Through-loading feature. On vehicles without code (287) Through-loading feature or without code (924) Bivalent natural gas drive. On vehicles with code (924) Bivalent natural gas drive.	AR68.30-P-4800TA AR68.30-P-4800T AR68.30-P-4800TB
2	Detach self-adhesive felt (8) at left and right and expose telephone antenna line (2) and GPS antenna line (2a)	ⓘ Observe installation position of telephone antenna line (2) and of GPS antenna line (2a). ⓘ Installation: Attach telephone antenna line (2) and GPS antenna line (2a) using self-adhesive felt (8), as otherwise telephone antenna line (2) and GPS antenna line (2a) may be damaged at the trunk lid hinge.	
3.1	Disconnect telephone antenna connector (A2/49a1x1)	On vehicles without code (228) Stationary heater.	
3.2	Detach telephone antenna line connector (2) from telephone/cell phone/STH radio remote control antenna splitter (A2/53).	On vehicles with code (228) Stationary heater.	
4	Undo nut on ground of right luggage compartment wheel well (W7) and remove ground line (7)		
5	Detach GPS antenna connector (A2/49a2x1)		
6	Undo nut on ground of left luggage compartment wheel well (W6) and remove ground line (6).		

8	Remove telephone antenna line (2) with right grommet (3) out of the right cable duct	<p>i Note installation of lines in luggage compartment.</p> <p>i Installation: Coat right rubber grommet (3) with soapy water.</p>	
9	Withdraw telephone antenna line (2) out of rear window rubber sealing	<p>i Installation: Insert telephone antenna line (2) into the rear window rubber sealing using a suitable feeler gauge.</p> <p></p>	*129589032100
10	Remove GPS antenna line (2a) with left rubber grommet (3a) from left cable duct	<p>i Note installation of lines in luggage compartment.</p> <p>i Installation: Coat left rubber grommet (3a) with soapy water.</p>	
11	Pull out GPS antenna line (2a) from rear window rubber seal	<p>i Installation: Insert GPS antenna line (2a) into the rear window rubber sealing using a suitable feeler gauge.</p> <p></p>	*129589032100
12	Detach GPS antenna (A2/49a2) from rear window using assembly wedge, remove and then remove adhesive residues on rear window using cleaning agent	<p>i Installation: Glue on GPS antenna (A2/49a2). If the old GPS antenna is being re-used (A2/49a2), use prescribed adhesive foil.</p> <p></p> <p>Cleaner Glass primer Adhesive foil</p>	<p>AR82.70-P-8951-01T</p> <p>*110589035900 *BR00.45-Z-1025-04A *BR00.45-Z-1023-02A *BR00.45-Z-1079-02A</p>
13	Install in the reverse order		

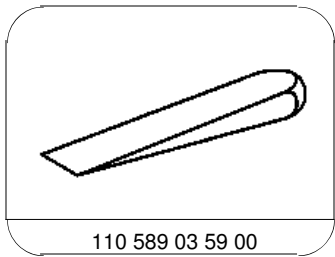

Mounting wedge

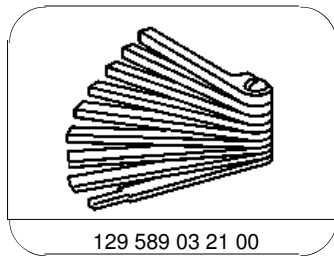

Feeler gauge

Repair materials

Number	Designation	Order number
BR00.45-Z-1023-02A	Glass primer	A 006 989 39 71
BR00.45-Z-1079-02A	Adhesive foil	A 211 817 00 21
BR00.45-Z-1025-04A	Cleaner	A 005 989 19 71