

P80.57-2069-09

1 Selector lever release cable  
(with transmission 722)

3 Instrument panel lower section  
4 Electrical connectors

6 Instrument panel mount

2 Rosette


5 Air ducting

N73 EIS [EZS] control unit

#### Modification notes

29.1.04	Repair method completely modified	Step 1 to step 8	
---------	-----------------------------------	------------------	--

	Remove/Install		
	Notes on avoiding damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
1.1	Transfer basic data from EIS control module (N73) to STAR DIAGNOSIS	Only when replacing EIS control module (N73) <b>i</b> <b>Installation:</b> Transfer basic data from STAR DIAGNOSIS to EIS control module (N73). On vehicles with electric glass tilting/sliding roof, code 414a always perform learn-in procedure for pinch protection of sliding roof.	
	Connect STAR DIAGNOSIS and read out fault memory	Diagnosis system STAR DIAGNOSIS	AD00.00-P-2000-04A *WH58.30-Z-1048-13A
2	Disconnect ground cable from battery	Model 211.0/6 Model 211.2	AR54.10-P-0003T AR54.10-P-0003TA
3	Unscrew rosette (2) using claw-type wrench		*210589000700
4	Remove cover below left of instrument panel		AR68.10-P-1500T
5.1	Remove air ducting (5)	Vehicles with comfort automatic air conditioning, code 481	
6.1	Remove instrument cluster	Vehicles with USA version, code 494 <b>i</b> To remove instrument panel bracket (6).	AR54.30-P-6015T
7.1 	Remove instrument panel bracket (6) Information on machining/treating magnesium components	Vehicles with USA version, code 494	AH60.00-P-0023-01R
8	Remove EIS control module (N73) from instrument panel bottom section (3) downward until electrical connectors (4) are accessible		
9.1	Unclip selector lever release cable (1) toward front of vehicle and remove from EIS control module (N73).	Vehicles with transmission 722	
10	Unplug electrical connectors (4) and remove electronic ignition switch control unit (N73)		
11	Install in the reverse order		

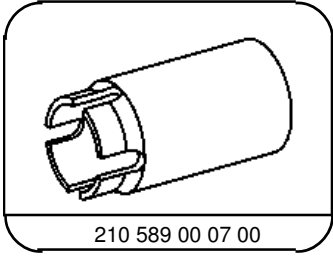

Claw-type wrench for rosette on ignition switch

**Commercially available tools**

Number	Designation	
WH58.30-Z-1048-13A	STAR DIAGNOSIS diagnosis system, Compact Passenger Car	6511 1801 00