


- MODEL 211.0**
with CODE (525) MB Audio 50 APS radio
with CODE (941) Preinstallation for radio data transmission
GPS antenna splitter
- MODEL 211.0**
with CODE (527) COMAND APS (with navigation)
with CODE (941) Preinstallation for radio data transmission
GPS antenna splitter
- MODEL 211.0**
with CODE (525) MB Audio 50 APS radio
with CODE (383) CP-High telephone system
GPS antenna splitter
- MODEL 211.0**
with CODE (527) COMAND APS (with navigation)
with CODE (383) CP-High telephone system
GPS antenna splitter
- MODEL 211.0**
with CODE (383) CP-High telephone system
with CODE (941) Preinstallation for radio data transmission
GPS antenna splitter
- MODEL 211.0**
with CODE (530) COMAND APS USA (with navigation system)
with CODE (384) Telephone preinstallation for USA
GPS antenna splitter


1 Electrical connectors

A2/5 GPS antenna splitter

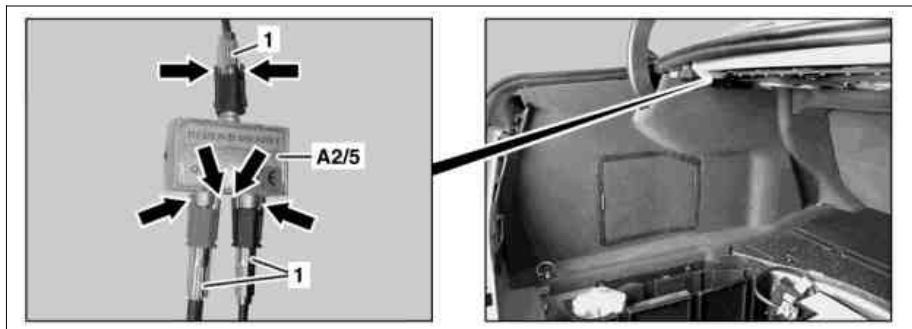

P82.70-4047-04

		Remove/install	
ⓘ		Information on preventing damage to electronic components due to electrostatic discharge	AH54.00-P-0001-01A
1		Remove left side trim in trunk	For vehicles without code (287a) Through-loading feature AR68.30-P-4800T For vehicles with code (287a) Through-loading feature. AR68.30-P-4800TA
2		Unclip GPS antenna splitter (A2/5) from rear shelf	*115589035900
3		Disconnect electrical connectors (1) at GPS antenna splitter (A2/5)	<div style="border: 1px solid black; padding: 2px; display: inline-block;"> Push locking clips together (arrows) to do this. </div> <div style="border: 1px solid black; padding: 2px; display: inline-block;"> Installation: Ensure electrical connectors (1) are correctly latched into place. </div>
4		Remove GPS antenna splitter (A2/5) from luggage compartment	
5		Install in the reverse order	

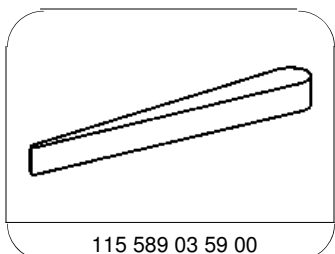

115 589 03 59 00