

- Parts list -

Vehicle	WDBUH83J96X202363 (64V)	E 500 4MATIC	
Color	197 - obsidianschwarz metallic	Equipment	831 - Leder anthrazit
FIN: WDB2112831X202363		Assortment class	PC
Group	50 RADIATOR	Sub-group	600 TRANSMISSION COOLING

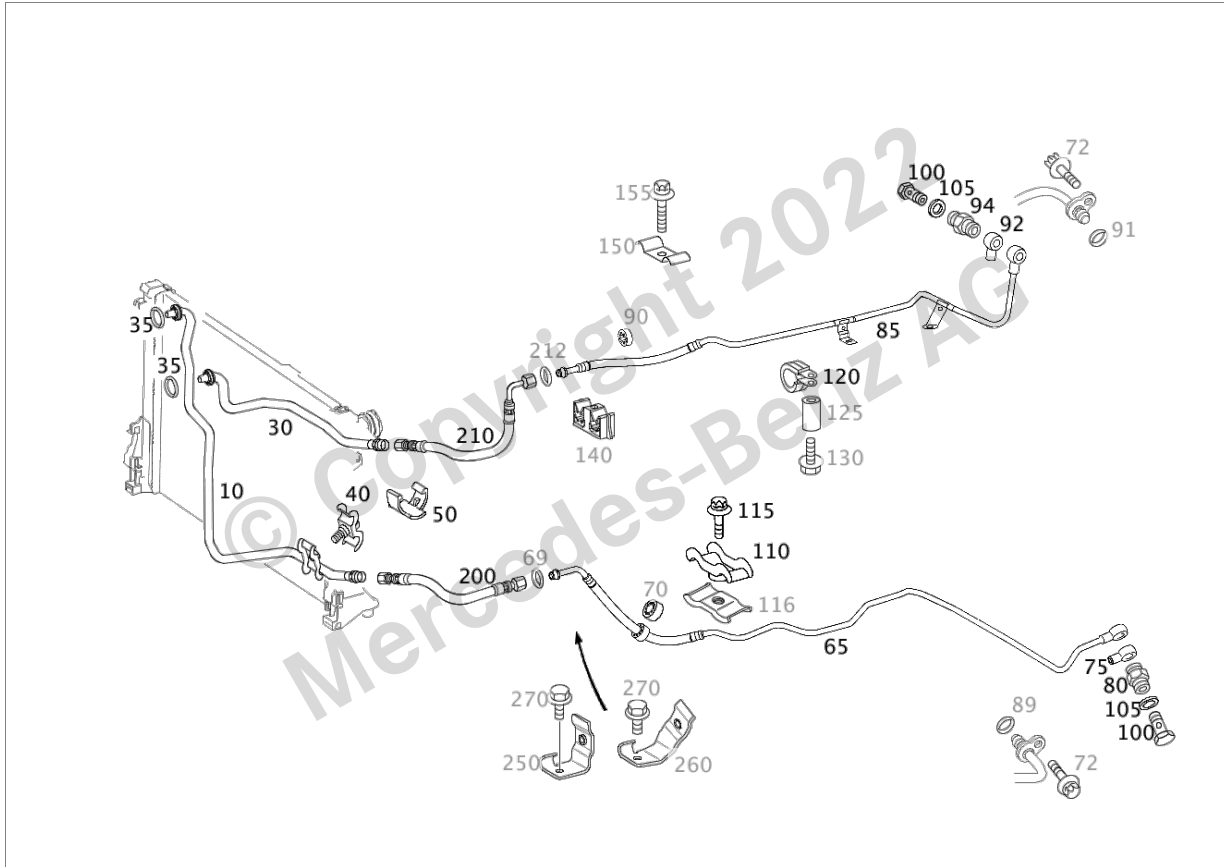






























Image ID: drawing_B50600000021

Item	Part number	Designation/additional information	Qty
10	A 211 270 05 27 	OIL LINE Upper  Code: M113/M273+M005/(M271/M647)+423/M648/M628/M272+917/M156+M63/M642+M013+(423/427)+M005;	1
30	A 211 270 00 27 	OIL LINE Lower  Code: (M113/M156+M63/M647/M648/M273/M271/M272+M012/M272+917/M642)+(423/427);	1
35	A 028 997 62 48	O-RING OIL LINE TO RADIATOR  Code: 423/427/917/M273/M156+M63/M629;	NB
40	A 000 995 20 32	CLAMP OIL LINE TO OIL LINE  Code: M113/(M271/M646+M010/M647/M648)+423/M273/M642+(423/427)/M156+M63;	1
50	A 012 988 04 78	CLAMP Oil line mount  Code: M113/M273/(M271/M647)+423/M648/M272+M012+(423/427);	2

Parts Information

Item	Part number	Designation/additional information	Qty
65	A 211 270 15 96	LINE Transmission to oil cooler, left  Code: M005+M113+423;	1
75	A 001 990 14 88	BANJO UNION Repair solution  Code: M005;	1
80	A 094 990 19 11	FITTING Torque converter housing  Code: M005;	1
85	A 211 270 16 96	LINE Transmission to oil cooler, right  Code: M005+M113+423;	1
92	A 001 990 14 88	BANJO UNION Repair solution  Code: M005;	1
94	A 094 990 19 11	FITTING Torque converter housing  Code: M005;	1
100	N 000000 004748	BANJO BOLT Oil line to torque converter housing  Code: (M112/M271/M272+M005/M642+M005)+423/M113+(M005/M001)/M273;	2
105	A 000 017 12 60	SEALING RING Oil line to torque converter housing; 14X18  Code: (M112/M271)+423/M113+(M005/M001/M50); Replaced by: A 000 271 11 60	4
105	A 000 271 11 60	SEALING RING Oil line to torque converter housing; 14X18  Code: (M112/M271)+423/M113+(M005/M001/M50); Replaces: A 000 017 12 60	4
110	A 000 995 20 32 	CLAMP Left oil line to right oil line  Code: M113+-M001;	2
115	N 000000 001114	HEXALOBULAR BOLT Clamp; M6X15  Code: M112+423/M113/M113+M001;	2
115	N 000000 001114	HEXALOBULAR BOLT Clamp to holder; M6X15  Code: M112+423/M113/M113+M001;	1
115	N 000000 001114	HEXALOBULAR BOLT Left and right oil line to oil pan; M6X15  Code: M112+423/M113/M113+M001;	2
115	N 000000 001114	HEXALOBULAR BOLT Left oil line to oil pan; M6X15  Code: M005;	3
115	N 000000 001114	HEXALOBULAR BOLT Right oil line to oil pan; M6X15  Code: M005;	2
120	N 000000 001045	CLAMP Left oil line to oil pan; 10/15  Code: M005/M005+M273;	3

Parts Information

Item	Part number	Designation/additional information	Qty
120	N 000000 001045	CLAMP Right oil line to oil pan; 10/15  Code: M005/M005+M273;	2
200	A 026 997 24 82	HOSE Connecting point to oil cooler  [402] NO LONGER AVAILABLE  Code: M005+M113+423;	1
210	A 000 180 00 82	HOSE Connecting point to oil cooler  Code: M005+M113+423;	1