


MODEL 204

MODEL 212 except CODE (224) Rear individual seat design

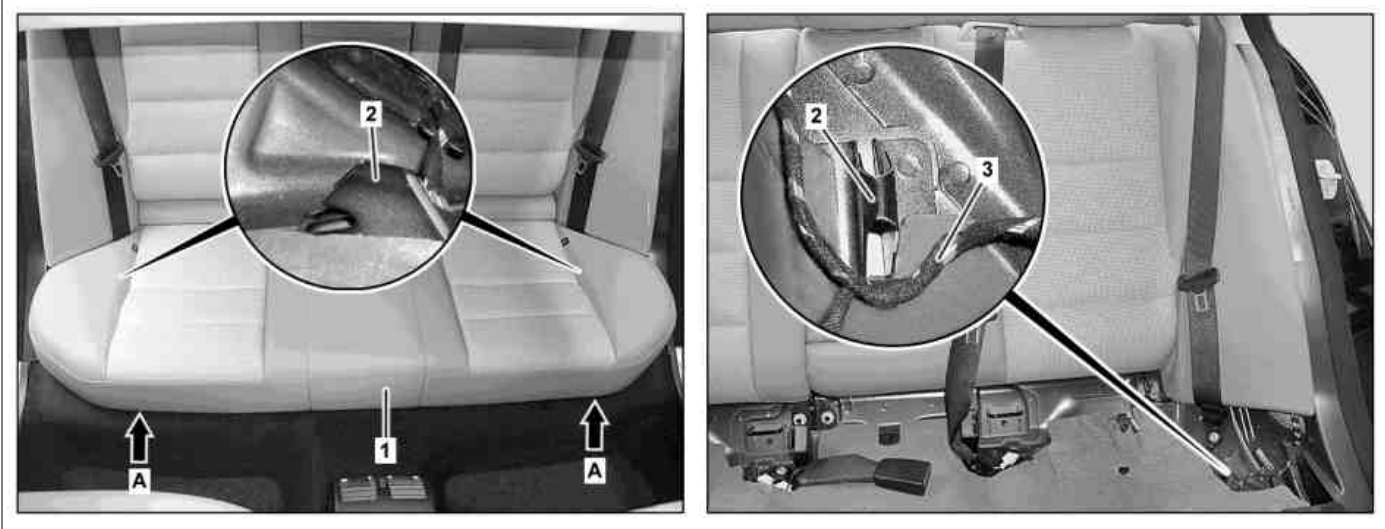

P91.12-3397-08


Shown on vehicle without code (248)

Rear seat with integrated child seat

1 Rear seat cushion

2 Mount

3 Wiring harness

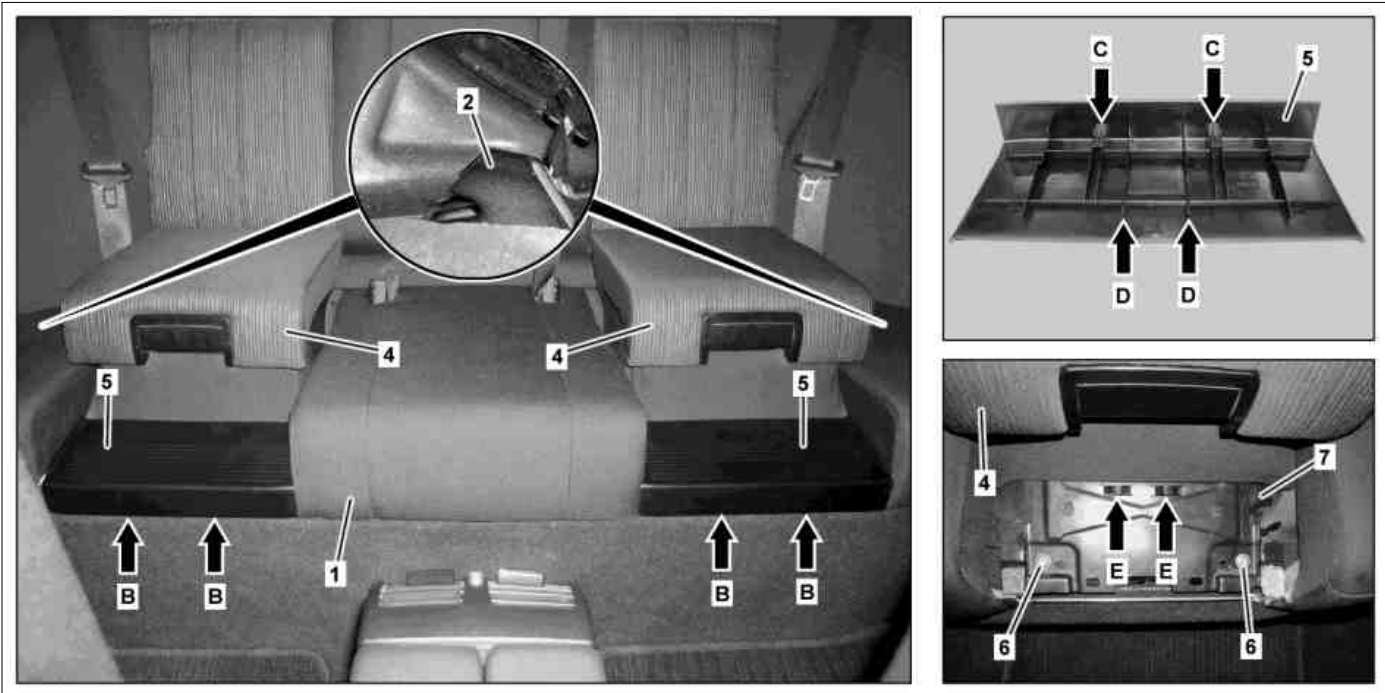

P91.12-3224-09

Shown on model 204.0 with code (248)

Rear seat with integral child seat

1 Rear seat cushion

2 Mount

4 Child seat cushions

5 Footrest


6 Screw

7 Seat frame

Model 212

1 Rear seat cushion

X54/11 Electrical connectors, heated cushion for left and right rear seat heaters (with code (872) Electric seat heater for left and right rear seats)

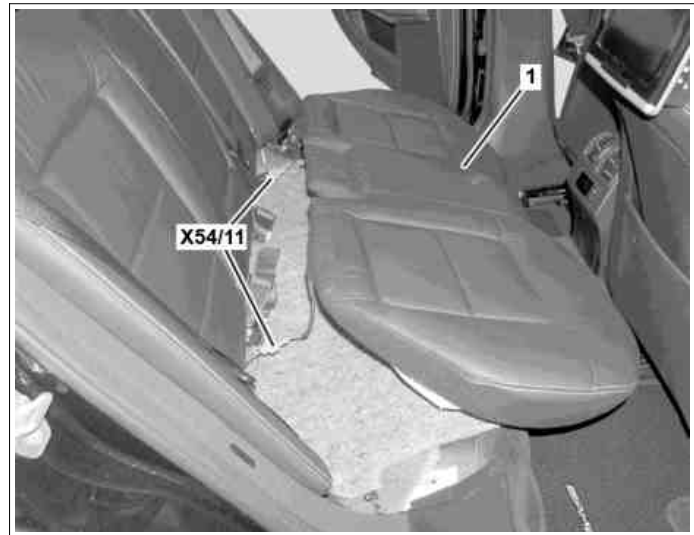

P91.12-3396-11

☒ ☒	Remove/install		
1	Move both front seats forwards		
2	Pull rear seat cushion (1) upwards out of the guide sleeves (arrows A)	For vehicles without code (248) Rear seat with integrated child seat ⚠ In model 212 with code (864) Rear entertainment system, do not drop rear seat cushion (1) when removing it in order to prevent damage to the DVD player.	
3	Extend child seat cushions (4)	For vehicles with code (248) Rear seat with integrated child seat	
4	Remove left and right footrests (5)	For vehicles with code (248) Rear seat with integrated child seat ⓘ At the marks (arrows B) on the footrests (5) insert a suitable screwdriver, alternately push back the catch hooks (arrows C), then remove the footrests (5) horizontally from the seat frame (7). ⓘ Installation: Insert guides (arrows D) of footrests (5) into the cutouts (arrows E) of the seat frame (7).	
5	Remove bolts (6) on left and right seat frame (7) of rear seat cushion (1)	For vehicles with code (248) Rear seat with integrated child seat Nm	*BA91.12-P-1010-03I
6	Remove DVD player paneling	Model 212 with code (864) Rear entertainment system	AR82.60-P-7505-01EW
7	Push rear seat cushion (1) far enough back to enable the retaining brackets on the bottom of the rear seat cushion (1) to be extended from the mounts (2)	ⓘ Installation: Check for correct seating of retaining brackets in mounts (2).	
8	Lead rear seat cushion (1) towards the front and disconnect electrical connectors from heated cushions for left and right rear seat heaters (X54/11)	Model 212 with code (872) Electric seat heaters for left and right rear seats	
9	Remove rear seat cushion (1)	⚠ Remove rear seat cushion (1) from the vehicle carefully, to avoid damage to components in the vehicle interior or on the rear doors. ⚠ Installation: Pay attention to the routing of the electrical wiring harness (3) in front of the holders (2), otherwise the electrical wiring harness (3) will be damaged. ⓘ Installation: Pay attention to position of center seat belt buckle.	
10	Install in the reverse order		

Nm Rear seats

Number	Designation	Model 204	Model 212

BA91.12-P-1010-03I	Bolt, rear seat cushion to body	Nm 8	10