Model 205

with code 345 (Windscreen wiper with rain sensor)

Model 213, 217, 222, 238, 253, 293

## Shown on model 222


1 Cover

2 Cover

3 Electrical connector4 Retaining clamp


B38/2 Rain/light sensor with additional

functions

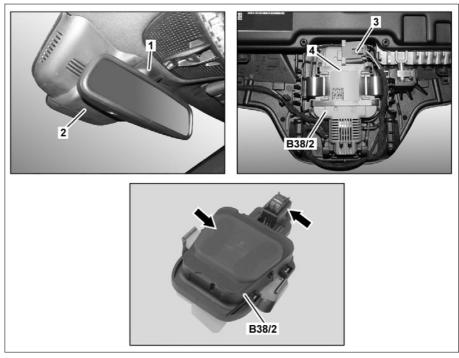

P82.30-3134-06

	Information on preventing damage to		AH54.00-P-0001-01A
	electronic components due to electrostatic discharge		
XX	Remove/install		
1	Switch off ignition and store transmitter key outside of transmission range (min. 2 m).		
2	Unclip and remove cover (1).	S Long wedge	*115589035900
3	Unclip and remove cover (2).	S Long wedge	*115589035900
4	Unhook retaining clamps (4) on both sides of rain and light sensor with additional functions (B38/2).		
5	Remove rain and light sensor with additional functions (B38/2) and disconnect electrical connector (3).	Do not touch surfaces (arrows) of rain/light sensor with additional functions (B38/2). Otherwise, soiling may cause the rain/light sensor with additional functions (B38/2) to malfunction.	
6	Install in the reverse order		
	Initial startup		
7	Perform commissioning of rain and light sensor with additional functions (B38/2).		
<b>⊯</b> AD		Model 293	AD00.00-P-2000-06FR
i≨ AD		Model 205 with code 345 (Windscreen wiper with rain sensor) Model 213, 217, 222, 253	AD00.00-P-2000-04B
<b>⊯</b> AD		Model 238	AD00.00-P-2000-06LWO

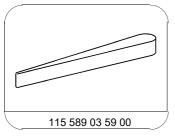

Long wedge