


MODEL 211

- 1 Cover
 2, 3 Electrical plug socket
 4 Detent
- F1 Fuse and relay box
 N47-5 ESP control unit

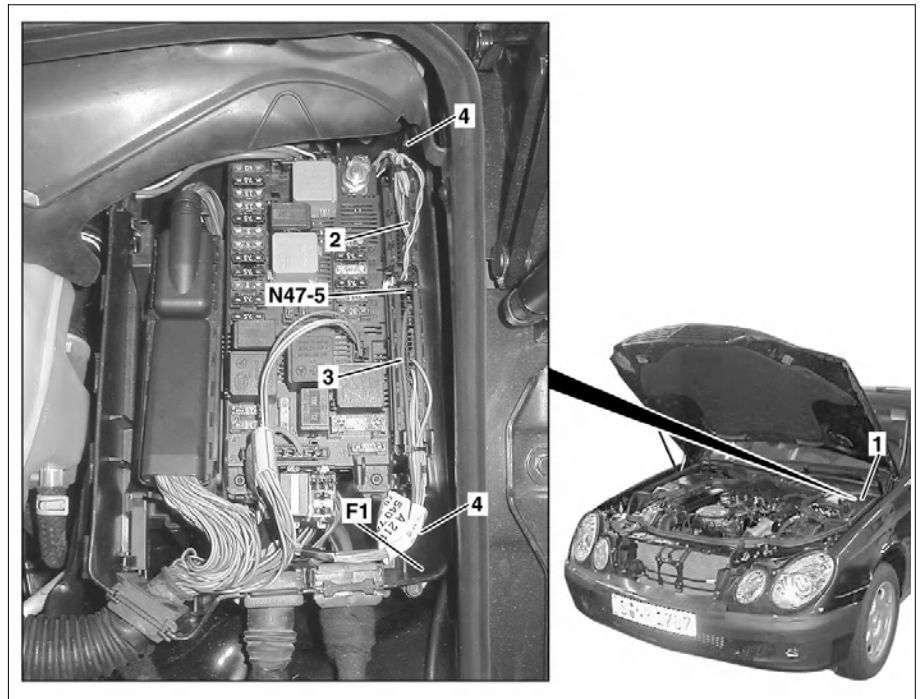

P42.45-2331-06

☒ ☒	Remove/install		
ⓘ	Notes on avoiding damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
1	Remove the left cover in the engine compartment	Vehicles as of 06/06	
2	Remove cover (1) of the fuse and relay box (F1)	i Installation: Check rubber seal in cover (1) and replace if necessary. The cover (1) must seat in the rear of the groove.	
3	Unlock and unplug electrical plug-in couplings (2, 3).		
4	Unlock the catches (4) and remove ESP control unit (N47-5) upwards.		
5	Install in the reverse order		
6	Read out diagnostic trouble code memory using STAR DIAGNOSIS and erase if necessary	STAR DIAGNOSIS diagnosis system	*WH58.30-Z-1048-13A

Commercially available tools

Number	Designation	
WH58.30-Z-1048-13A	STAR DIAGNOSIS diagnosis system, Compact Passenger Car	6511 1801 00