


Model 213.0/1

Model 238.3

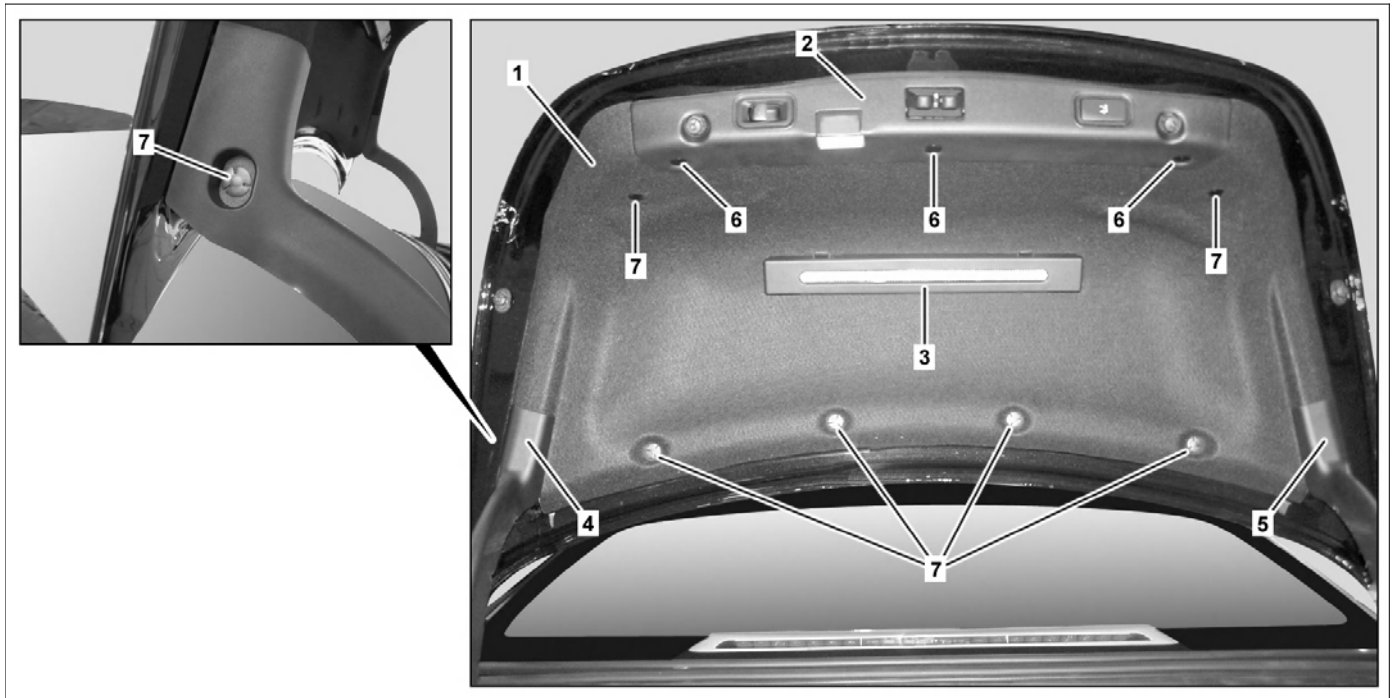

P68.30-3885-09

## Shown on model 213.0

1 Cover

2 Cover

3 Hazard warning triangle bracket


4 Hinge cover

5 Hinge cover

6 Mounting clip

7 Retaining clips

	<b>Risk of injury</b> caused by fingers being jammed or pinched when removing, installing or aligning hoods, doors, trunk lid/rear-end door or sliding roof.	No parts of the body or limbs should be within the operating area when the components are moving.	AS00.00-Z-0011-01A
<b>i</b>	Notes on sensor system for trunk lid opening/closing	Model 213.0/1, 238.3 with code P17 (KEYLESS-GO package)	AH80.61-P-0001-01A
<b>↔ ↔</b>	<b>Remove/install</b>		
1	Remove warning triangle (3) from warning triangle bracket		
2	Remove rear hazard warning triangle (3)	Clip remover	*452589016300
3	Unclip retaining clips (6)	Clip remover	*452589016300
4	Unclip paneling (2) and disconnect electrical connector	<b>i</b> The number of electrical connectors may vary depending on the equipment.	
5	Remove trim panel (2)		
6	Unclip retaining clips (7) from hinge covers (4, 5)	Clip remover	*452589016300
7	Unclip remaining retaining clips (7)		
8	Remove paneling (1) upward from hinge covers (4, 5)		
9	Install in the reverse order		

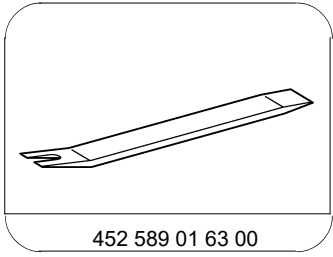

452 589 01 63 00

Clip remover