

AZ88.30-P-0003GY

Retrofit mud guards


4.7.08

MODEL 164.8

- 1 Expansion rivets
- 2 Front fender liner
- 5 Protective foil
- 6 Front mud guards



P88.30-2383-04

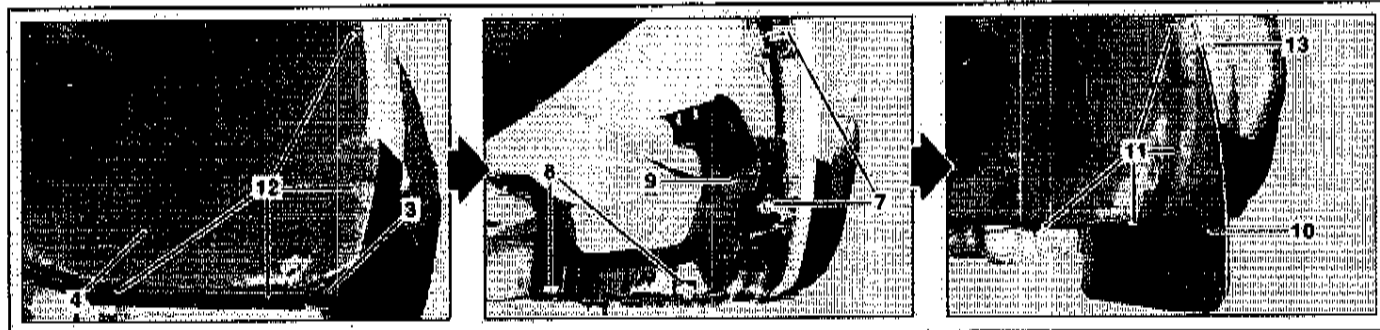

P88.30-2384-07

- 3 Larger expansion rivet
- 4 Rear inner fender
- 12 Expansion rivets
- 7 Sheet metal clips
- 8 Threaded clips
- 9 Bracket
- 10 Rear mud guards
- 11 Bolts
- 13 Protective foil

Modification notes

15.6.06	Step 1 revised	Page 2	
---------	----------------	--------	--

Step	Removal		
1	Move vehicle to ramp platform		
2	Remove expansion rivet (1) for front inner fender (2)	1 Only on vehicles without running board, code 846.	
3	Remove larger expansion rivet (3) and expansion rivets (12) for inner rear fender (4)	1 Reuse larger expansion rivets (3) Dispose of other expansion rivets (12).	
4	Installation of front fender flap	1 Only on vehicles without running board, code 846	
4	Clean all surfaces in installation area	Cleaner	*BR00.45-Z-1025-04A
5	Detach protective foil (5) over a length of 20 mm at the end of the bonding surface of the front mud guard (6).		
6	Install front mud guard (6) with expansion rivets (1)		
7	Remove protective foil (5) from bonding surface and press on front mud guard (6)	1 It is not possible to align the front mud guard again after sticking on.	
1	After installing the vehicle may not be driven for 24 h. Do not carry out any high pressure wash or machine wash for 48 h		
8	Installation of rear fender flaps		
8	Clean all surfaces in installation area	Cleaner	*BR00.45-Z-1025-04A
9	Install sheet metal clips (7) and threaded clips (8) on inner side of bumper and mount (9)		
10	Detach protective foil (13) over a length of 20 mm at the end of the bonding surface of the rear mud guard (10).		
11	Install rear mud guard (10) with bolts (11)		
12	Remove protective foil (13) from bonding surface and press on rear mud guard (10)	1 It is not possible to align the rear mud guard again after sticking on.	
13	Install larger expansion rivets (3)		
1	After installing the vehicle may not be driven for 24 h. Do not carry out any high pressure wash or machine wash for 48 h		