Model 253

with code 889 (KEYLESS-GO)


Model 253

with code 893 (KEYLESS-GO)

1 Electrical connector

2 Nut3 Bracket

N69/5 KEYLESS-GO control unit

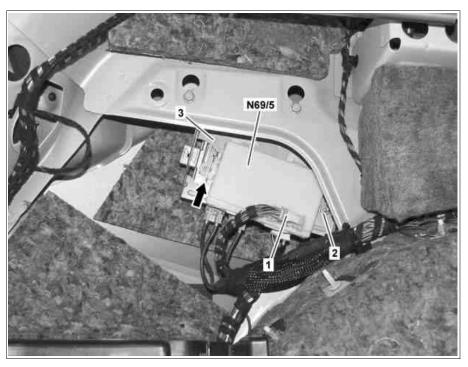

P80.61-2907-06

	Risk of injury caused by fingers being jammed or pinched when removing, installing or aligning hoods, doors, trunk lid/rear-end door or sliding roof.	No parts of the body or limbs should be within the operating area when the components are moving.	AS00.00-Z-0011-01A
(9)	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
i	Notes on sensor system for trunk lid opening/ closing		AH80.61-P-0001-01A
X	Remove/install		
1	Perform initial startup for KEYLESS-GO control unit (N69/5)	When replacing KEYLESS-GO control unit (N695).	
2	Remove left side load compartment lining		AR68.30-P-1180LWG
3	Release and disconnect electrical connection (1)		
4	Unscrew nut (2)		
5	Remove KEYLESS GO control unit (N69/5) from bracket (3)	i Installation: Ensure that KEYLESS-GO control unit (N69/5) is seated correctly in retaining bracket (arrow) on bracket (3).	
6	Install in the reverse order		