








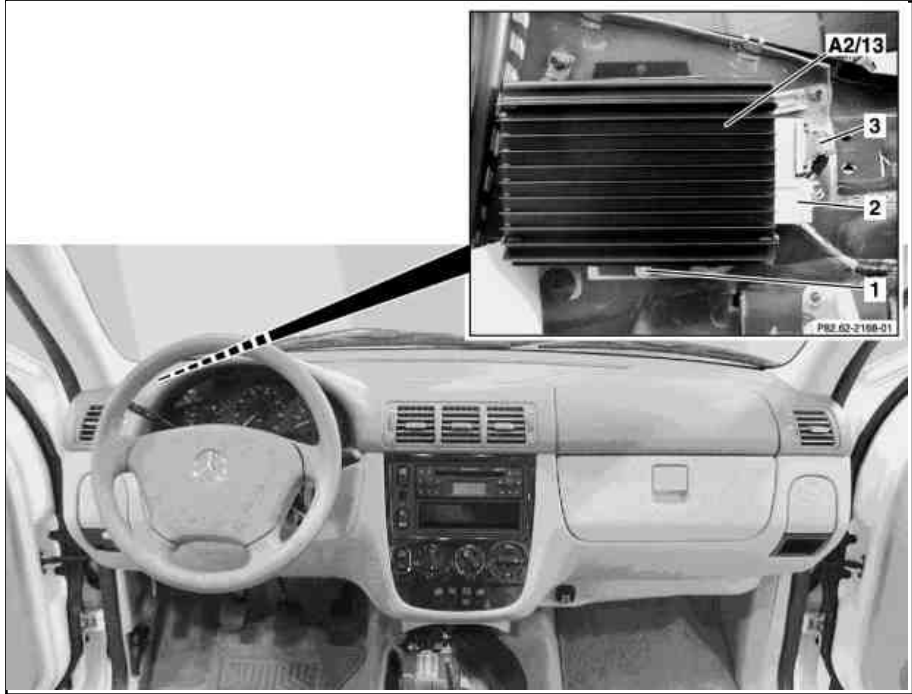

MODELS 163.113 /128 /136 /154 /157 /172 /175 with CODE (810) Sound system

MODEL 163.174

- 1 Bolt
- 2 Connector
- 3 Connector
- A2/13 Sound amplifier



P82.62-2169-06

	Remove/Install		
1	Remove cover below instrument panel on left side	<ul style="list-style-type: none">  Left-hand drive vehicle.  Right-hand drive vehicle. 	<p>AR68.10-P-1500GH</p> <p>AR68.10-P-1520GI</p>
2	Unscrew screw (1) and detach Sound amplifier (A2/13) from bracket	<ul style="list-style-type: none">  Lay insulation down to side. 	
3	Disconnect connector (2, 3)	<ul style="list-style-type: none">  As of VIN A289565, X754620: only one connector. 	
4.1	Disconnect conductive coupling D2B	<ul style="list-style-type: none">  Do not kink or stretch fiber optical cable. Press protective caps on conductive coupling and device connection.  As of VIN A289565, X754620. 	AR82.95-P-0005-01A
5	Remove Sound amplifier (A2/13)	<ul style="list-style-type: none">  Do not damage leads and insulation. 	
6	Install in the reverse order		