
SM47.20-P-0009A Check fuel filter 29.2.12

ENGINES 642 in MODEL 164, 166, 204, 207, 211, 212, 218, 221, 251


ENGINES 651 in MODEL 204, 207, 212 ENGINES 642 in MODEL 463

- Fuel filter
- Clip

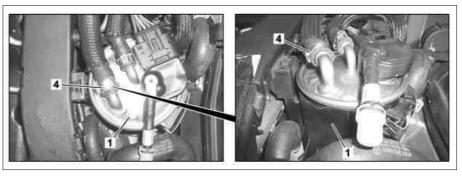

P47.20-2507-04

- Fuel filter
- Threaded connection 2
- Label Q16

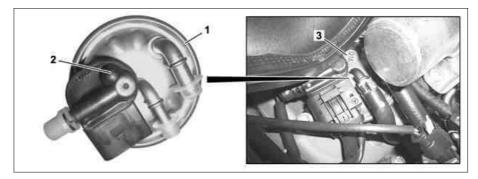

P47.20-2506-04

Operation no. of operation texts or standard texts and flat rates

Category	Op. no.	Operation text	Time	Acc. no.	Code
Р	027383	Check fuel filter			
Р	027384	Replace fuel filter			

i	Affected vehicles	Model 164 with engine 642	SM47.20-P-0010A
		Model 166 with engine 642	SM47.20-P-0010B
		Model 204 with engine 642	SM47.20-P-0010C
		Model 204 with engine 651	SM47.20-P-0010D
		Model 207 with engine 642	SM47.20-P-0010E
		Model 207 with engine 651	SM47.20-P-0010F
		Model 211 with engine 642	SM47.20-P-0010G
		Model 212 with engine 642	SM47.20-P-0010H
		Model 212 with engine 651	SM47.20-P-0010I
		Model 218 with engine 642	SM47.20-P-0010J
		Model 221 with engine 642	SM47.20-P-0010K
		Model 251 with engine 642	SM47.20-P-0010L
		Model 463 with engine 642	SM47.20-P-0010M
⚠ Danger!	No fire, sparks, open flames or smoking. Pour fuels only into suitable and appropriately marked containers. Wear protective clothing when handling fuel.	Risk of explosion caused by fuel igniting, risk of poisoning caused by inhaling and swallowing fuel and risk of injury to eyes and skin caused by contact with fuel	AS47.00-Z-0001-01A
4	Checking		
1	Threaded connection (2) of fuel filter	i If the threaded connection (2) is present of the fuel filter does not have a threaded connection but the adhesive label Q16 (3) is present: No further action is required. I If the threaded connection (2) is not present, proceed with operation step 2.	or
2	Replace fuel filter	On vehicles with engine 651, the clamp (4) must be positioned horizontally.	
		i Engine 642 in model 164	AP47.20-P-0780GZD
		i Engine 642 in model 166, 207, 212, 218	AP47.20-P-0780EWO
		i Engine 642 in model 204	AP47.20-P-0780CWX
		i Engine 642 in model 211	AP47.20-P-0780TI
		i Engine 642 in model 221	AP47.20-P-0780SXI
Daimler A.C. 5/23/10 1 /	01/18. sm47.20-p-0009a. Check fuel filter	1 3 3 2 12 111 1112 221 221	Page 1 o

i Engine 642 in model 251	AP47.20-P-0780RTD
i Engine 642 in model 463	AP47.20-P-0780GY
i Engine 651 in model 204	AP47.20-P-0780CWD
i Engine 651 in model 207, 212	AP47.20-P-0780EWD

Parts ordering notes

Part no.	Designation	Quantity
A 651 090 16 52 05	Fuel filter (engine 651)	1
A 642 090 53 52 05	Fuel filter (engine 642)	1
A 004 997 20 90	Hose clamp	1
A 006 997 18 90	Hose clamp	1