


**Model 217**  
with code 501 (360° camera)

### Modification notes

7.10.15	"Perform initial startup of front 360° camera using the diagnostic system" added.	Operation step 6	
---------	---	------------------	--

- 1 Electrical connector  
2 Cover  
B84/9 Front end 360° camera

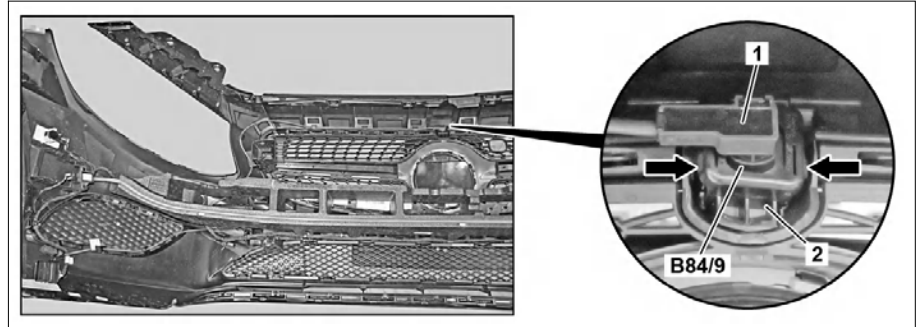

P54.33-3916-04

ⓘ	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
⊞ ⊞	<b>Remove/install</b>		
1	Remove front bumper		AR88.20-P-2000LC
2	Disconnect electrical connector (1)		
3	Release retaining lug (arrows) and unclip cover (2)		
4	Remove front 360° camera (B84/9)		
5	Install in the reverse order		
6	Commission front 360° camera (B84/9) using the diagnostic system	If the front 360° camera (B84/9) was replaced.	AD00.00-P-2000-04B
AD			
7	Calibrate front 360° camera (B84/9) using the diagnostic system		AD00.00-P-2000-04B
AD			