Model 117.3

Model 166, 172.4, 218

Model 212.0/2 Model 222 Model 242, 246

with code 362 (HERMES LTE) with code 460 (Canada version)

Model 242, 246

with code 362 (HERMES LTE) with code 494 (US version)

Model 242, 246

with code 536 (SIRIUS satellite radio)

Model 292


Repair materials

Number	Designation	Order number
BR00.45-Z-1012-07A	Primer stick	A 000 986 27 50
BR00.45-Z-1135-02A	Repair kit for installing windshields, 1-component adhesive	A 221 670 81 01

(i) In the event of damage, the bonding area on the body may only be repaired by using a primer stick, and it must be absolutely free of dust and grease.

Otherwise, paint adhesion problems may arise during adhesive bonding.

- Cut back any adhesive residue on the body using a suitable scraping tool, and remove any loose adhesive material.
 - Carefully cut back adhesive residue. Otherwise the paint can be damaged.
- Clean bonding area (1) at body with the cleaning cloth included in the repair kit and then wipe again using a dry cloth.
- 3 Touch up paint damage in bonding area (1) with primer stick.

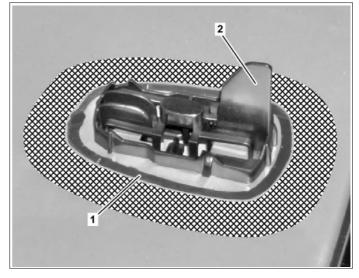

P82.62-3674-11