MODEL 216.386 MODEL 221.0 /1

with CODE (600) Headlamp cleaning system except CODE (487) Active Body Control (ABC)




P82.35-2463-07

- Washing water reservoir
- 2 Sealing ring
- 3 Gasket

M5/2 HCS [SRA] pump

XX	Remove/install		
1	Loosen washing water reservoir (1)		AR82.35-P-6000-01SX
2	Detach electrical connector on HCS [SRA] pump (M5/2)		
3	Detach washer fluid hose from the HCS [SRA] pump (M5/2)	i To pull off the washer fluid hose, press safety clamp. Collect washer fluid which flows out. i Installation: Install new seal ring (2).	
4	Unclip HCS [SRA] pump (M5/2) and remove	i Installation: Check gasket (3) and replace if necessary.	*110589035900
5	Install in the reverse order		
6 № AP	Fill washer fluid reservoir (1) Check windshield washing unit fluid level,		AP82.35-P-8210SX
, , , ,	top up if necessary		
7	Check windshield washer system for proper operation		
₩AP	Windshield wipers, windshield washer system and headlamp cleaning system - function check		AP82.30-P-8252SX

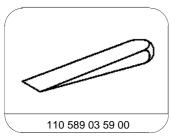

Mounting wedge