
AR77.20-P-1700SXRemove/install pop-up bracket on tilting/sliding roofMODEL221.0 with CODE (414) Power glass tilting/sliding roofMODEL221.1, 216.3

19.4.06

- 1 Water trough
- 2 Lock lever
- 3 Upper gate
- 4 Lower gate
- 5 Drive wedge
- 6 Lock lever spring

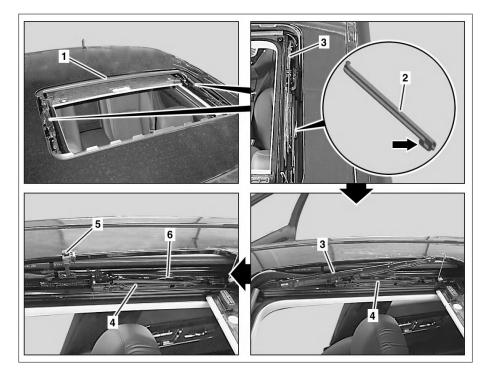

P77.20-2607-06

Modification notes


4.4.06	Method for removing locking lever completely modified	Steps 1 to 21	

24	Removing		
1	Remove tilting/sliding roof cover		AR77.20-P-1000SX
2	Move upper gate (3) to tilt position		
3	Unclip water trough (1) at side of sliding roof where the individual parts of the sliding roof mechanism are to be removed.	() Carefully unclip water trough to prevent damaging water trough (1).	
4	toward rear until rotation point of the drive	Never actuate sliding roof mechanical system electrically when lock lever (2) is released, to prevent damaging the sliding roof mechanical system.	*140589023300
5	Remove upper gate (3).	i Observe installation position of upper gate (3).	
6	Pivot drive wedge (5) upward and unclip		
7	Unhook lock lever spring (6)		
3	Slide lower gate (4) toward rear until lock lever (2) is exposed.		
Э	Unclip front lock lever (2) and slightly pull up.).	
10	Slide lower gate (1) toward front until rear end (arrow) of lock lever (2) is located on recess of guide rail.		
11	Remove lock lever (2).		
Х	Install		
12	Slide lower gate (4) toward rear and clip in front lock lever (2).		
13	Slide lower gate (4) toward front until rear end (arrow) of lock lever (2) arrests in recess on guide rail.		
14	Install lock lever spring (6).		
15	Lift lock lever (2) at rear end (arrow) with pulling hook and slide lower gate (4) toward rear until rotation point of drive wedge (5) is exposed.	Never actuate sliding roof mechanism electrically when lock lever (2) is released to prevent damaging the sliding roof mechanism	*140589023300
16	Clip in drive wedge (5) and pivot downward.		

17	Slightly grease sliding roof mechanical system and insert upper gate (3).	Klueber Polylub GLY 801 grease	*BR00.45-Z-1046-06A
18	Slide lower gate (4) toward front until lock lever (2) arrests audibly.	i Check whether lock lever (2) is arrested correctly.	
19	Clip in rain trough (1).		
20	Move upper gate (3) to tilting/sliding roof cover closed position		
21	Instal tilting/sliding roof cover		AR77.20-P-1000SX

Repair materials

Number	Designation	Order number
BR00.45-Z-1046-06A	Klueber Polylub GLY 801 grease	A 001 989 84 51

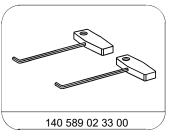

Pulling hook