26.07.2017


Model 217.3, 222 as of model year 2018

Shown on model 222 with code 582 (Rear air conditioning system) and code 897 (Wireless mobile phone charging)

5 Extraction hook



P68.10-5481-06

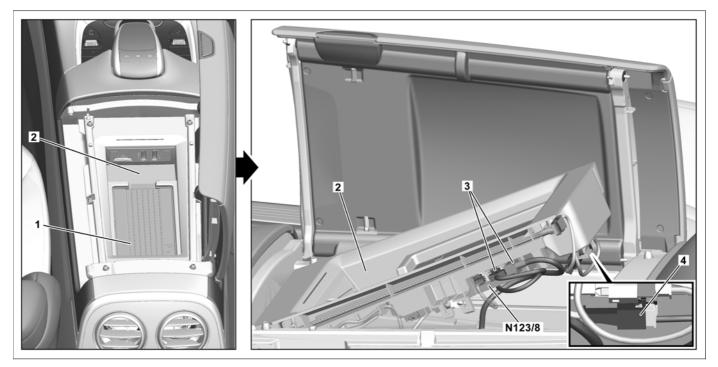


P82.70-7905-09

Shown on model 222 with code 582 (Rear air conditioning system) and code 897 (Wireless mobile phone charging)

1	Rubber mat	4	Electrical connector
2	Stowage compartment	N123/8	Mobile phone cradle control unit
3	Electrical connector		

Shown on model 222 except code 582 (Rear air conditioning system) and with code 897 (Wireless mobile phone charging)

1	Rubber mat
2	Stowage compartment
3	Electrical connectors
N123/8	Mobile phone cradle control unit

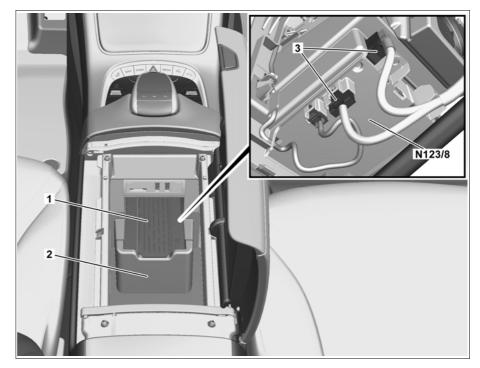

P82.70-7902-06

	Notes on avoiding damage to optical fibers during repair work		AH82.60-P-0001-05AK
	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
XX	Remove/install		
1	Remove multimedia connection unit in front stowage compartment		AR82.60-P-1032LFM
2	Remove rubber mat (1)		
3	Insert extraction hook (5) in opening (arrow)	Model 222 as of model year 2018 with code 582 (Rear air conditioner)	
		S Extraction hook	*140589023300
4.1	Unclip stowage compartment (2) using the extraction hook (5)	Model 222 as of model year 2018 with code 582 (Rear air conditioner)	
		S Extraction hook	*140589023300
4.2	Unclip stowage compartment (2)	Model 217.3 as of model year 2018 Model 222 as of model year 2018 except code 582 (Rear air conditioner)	*****
		S Mounting wedge	*110589035900
5	Release and disconnect electrical connections (3)	Model 217.3, 222 as of model year 2018 with code 897 (Wireless mobile phone charging) Model 217.3, 222 as of model year 2018 with code 899 (Multifunction telephony)	
6	Remove chafe protection and release and disconnect electrical connection (4)	Model 222 as of model year 2018 with code 582 (Rear air conditioner)	
7	Remove stowage compartment (2)		
8	Install in the reverse order		

