


MODEL 222
with CODE P46 (Individual Entertainment in the rear)
without CODE 224 (First-Class rear compartment)

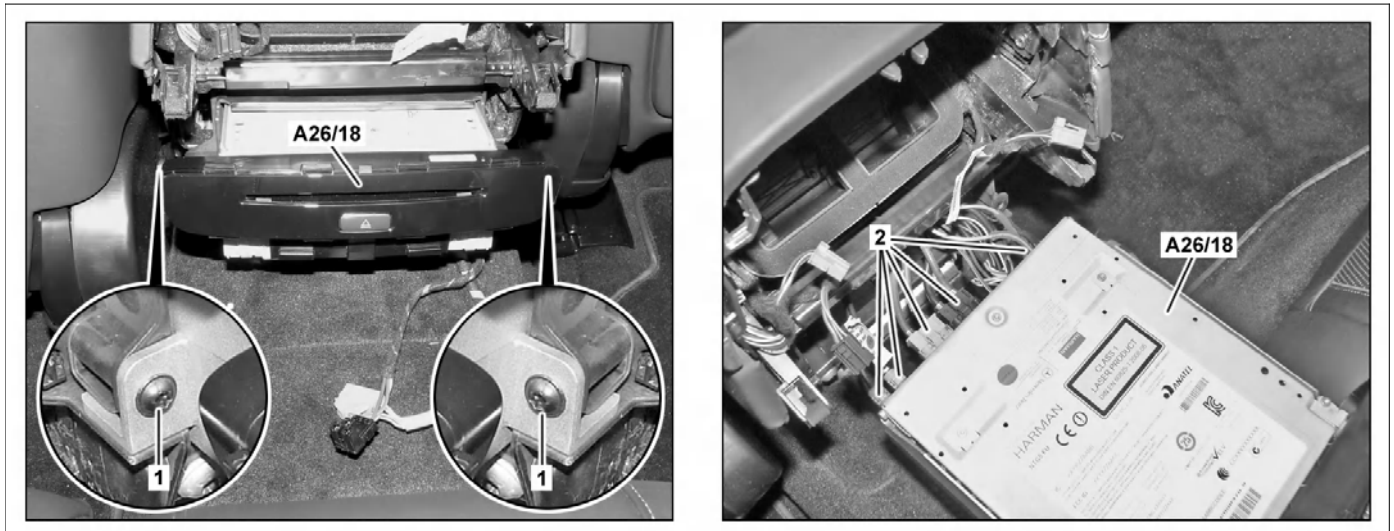

P82.60-9191-08

- 1 Screw
 2 Electrical connectors

A26/18 Rear entertainment controller unit

ⓘ	Notes on avoiding damage to optical fibers during repair work		AR82.60-P-0001-05AK
ⓘ	Information on preventing damage to electronic components due to electrostatic discharge		AR54.00-P-0001-01A
⊞ ⊞	Remove/install		
1	Connect Star Diagnosis and perform commissioning of Rear Seat Entertainment system controller unit (A26/18)	When replacing Rear Seat Entertainment system controller unit (A26/18).	
2	Switch off ignition and remove transmitter key from electronic ignition lock control unit		
3	Remove cover on center console	MODEL 222.0/1 with CODE P46 (Individual Entertainment in the rear) without CODE 224 (First-Class rear compartment)	AR68.20-P-2350LF
4	Remove bolts (1)		
5	Guide Rear Seat Entertainment system controller unit (A26/18) out of center console until electrical connectors (2) are accessible		
6	Separate electrical connectors (2)		
7	Remove Rear Seat Entertainment system controller unit (A26/18) from vehicle		
8	Install in the reverse order		