


MODEL 217
MODEL 222

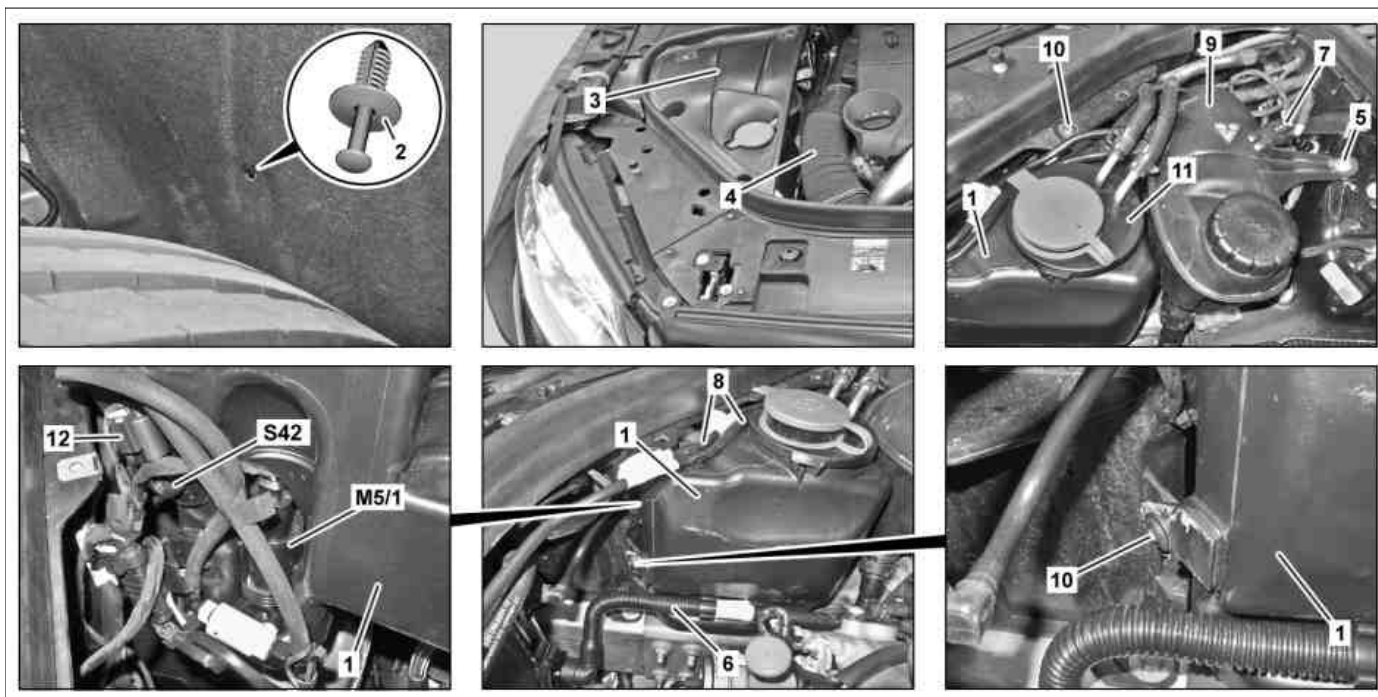


P82.35-2736-09

Shown on MODEL 222 with CODE 874 (MAGIC VISION CONTROL, heated)

- | | | | | | |
|---|--|----|-----------------------------|------|---|
| 1 | Washer fluid reservoir | 6 | Coolant line | 11 | Heat exchanger (with CODE 874 (MAGIC VISION CONTROL, heated)) |
| 2 | Expansion rivet | 7 | Electrical connector | 12 | Electrical connector |
| 3 | Cover | 8 | Coolant lines | M5/1 | Windshield washer system pump |
| 4 | Intake air duct upstream of air filter | 9 | Coolant expansion reservoir | S42 | Windshield washer system washer fluid level switch |
| 5 | Screw | 10 | Screw | | |


	Risk of death caused by vehicle slipping or toppling off of the lifting platform.	Align vehicle between vehicle lift columns and position the four support plates at the vehicle lift support points specified by the vehicle manufacturer.	AS00.00-Z-0010-01A
	Remove/install		
2	Raise vehicle		
3	Remove expansion rivet (2) from right front fender liner	Clip remover	*452589016300
4	Open engine hood		
5	Remove right intake air duct upstream of air filter (4)		
6	Remove cover (3)		
7	Unclip coolant line (6) from washer fluid reservoir (1)		
8	Unclip coolant lines (8) from washer fluid reservoir (1)		
9	Disconnect electrical connector (7)		
10	Remove screw/bolt (5)		
11	Unclip coolant expansion reservoir (9) from the supports and place to one side with connected coolant lines (8)		
12	Remove screws/bolts (10)		
13	Raise washer fluid reservoir (1) far enough until the windshield washer system pump (M5/1) is accessible		

14	Remove windshield washer system pump (M5/1) from washer fluid reservoir (1) and place to one side with connected electrical line and washer fluid hose	<input type="checkbox"/> Collect washer fluid which flows out. <input type="checkbox"/> Installation: Replace seal. <input checked="" type="checkbox"/> Mounting wedge	*110589035900
15	Remove infrared camera washer fluid pump from the washer fluid reservoir (1) and place to one side with connected electrical line and washer fluid hose	MODEL 217, 222 with CODE 610 (Night View Assist Plus) <input type="checkbox"/> Installation: Replace seal. <input checked="" type="checkbox"/> Mounting wedge	*110589035900
16	Disconnect electrical connection (12)		
17	Remove heat exchanger (11) from washer fluid reservoir (1) and place to one side with connected coolant lines	MODEL 217 MODEL 222 with CODE 874 (MAGIC VISION CONTROL, heated)	
18	Take off washer fluid reservoir (1)		
19	Remove switch for windshield washer system washer fluid level (S42) from washer fluid reservoir (1)	When replacing the washer fluid reservoir (1).	
20	Install in the reverse order		
21	Fill washer fluid reservoir (1)		
AP			AP82.35-P-8210HA

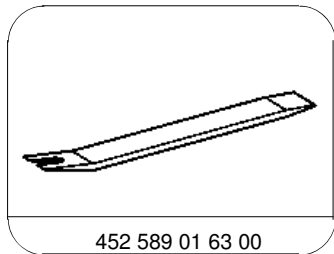

452 589 01 63 00

Clip remover

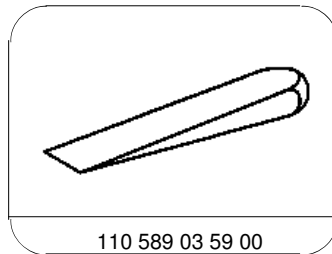

110 589 03 59 00

Mounting wedge