
MODEL 129

Screw
Clip
Screw

M10/3 Left front power window motor M10/4 Right front power window motor

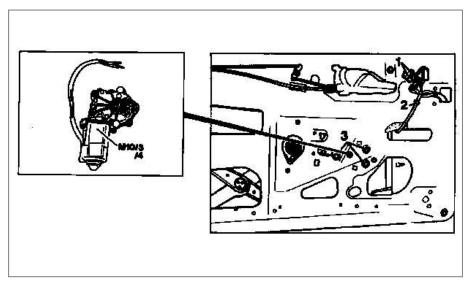

P72.29-2029-05

XX	Removal, installation		
1	Remove door liner		ra72001290100x
2	Close side windows		
3	Disconnect connector from loudspeaker		
4	Remove loudspeaker with mount		
5	Remove air duct		
6	Loosen door foil in front and lower area	i Installation: Replace damaged door foil.	
7	Remove power window motor (M10/3, M10/4)	Nm (c)	*BA72.29-P-1001-01A
		Protect power window motor from falling	
		Li Unscrew screws (1), unclip clips (2) and	
		unscrew screws (3).	
		linstallation: Grease gear on motor lightly.	
		When installing observe hole pattern for	
		mounting.	
8	Install in opposite order		

Nm Electrical equipment in side doors

Number	Designation		Model 129
BA72.29-P-1001-01A	Screw for power window motor in front door	Nm	9