


MODEL 230.4 up to 28.1.08
 except CODE (809) Model year 2009
 with CODE (813) Voice control system (VCS [SBS])

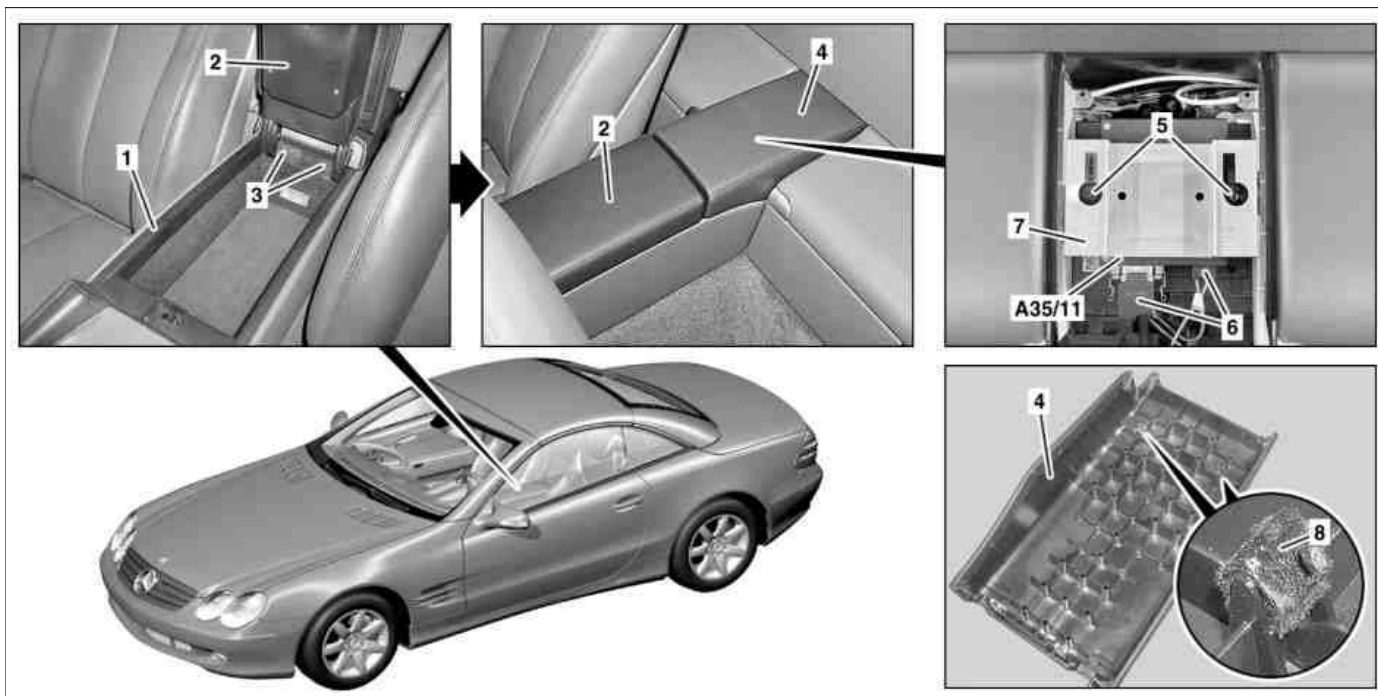

P82.70-6152-09

- 1 Stowage box
- 2 Cover
- 3 Bolts
- 4 Cover

- 5 Bolts
- 6 Plug connections
- 7 Control unit bracket
- 8 Retaining clamp

A35/11 Voice control system control unit

☒ ☒	Remove/install		
1	Switch off the ignition and remove the transmitter key from the EIS control unit	i On vehicles with code (889) Keyless-Go, press Keyless-Go start/stop button repeatedly until ignition is switched off. Remove Keyless-Go chip card or transmitter key from vehicle and store beyond transmission range of transmitter (min. 2 m).	
2	Open cover (2) of stowage box (1)		
3	Remove bolts (3)		
4	Close cover (2) of stowage box (1)		
5	Take off cover (4)	i Installation: Ensure retaining clamps (8) in the control unit bracket (7) are seated correctly.	
6	Remove bolts (5)		
7	Disconnect connectors (6) from voice control system control unit (A35/11)	! To avoid damaging them, do not kink fiber optic cables, route over sharp edges or bend in radii smaller than 25 mm.	
8	Cover fiber optic cable connector and equipment connector at voice control system control unit (A35/11).	i The right connector (6) shown is a fiber optic cable connector.	AR82.95-P-0005-01A
9	Push voice control system control unit (A35/11) to the rear and remove from control unit bracket (7)		
10	Install in the reverse order		