


# Mercedes 722.6

# sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA  
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

## 1 68942-10K TC Lockup Clutch Regulator Valve Kit

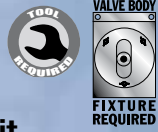

Helps cure:

- Converter apply & release complaints
- Converter codes
- Lube failures


Note: Requires tool kit F-68942-TL10 & the VB-FIX reaming fixture.

## 2 68942-23K TCC Damper Valve & Sleeve Kit

Helps cure:

- Harsh lockup

## 3 68942-16 Oversized Manual Valve

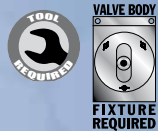


Helps cure:

- Reduced line pressure
- Delayed engagements

Note: Requires tool kit F-68942-TL16 & the VB-FIX reaming fixture.

## 4 68942-07K Pressure Regulator Valve Kit

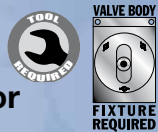


Helps cure:

- Loss of 2-3, 4-3 neutral
- Soft shifts under acceleration

Note: Requires tool kit F-68942-TL7 & the VB-FIX reaming fixture.

## 5 68942-06 Outer Pressure Regulator Sleeve

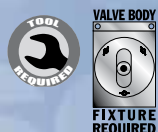

Repairs outer bore only

Helps cure:

- Loss of 2-3, 4-3 neutral
- Soft shifts under acceleration

Note: Requires tool kit F-68942-TL6 & the VB-FIX reaming fixture.

## 6 68942-17K Oversized Regulating Valve Pressure Control Valve Kit




Early & Late Units

Helps cure:

- Delayed engagements
- Upshift/Downshift flares

Note: Requires tool kit F-68942-TL14 & the VB-FIX reaming fixture.

## 7 68942-14K Lubricating Pressure Control Valve Kit

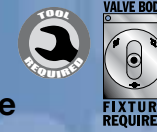


Helps cure:

- Delayed engagement
- Poor performance/higher stall speeds

Note: Requires tool kit F-68942-TL14 & the VB-FIX reaming fixture.

## 8 68942-19K 1-2, 4-5 Overlap Control Valve Kit

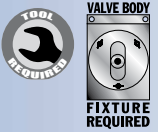


Helps cure:

- Harsh/Flare/Cycling of 1-2/4-5 shifts
- Slipping Gears

Note: Requires tool kit F-68942-TL19 & the VB-FIX reaming fixture.

## 9 68942-27K 2-3 Overlap Control Valve Kit

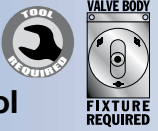


Helps cure:

- Harsh/Bumpy/Flare 2-3 shifts
- Slipping gears

Note: Requires tool kit F-68942-TL27 & the VB-FIX reaming fixture.

## 10 68942-31K 3-4 Overlap Control Valve Kit

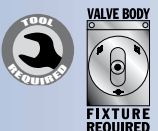

Helps cure:

- Harsh/Bumpy/Flare 3-4 shifts
- Slipping gears

Note: Requires tool kit F-68942-TL31 & the VB-FIX reaming fixture.

## 11 68942-05K Overlap Control Valve Sleeve Kit

This kit fits 3 locations!  
(Parts also sold separately)

Helps cure:

- Harsh/Bumpy/Flare shifts
- Slipping gears

## 12 68942-01 Solenoid Pressure Regulator Spring

'99-Earlier Units

Helps cure:

- Delayed engagements
- Flare 2-3, 3-4 or 4-5 shifts

