


Model	204.0 (except 204.077), 204.2 (except 204.277), 204.3 with code 409 (Left/right front multicontour seat)
Model	207, 212, 218 with code 409 (Left/right front multicontour seat)
Model	463.202/236/237 as of model year 2010 up to model year 2013 with code SM7 (Left front multicontour seat) with code SM8 (Front passenger multicontour seat)
Model	463.222/270/271/303/340/341 as of model year 2010 up to model year 2013 with code SM7 (Left front multicontour seat) with code SM8 (Front passenger multicontour seat)
Model	463.242 as of model year 2013 up to model year 2015 with code S52 (Left/right individual seats in rear with seat heater)
Model	463.306/336 as of model year 2010 up to model year 2013 with code SM7 (Left front multicontour seat) with code SM8 (Front passenger multicontour seat)
Model	463.346 as of model year 2010 up to model year 2013 with code SM7 (Left front multicontour seat) with code SM8 (Front passenger multicontour seat) /FACELIFT 2012

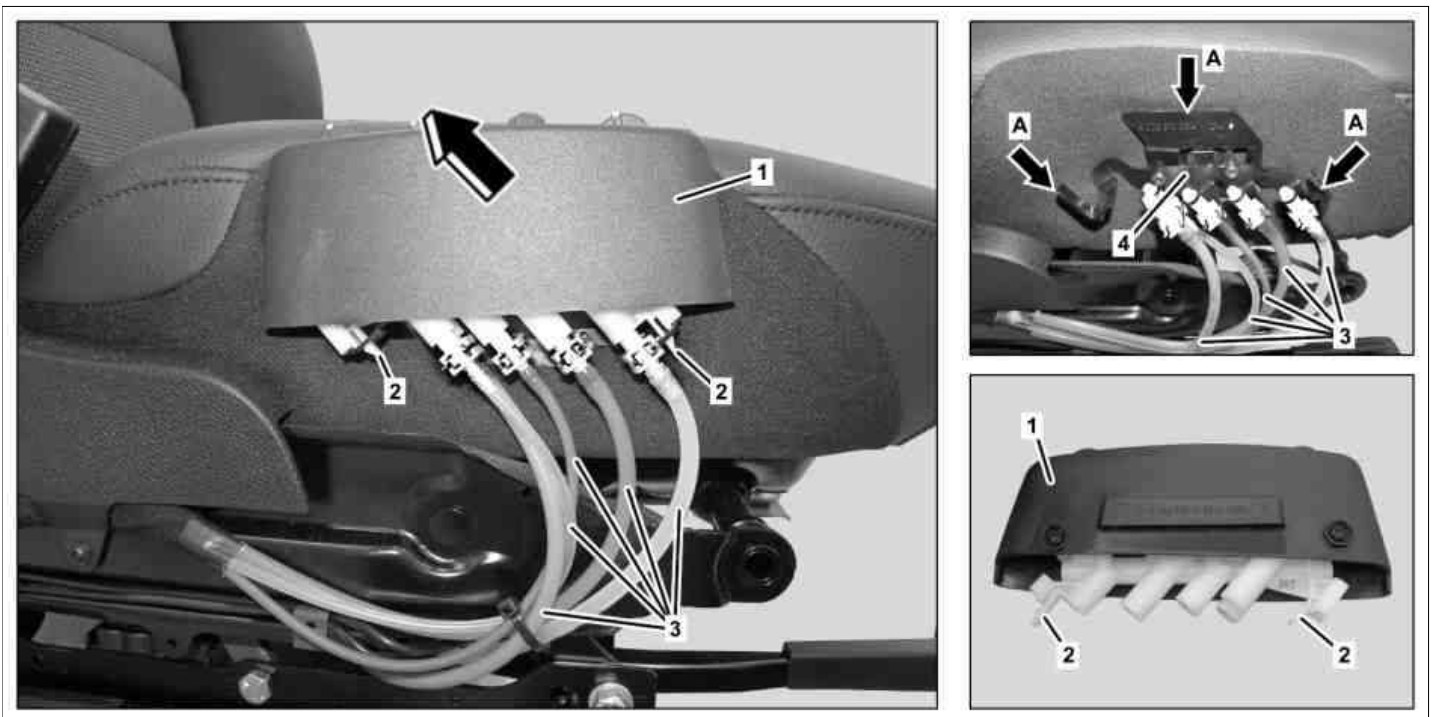

P91.25-2419-09

Shown on model 204, on removed left front seat

- | | |
|-----------------|-------------------|
| 1 Control valve | 3 Pneumatic lines |
| 2 Catch hook | 4 Bracket |



Remove/install

1	Push both catch hooks (2) inwards, while at the same time pulling the control valve (1), as shown, upwards at an angle out of the holder (4) and the pneumatic lines (3) and remove	i Installation: Check sealing rings of pneumatic lines (3) for damage, replace if necessary. Ensure that control valve (1) is correctly seated in the guides (arrows A) of the bracket (4).	
2	Install in the reverse order		