


MODEL 203, 209.3 /4 with TRANSMISSION 722.6

MODEL 203, 209.3 with TRANSMISSION 716.6 with CODE (424) Sequentronic automated manual transmission (SEQ)

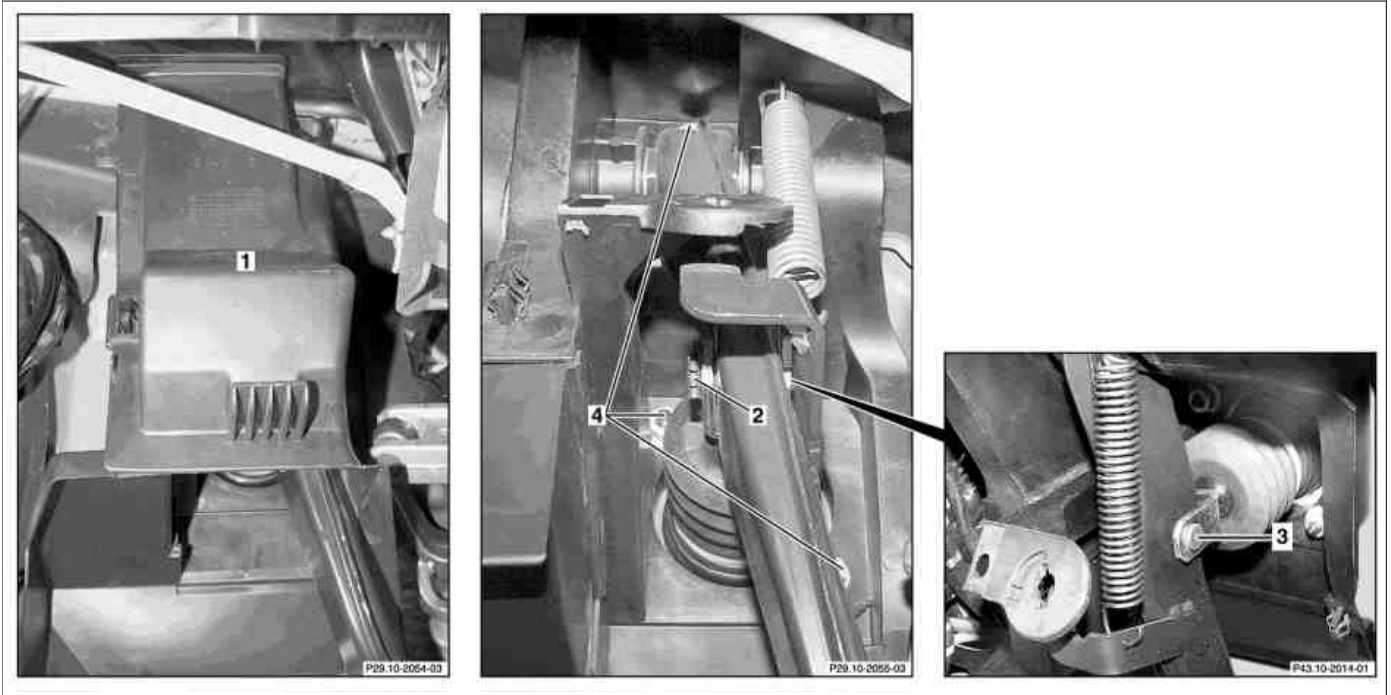

P29.10-2053-09

Illustrated on model 209.4

- 1 Cover
- 2 Securing clamp

- 3 Pin
- 4 Nuts

Remove/install			
Notes on self-locking nuts and bolts	All models		AH00.00-N-0001-01A
1 Remove cover below dashboard (left)			AR68.10-P-1500P
2 Remove noise absorber			
3 Remove cover (1)			
4 Pry locking clip (2) off bolt (3)			
5 Pull out pin (3)	<ul style="list-style-type: none"> i Check bolt (3) for damage and wear and replace if necessary. i Installation: Grease bolt (3) lightly. 		*BR00.45-Z-1001-06A
6 Unscrew nuts (4)	Nm		*BA43.10-P-1002-01A
7 Remove pedal assembly	i Do not damage wiring harness.		
8 Install in the reverse order			

Nm Pneumatic brake booster

Number	Designation		Model 203	Model 209
BA43.10-P-1002-01A	Nut, brake booster carrier to front end	Nm	20	20

Repair materials

Number	Designation	Order number
BR00.45-Z-1001-06A	Long-life grease	A 000 989 63 51 11