
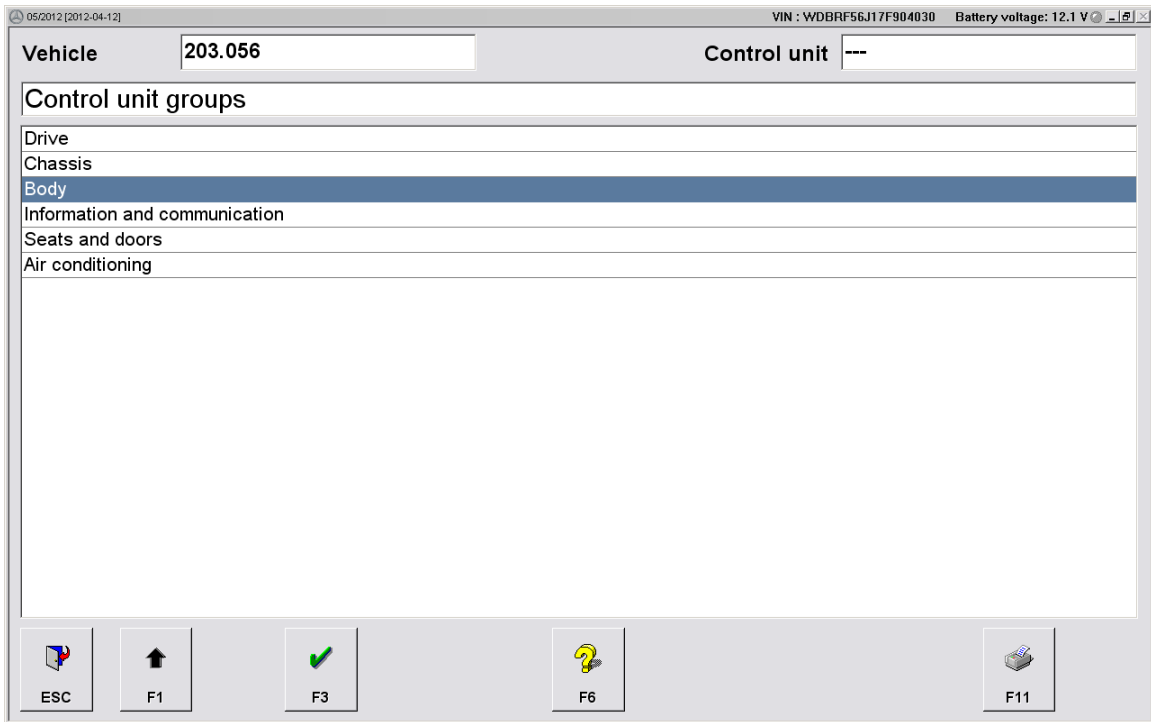


Step by step menu selections in Star DAS for activating Sunroof Rain closing.

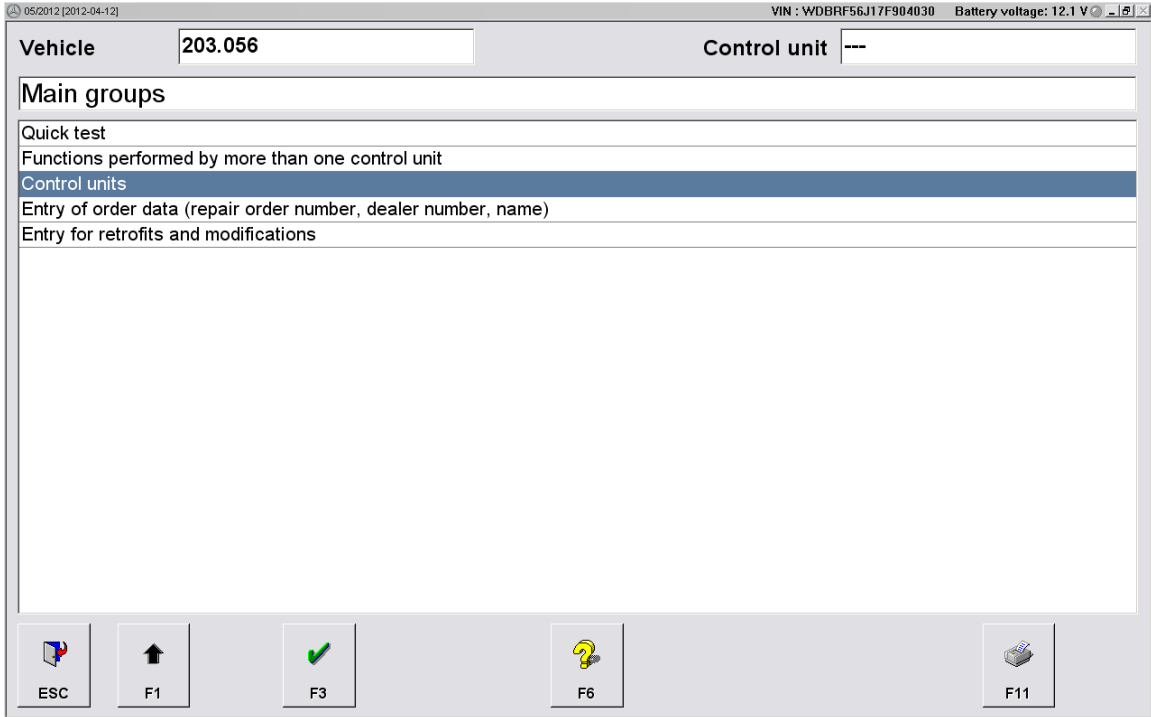

05/2012 [2012-04-12] VIN : WDBRF56J17F904030 Battery voltage: 12.1 V

Vehicle Control unit

Body

- CGW - Central gateway
- EZS - Electronic ignition switch
- AB - Airbag
- WSS - Weight sensing system (USA)
- SAM-F - Signal acquisition and actuation module front
- REAR SAM - Rear signal acquisition and actuation module
- HRA-FL - Front left headlamp range control
- HRA-FR - Front right headlamp range control
- OCP - Overhead control panel**
- UCP - Upper control panel
- LCP - Lower control panel
- On-board electrical system (voltage supply)
- AHE - Trailer recognition
- MSS - Special vehicle multifunction control module
- System diagnosis

ESC F1 F3 F6 F11

05/2012 [2012-04-12] VIN : WDBRF56J17F904030 Battery voltage: 12.1 V

Vehicle Control unit

Overhead control panel

- Control unit version
- Fault codes
- Events
- Actual values
- Actuations
- Initial startup
- Control unit adaptations
- Complete list of guided tests
- Full list of fault codes and events
- Development data**
- Service information

ESC F1 F3 F6 F11

05/2012 [2012-04-12] VIN : WDBRF56J17F904030 Battery voltage: 12.1 V

Vehicle Control unit

Main menu of control module DBE2

- Control unit version
- Fault memory
- Actual values
- Actuations
- Control unit adaptations**
- Entry of service data (API1)

ESC F1 F3 F6 F11

05/2012 [2012-04-12] VIN : WDBRF56J17F904030 Battery voltage: 12.1 V



Vehicle Control unit

Control unit adaptations

Read coding and/or transfer download data to new control unit.

- Control unit adaptations (Variant coding)
- Control unit adaptations (Download)**

ESC F1 F3 F11

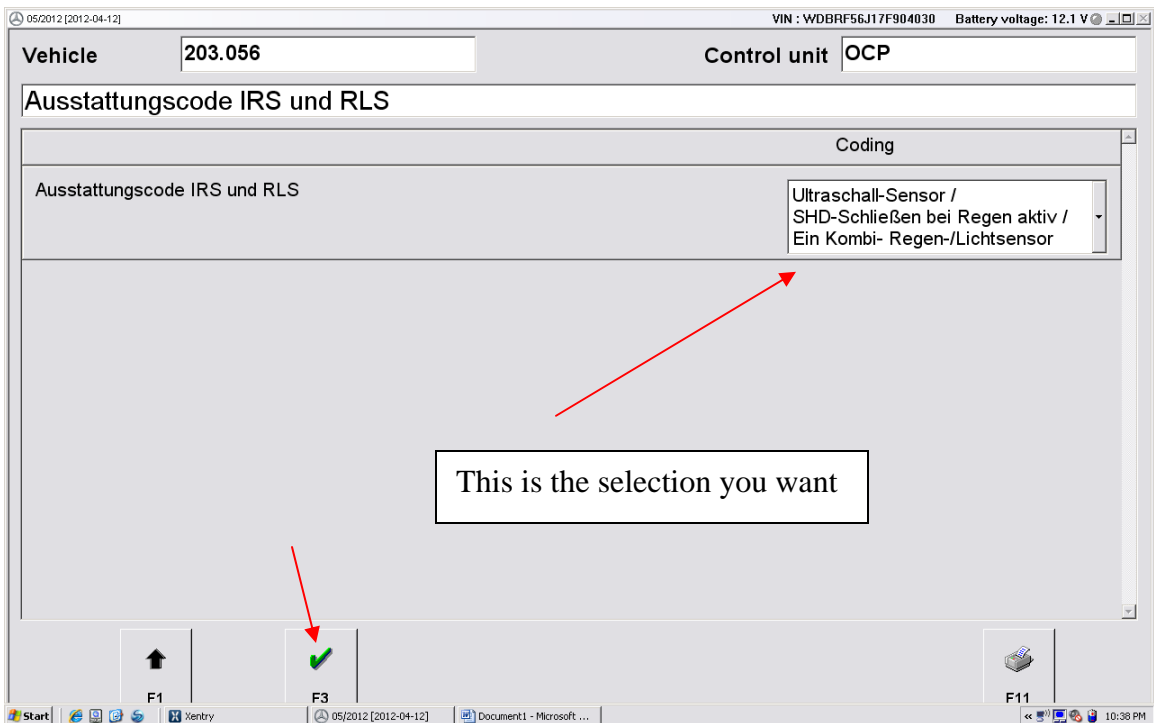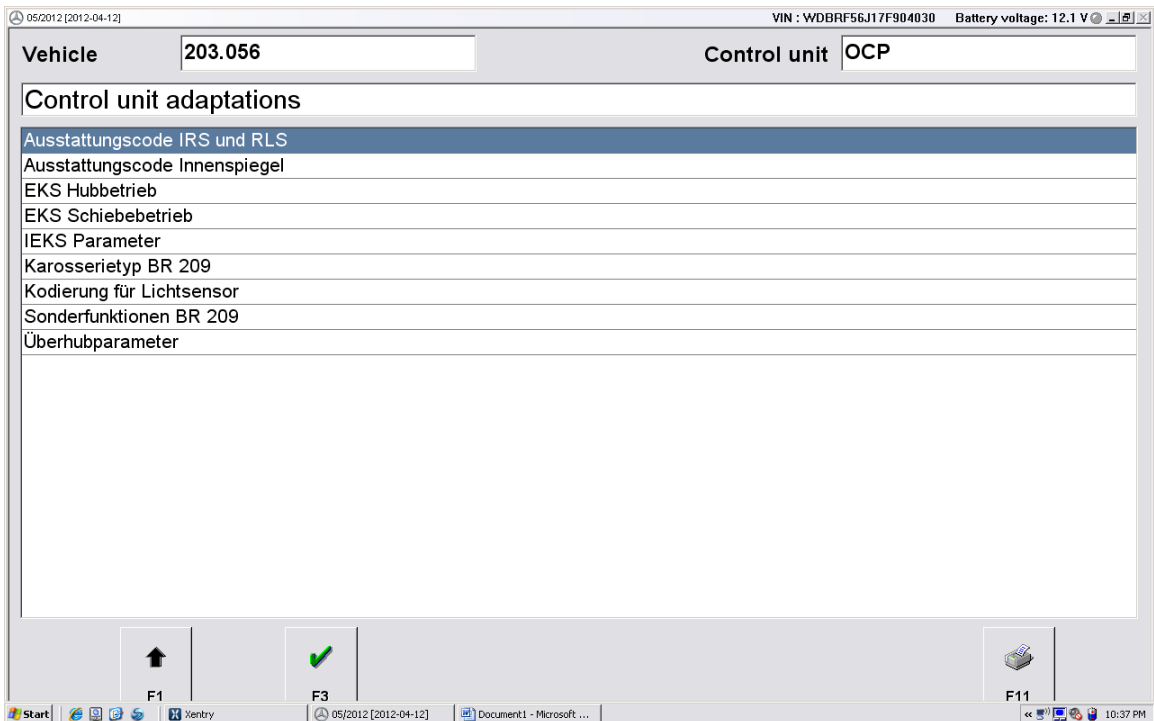

Translated – this selection is:

“Equipment code IRS and RLS ultrasonic sensor / SHD close at active rain a Combi - rain / light sensor”

If this creates an error because you don't have the Interior Motion Sensor (Ultrasonic) you can try the setting “Regenschließen des Schiebehebbedachs” which kinda translates to “Rain closed the sliding lifting roof”

05/2012 [2012-04-12] VIN : WDBRF56J17F904030 Battery voltage: 12.1 V

Vehicle Control unit

Ausstattungscode IRS und RLS

Is the coding to be transferred to the control unit?

