


AR77.21-P-0100LF	Remove/install panoramic roof wind deflector	21.09.2017
------------------	--	------------

Model	205
	with code 413 (Automatic panoramic sliding sunroof)
Model	222
	with code 398 (Panoramic roof with MAGIC SKY CONTROL)
Model	222
	with code 413 (Automatic panoramic sliding sunroof)
Model	238
	with code 413 (Automatic panoramic sliding sunroof)
Model	253
	with code 413 (Automatic panoramic sliding sunroof)

P77.21-2362-09

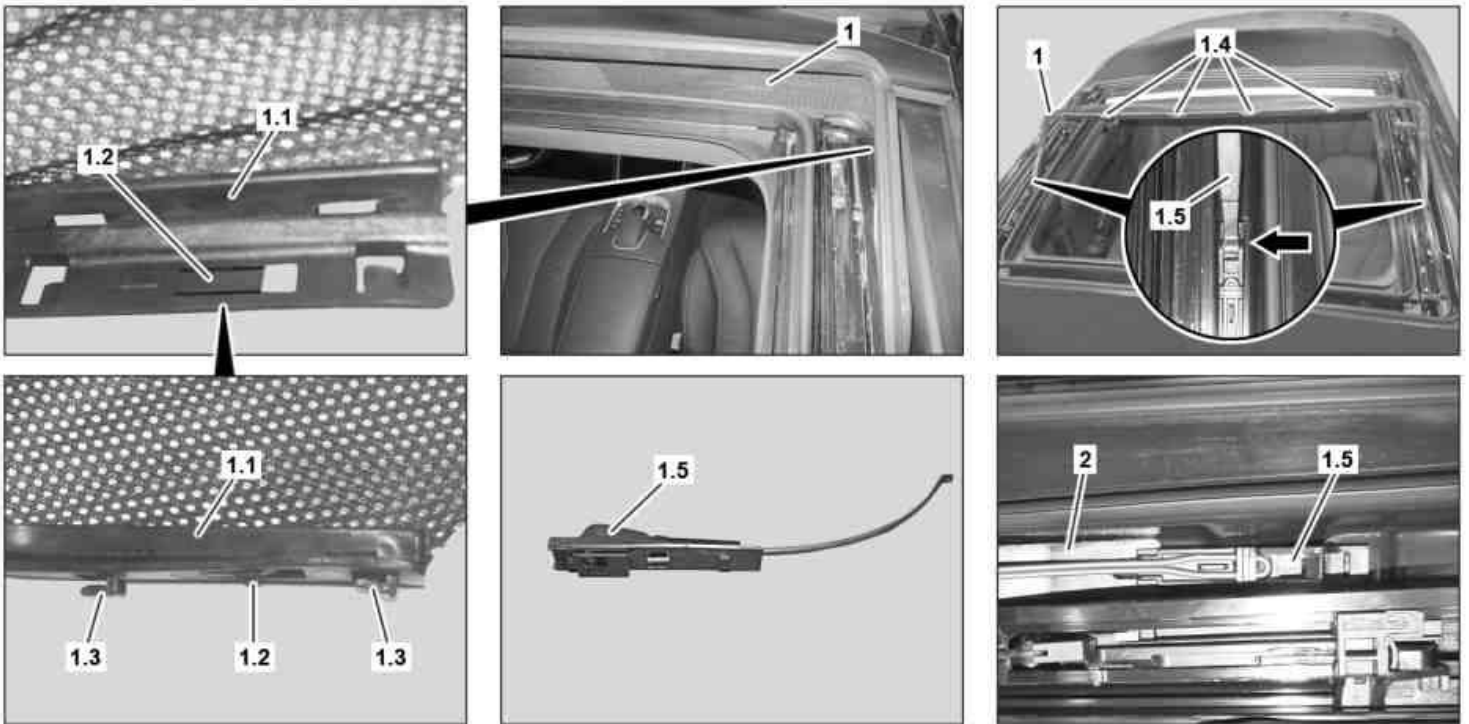

Shown on model 222


1	Wind deflector	1.3	Guide	2	Clip remover
1.1	Frame	1.4	Catch hook		
1.2	Tab	1.5	Bearing		

⚠	Warningseverity=W	Risk of injury caused by fingers being jammed or pinched when removing, installing or aligning hoods, doors, trunk lid/rear-end door or sliding roof.	No parts of the body or limbs should be within the operating area when the components are moving.	⚠ Risk of injury caused by fingers being jammed or pinched when removing, installing or aligning hoods, doors, trunk lid/rear-end door or sliding roof.
🛠		Remove/install		
1		Completely open panorama sliding roof		
2		Lift left and right lug (1.2) on frame (1.1) with screwdriver and push frame (1.1) toward rear until guides (1.3) move out of mounts on panoramic sliding roof frame		
3		Unclip frame (1.1) on catch hook (1.4) from panoramic sliding roof frame	🛑 Installation: Carefully clip in frame (1.1). Otherwise the catch hooks (1.4) can break.	

		☞ Extraction hook	*140589023300
4	Fold up wind deflector (1)		
5	Unclip wind deflector (1) from left and right bearing (1.5) (arrow) and remove		
6	Lift left and right bearing (1.5) in front area, push toward front and remove	☞ Clip remover	*452589016300
7	Install in the reverse order		
8	Normalize panoramic sliding roof with diagnostic system and perform teach-in run for automatic reversing function		
a		Model 205, 222, 253 with code 413 (Automatic panoramic sliding sunroof) Model 222 with code 398 (Panoramic roof with MAGIC SKY CONTROL)	📘 Connect STAR DIAGNOSIS and read out fault memory
a		Model 238 with code 413 (Automatic panoramic sliding sunroof)	📘 Connect/disconnect diagnostic unit

Extraction hook

140 589 02 33 00

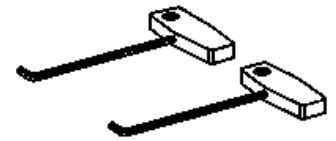

Clip remover

452 589 01 63 00

