
Shown on model 169.0 with code (220) Parktronic system (PTS), code (551) Antitheft alarm system (EDW) and code (873) Heated right and left front seats

- 1 Cover
- 2 Instrument panel
- 3 Electrical connector (with code (220) Parktronic system (PTS) or with code (551) Anti-theft alarm system (EDW))
- 4 Electrical connector (with code (873) Heater right and left front seats)

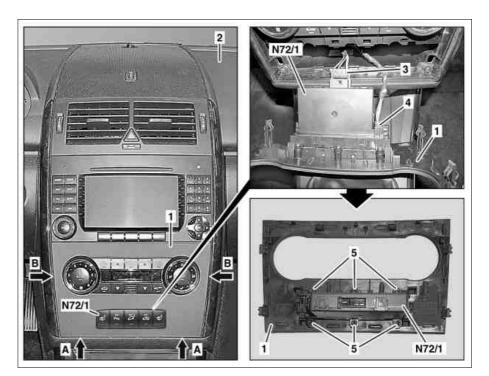

P68.20-3430-06

5 Bolts (with code (220) Parktronic system (PTS) or with code (551) Anti-theft alarm system (EDW) or with code (873) Heater right and left front seats)

## N72/1 Uppe (with

Upper control panel control unit (with code (220) Parktronic system (PTS) or with code (551) Anti-theft alarm system (EDW) or with code (873) Heater right and left front seats)

XX	Remove/install		
	Notes on avoiding damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
1.1	Switch off the ignition and remove the transmitter key from the EIS control unit	On vehicles with code (220) Parktronic system (PTS) or with code (551) Anti-theft alarm system (EDW) or with code (873) Heater right and left front seats	
2	Unclip cover (1) from instrument panel (2) with long wedge	<ul> <li>First unclip cover (1) from instrument panel (2) in bottom area (arrows A), then at side (arrows B) with long wedge.</li> <li>Installation: Pay attention to correct seat of cover (1) in the instrument panel (2).</li> </ul>	*115589035900
3.1	Separate electrical connection (3)	On vehicles with code (220) Parktronic system (PTS) or with code (551) Anti-theft alarm system (EDW)	
4.1	Disconnect electrical connector (4)	On vehicles with code (873) Heater right and left front seats	
5.1	Unscrew bolts (5) from rear of cover (1) and remove upper control panel control unit (N72/1)	When replacing cover (1) on vehicles with code (220) Parktronic system (PTS) or with code (551) Anti-theft alarm system (EDW) or with code (873) Heater right and left front seats.	
6	Install in the reverse order		
7.1	Check function of upper control panel control unit (N72/1)	On vehicles with code (220) Parktronic system (PTS) or with code (551) Anti-theft alarm system (EDW) or with code (873) Heater right and left front seats	

