


Model 257, 290

K40/6 Driver-side fuse and relay module

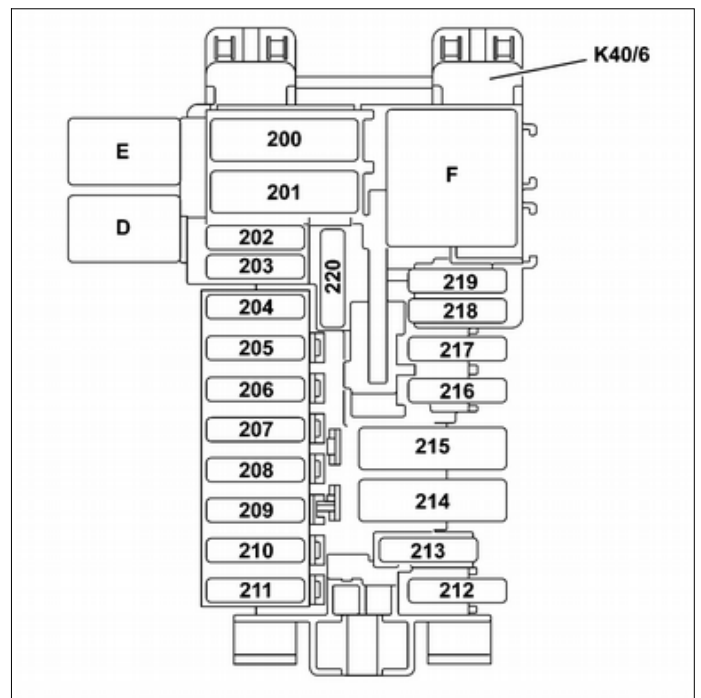

P54.15-3427-12

Slot	Fuse	Circuit	Wire Identification	Fused component	Fuse rating (A)
200	Electrical fuse 200 (K40/6f200)	30t	4.0 RD	Front SAM control unit (N10/6)	40
201	Electrical fuse 201 (K40/6f201)	30t	4.0 RDWH	Front SAM control unit (N10/6)	40
202	Electrical fuse 202 (K40/6f202)	30t	0.5 RDBK	Engine 256: Starter-alternator control unit (N129)	5
			0.5 RDYE	Engine 264 with code B01 (48V technology): Starter alternator (M1/10)	
203	Electrical fuse 203 (K40/6f203)	30t	2.5 RD	LHD vehicles: Left front door control unit (N69/1)	30
				Right-hand steering: Right front door control unit (N69/2)	
204	Electrical fuse 204 (K40/6f204)	30t	0.5 RDGN	With code 498 (Japan version) or code 835 (Additional parts for South Korea vehicles): Dedicated Short-Range Communications control unit (A50/6)	5
			0.5 RD	With code 320 (Pre-installation of single CD drive): External CD drive (A2/132)	
205	Electrical fuse 205 (K40/6f205)	30t	0.5 RDBU	Steering column tube module control unit (N80)	7,5
206	Electrical fuse 206 (K40/6f206)	30t	0.5 RDYE	With code 246 (Analog clock): Analog clock (A70/1)	5
				With code 897 (Wireless mobile phone charging) or with code 899 (Multifunction telephony): USB port on center console at front (X115/5)	
207	Electrical fuse 207 (K40/6f207)	-	-	Spare	-
208	Electrical fuse 208 (K40/6f208)	30t	0.5 RD	Audio/COMAND display (A40/8)	7,5
				With code 464 (Full display digital instrument cluster): Digital instrument cluster full display fan motor (M4/12)	
209	Electrical fuse 209 (K40/6f209)	30t	0.5 RDWH	Upper control panel control unit (N72/1) Climate control operating unit (N58/1)	5
210	Electrical fuse 210 (K40/6f210)	30t	1.5 RDBK	Climate control control unit (N22/1)	15
211	Electrical fuse 211 (K40/6f211)	30t	1.0 RD	Steering column tube module control unit (N80)	15

212	Electrical fuse 212 (K40/6f212)	30t	0.5 RDOG	With code B24 (Remote control for stationary heater) or code 503 (Pre-installation for Remote Parking Pilot) and code 380 (Car telephony package) or code 899 (Multifunction telephony): Telephone and Active Parking Assist/stationary heater antenna changeover switch (A2/155)	5
213	Electrical fuse 213 (K40/6f213)	30t	4.0 RDGN	LHD vehicles: Left front reversible emergency tensioning retractor (A76)	30
			4.0 RDBK	Right-hand steering: Right front reversible emergency tensioning retractor (A76/1)	
214	Electrical fuse 214 (K40/6f214)	30t	2.5 RDBU	LHD vehicles: Left rear door control unit (N69/3)	30
			2.5 RDYE	Right-hand steering: Right rear door control unit (N69/4)	
215...220	Electrical fuse 215 (K40/6f215) - Electrical fuse 220 (K40/6f220)	-	-	Spare	-

Relays	Designation
D	Not assigned
E	Not assigned
F	Backup relay (K40/6kF)