



MODEL 207

Shown on left side of vehicle

- 1 Longitudinal member paneling
- 2 Door sill molding

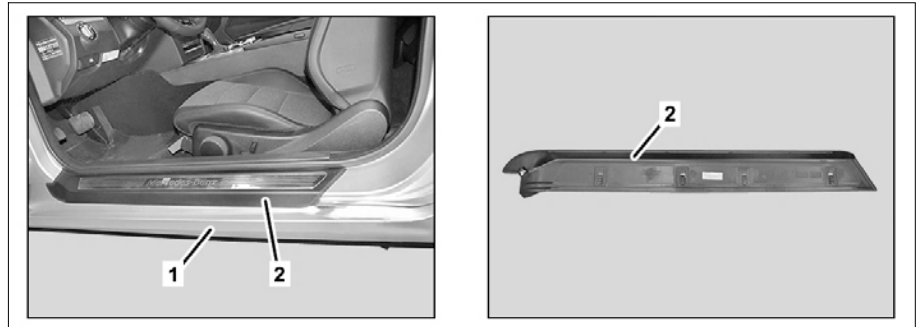

P88.80-2179-04

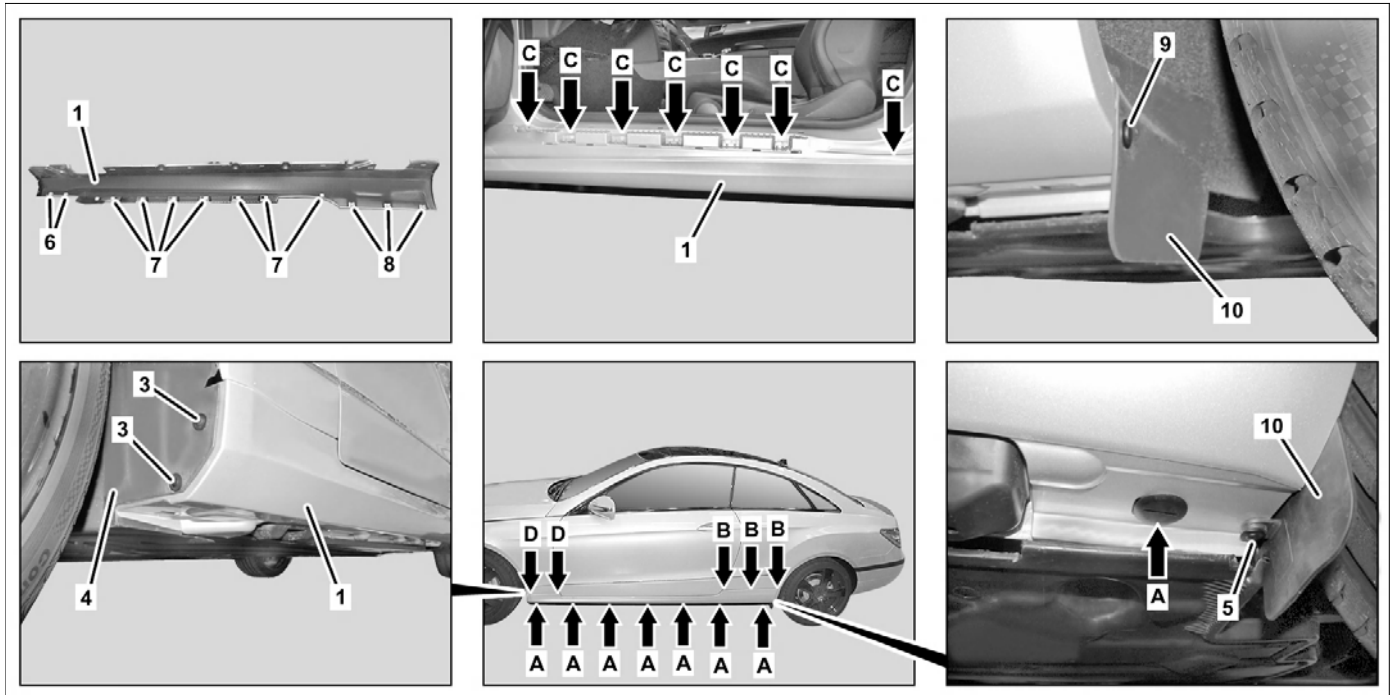


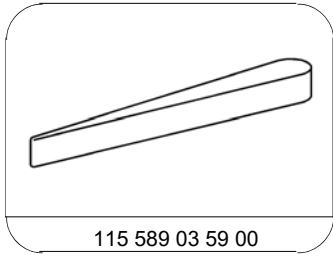
P88.80-2180-09

Shown on left side of vehicle

- 1 Longitudinal member paneling
- 2 Door sill molding
- 3 Expansion clip
- 4 Fender liner
- 5 Expansion clip
- 6 Clip
- 7 Clip
- 8 Clip
- 9 Expansion clip
- 10 Rear fender interior trim

Remove/install		
1	Turn clips (arrows) 90° at bottom of longitudinal member panel (1) and remove clips (arrows A)	i Remove damaged clips (arrows A).
2	Pull longitudinal member panel (1) out of underfloor paneling at bottom	S *115589035900
3	Remove expansion clip (3) from fender liner rear section (4) on front axle	
4	Loosen rear fender liner section (4) in area of longitudinal member panel (1)	
5	Remove expansion clips (5, 9) from rear fender inner trim (10)	
6	Open driver door or passenger door	
7	Unclip door sill (2) from longitudinal member panel (1) and remove	i Observe clips on door sill (2) on A-pillar Replace damaged clip. S *115589035900
8	Loosen clip (8) on rear fender (arrows B)	i Replace damaged clips (8). S *115589035900
9	Loosen clips (7) on longitudinal member (arrows C)	i Replace damaged clips (7). S *115589035900
10	Loosen clips (6) from inside on fender (arrows D)	i Press fender liner section (4) to side. Replace damaged clips (6).

			*115589035900
11	Remove longitudinal member paneling (1)		
12	Install in the reverse order		



Long wedge