


MODEL 204.0/2/9

MODEL 212

without CODE 224 (Rear individual seat design)

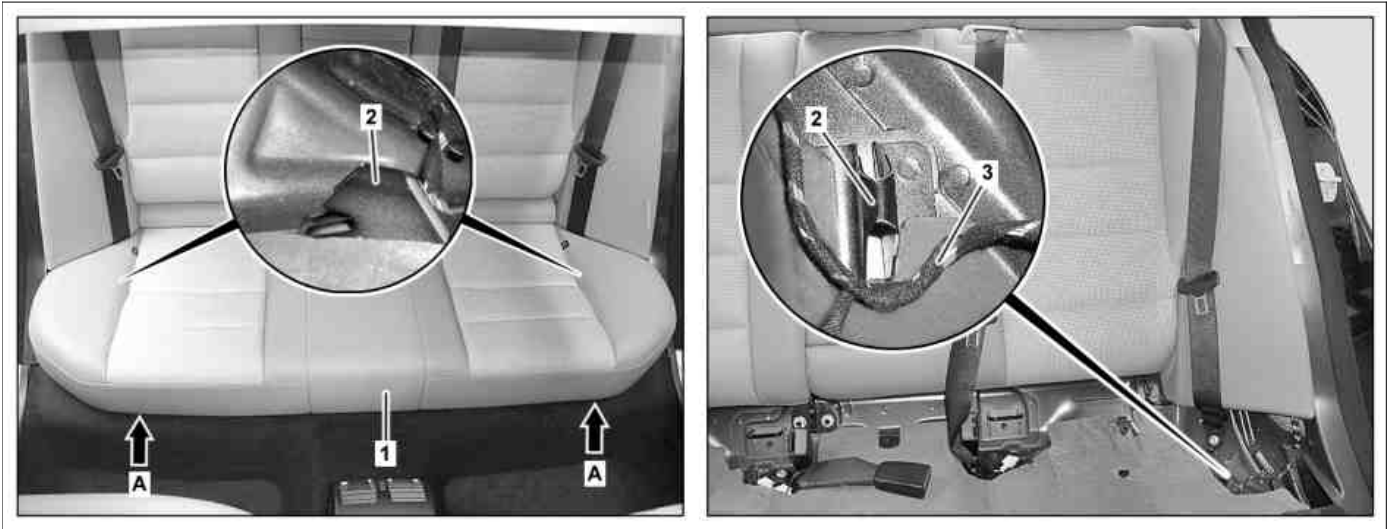


P91.12-3397-08

Shown on model 204.0 without code (248) Rear seat with integrated child seat

1 Rear seat cushion

2 Support

3 Electrical wiring harness

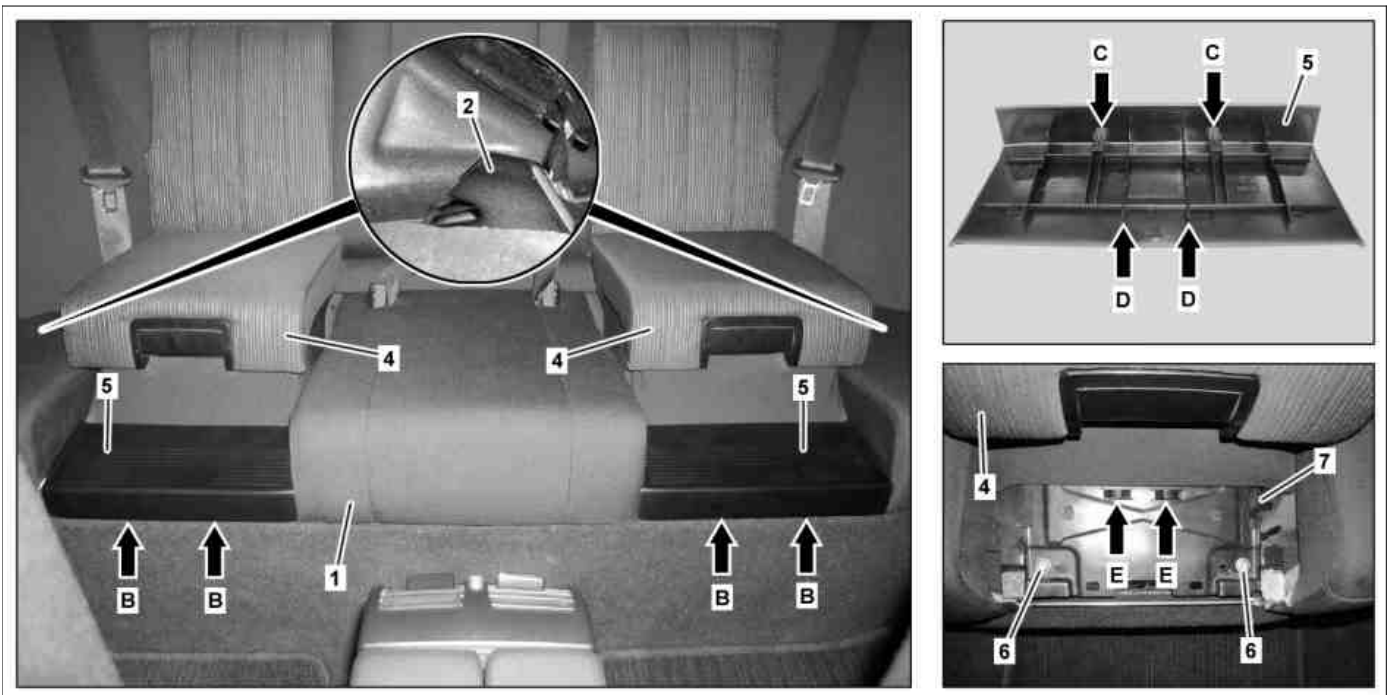

P91.12-3224-09

Shown on model 204.0 with code (248) Rear seat with integrated child seat

1 Rear seat cushion

4 Child seat cushions

6 Screw


2 Support

5 Footrest

7 Seat frame

**Shown on model 204.3, left side of vehicle**

- 2 Support
- 3 Electrical wiring harness
- 8 Adhesive strips

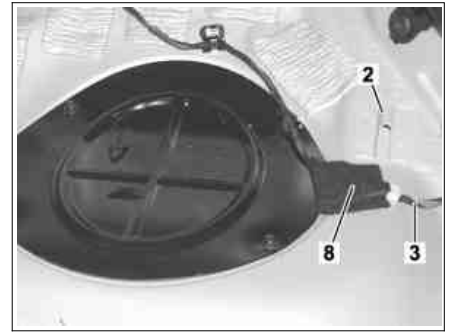

P91.12-3570-01

**Shown on model 212**

- 1 Rear seat cushion
- X54/11 Left and right rear seat heater pad electrical connectors (with code (872) Electric seat heater for left and right rear seat)



P91.12-3396-11

☒ ☒	Remove/install		
1	Move both front seats forwards		
2	Pull rear seat cushion (1) upwards out of the guide sleeves (arrows A)	<p>For vehicles without code (248) Rear seat with integrated child seat</p> <p>⚠</p> <p>In model 212 with code (864) Rear entertainment system, catch rear seat cushion (1) while pulling it out. Otherwise the DVD player will be damaged.</p>	
3	Extend child seat cushions (4)	For vehicles with code (248) Rear seat with integrated child seat	
4	Remove left and right footrests (5)	<p>For vehicles with code (248) Rear seat with integrated child seat</p> <p><b>i</b> At the marks (arrows B) on the footrests (5) insert a suitable screwdriver, alternately push back the catch hooks (arrows C), then remove the footrests (5) horizontally from the seat frame (7).</p> <p><b>i</b> <b>Installation:</b> Insert guides (arrows D) of footrest (5) in cutouts (arrows E) of seat frame (7).</p>	
5	Remove bolts (6) on left and right seat frame (7) of rear seat cushion (1)	<p>For vehicles with code (248) Rear seat with integrated child seat</p> <p><b>Nm</b> Bolt, rear seat cushion to body</p>	*BA91.12-P-1010-03I
6	Remove DVD player paneling	<p>MODEL 212 with CODE 864 (Rear entertainment system) without CODE 224 (Rear individual seat design)</p>	AR82.60-P-7505-01EW
7	Push rear seat cushion (1) far enough back to enable the retaining brackets on the bottom of the rear seat cushion (1) to be extended from the mounts (2)	<b>i</b> <b>Installation:</b> Ensure that mounting frame bow is seated correctly in mounts (2).	
8	Guide rear seat cushion (1) forward and disconnect left and right rear seat heater pad electrical connectors (X5411)	<p>MODEL 212 with CODE 872 (Electrically heated left and right rear seats)</p>	

9	Remove rear seat cushion (1)	<p>⚠ Carefully remove rear seat cushion (1) from vehicle. Otherwise components in vehicle interior or at rear doors will be damaged.</p> <p>⚠ <b>Installation:</b> Note routing and fastening of electrical wiring harness (3) in front of mounts (2). Otherwise the electrical wiring harness (3) will be damaged.</p> <p><b>i</b> <b>Installation:</b> Note position of center seat belt buckle.</p>	
10	Install in the reverse order		

**Nm** Rear seats

Number	Designation	MODEL 204	MODEL 212
BA91.12-P-1010-03I	Bolt, rear seat cushion to body Nm	8	10