
MODEL 211.0/ 2/ 6

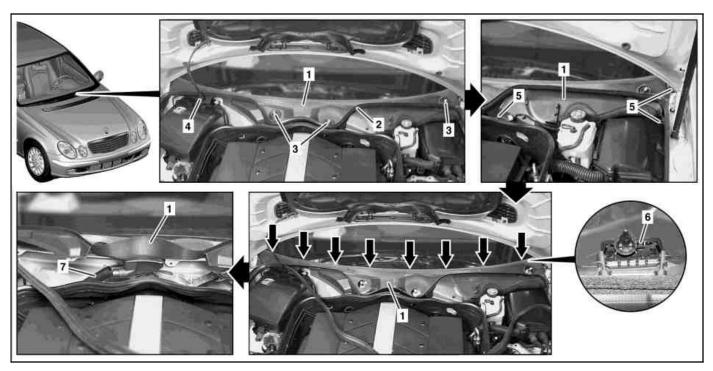

P83.25-2098-09

1 Water collector

2 Rubber seal

3 Gaskets

4 Cable

5 Expanding clip

6 Clip 7 Wat

7 Water drain hose

23 23	Remove/Install		
1	Remove wiper arms		AR82.30-P-6100T
2.1	Remove multifunction sensor and place to oneOn	on vehicles with code (581b) convenience	AR83.40-P-6730T
	side with attached cable au	utomatic air conditioning	
3	Remove rubber seal (2) in water collector area (1)		
4	Detach gaskets (3) at the wiper shafts		
5	Unclip line (4) for windshield washer nozzles		
6	Remove expander clips (5) on water collector (1)	_	
7	Unclip water collector (1) in the area of the windshield (arrows)	Installation: Replace defective clips (6).	
8	Detach water drain hose (7) on water collector (1)		
9	Remove water collector (1)		
10	Install in the reverse order		