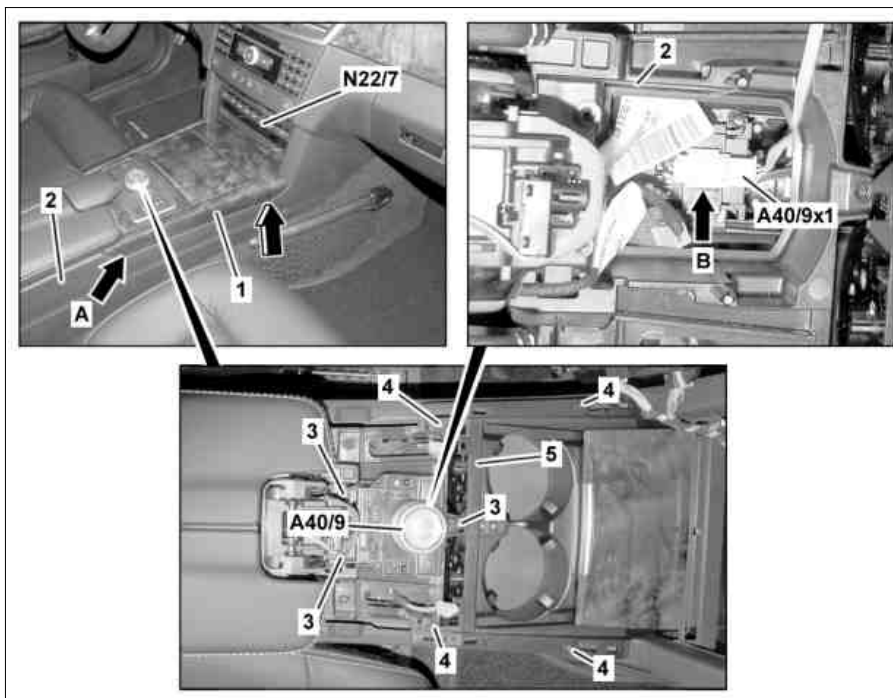


MODEL 212.0 /1 /2 (except 212.074 /077 /274 /277) with CODE (279) Electronic gear selector

Shown on vehicle with code (581)
Comfort automatic air conditioning

- 1 Trim strip
2 Center console
3 Screw
4 Screw
5 Stowage compartment






- A40/9 Audio/COMAND control panel
A40/9x1 Audio/COMAND control panel electrical connector
N22/7 Automatic air conditioning control and operating unit

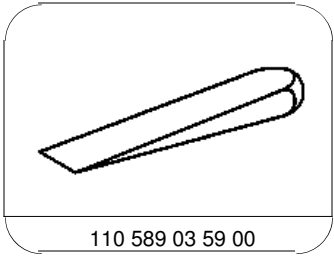


P82.60-7330-06

Modification notes

12.4.12	Remove cover, added	Operation step 4	
---------	---------------------	------------------	--

	Remove/install		
	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
	1 Buffer basic data from the Audio/COMAND control panel (A40/9) in STAR DIAGNOSIS Connect STAR DIAGNOSIS and read out fault memory	When replacing the Audio/COMAND control panel (A40/9).  Installation: Transmit buffered basic data to the new Audio/COMAND control panel (A40/9).	AD00.00-P-2000-04A
	2 Unclip right and left trim strip (1) at front using assembly wedge in the direction of arrow, and unhook and remove at rear area (arrow A)		*110589035900
	3 Remove automatic air conditioning control and operating unit (N22/7) and place to one side with electrical lines		AR83.40-P-6350EW
	4 Remove cover on center console		AR68.20-P-2350EW
	5 Remove screws/bolts (4) and detach stowage compartment (1)		
	6 Remove screws/bolts (3), lift stowage compartment (5) at front and remove Audio/COMAND control panel (A40/9) until the Audio/COMAND control panel electrical connector (A40/9x1) is accessible		
	7 Disconnect Audio/COMAND control panel electrical connector (A40/9x1), detach wiring harness of Audio/COMAND control panel (A40/9) from bracket (arrow B) of center console (2) and remove Audio/COMAND control panel (A40/9)		
	8 Install in the reverse order		



110 589 03 59 00

Assembly wedge