



MODEL 204.0/2/9
 MODEL 212
 without CODE 224 (Rear individual seat design)

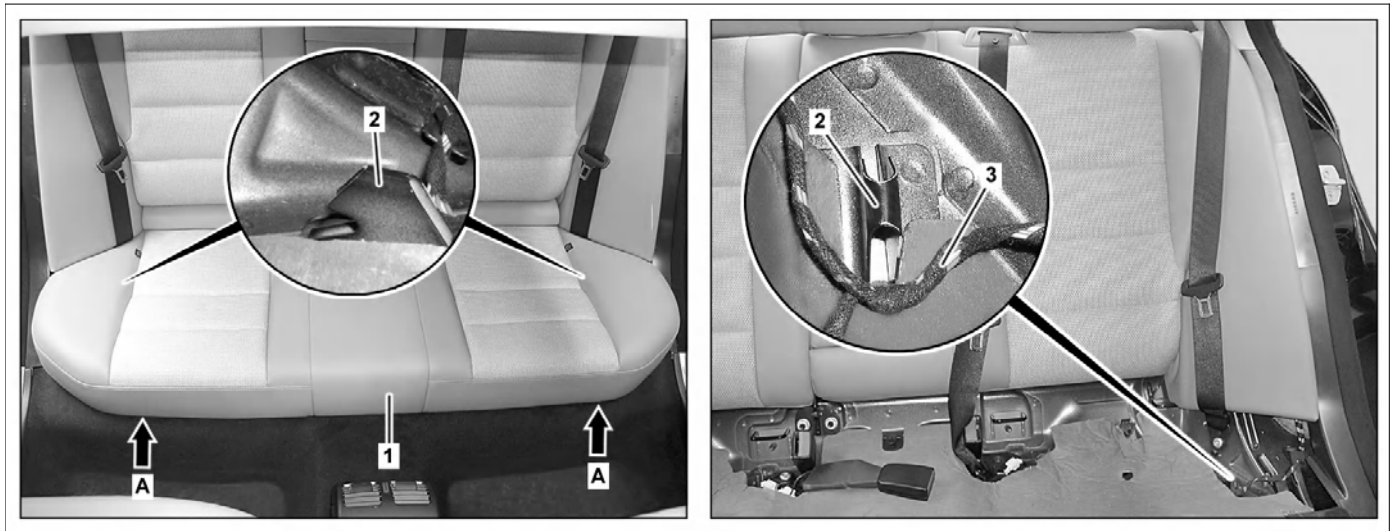

P91.12-3397-08

Shown on model 204.0 without code (248) Rear seat with integrated child seat

- 1 Rear seat cushion
- 2 Support
- 3 Electrical wiring harness

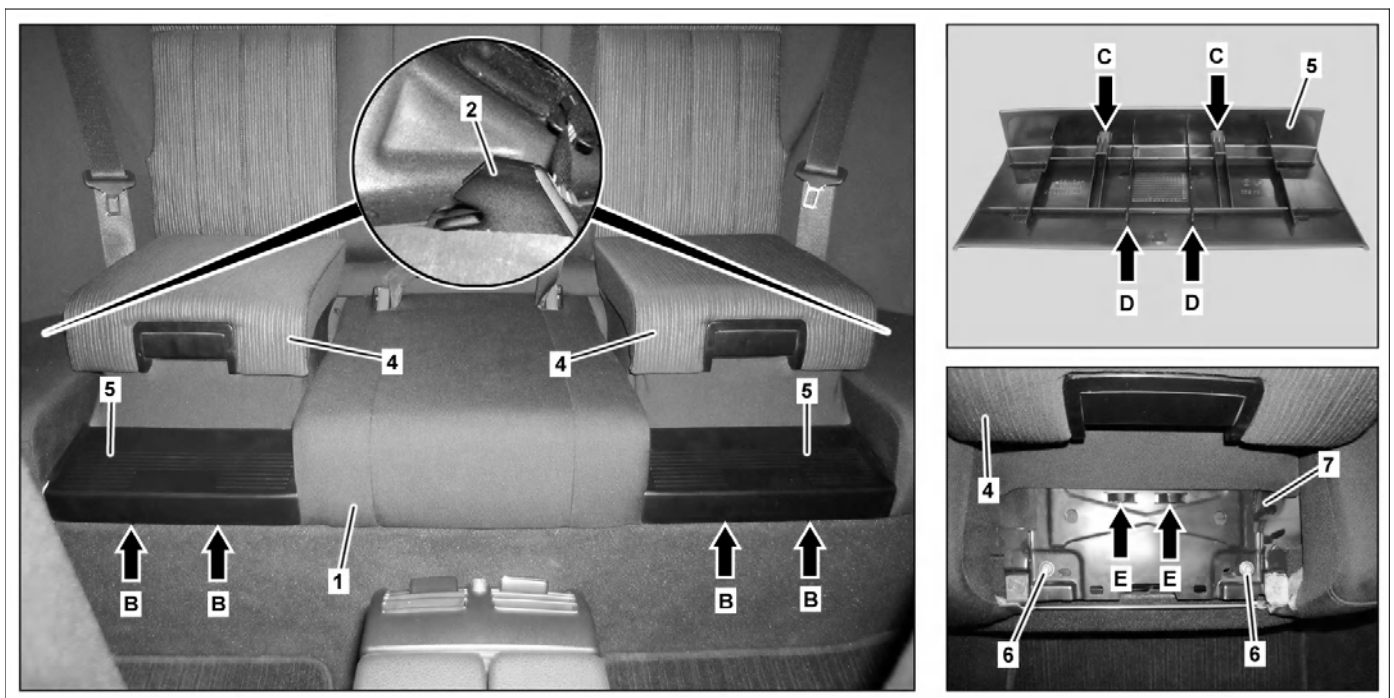


P91.12-3224-09

Shown on model 204.0 with code (248) Rear seat with integrated child seat

- 1 Rear seat cushion
- 2 Support
- 4 Child seat cushions
- 5 Footrest
- 6 Screw
- 7 Seat frame

Shown on model 204.3, left side of vehicle

- 2 Support
- 3 Electrical wiring harness
- 8 Adhesive strips

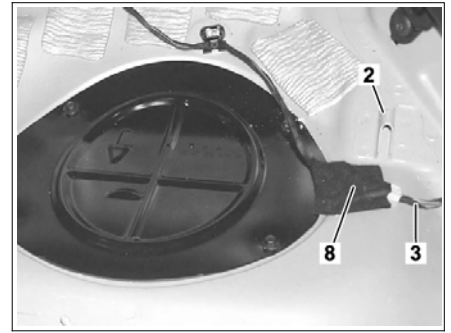

P91.12-3570-01

Shown on model 212

- 1 Rear seat cushion
- X54/11 Left and right rear seat heater pad electrical connectors (with code (872) Electric seat heater for left and right rear seat)



P91.12-3396-11

☒ ☒	Remove/install		
1	Move both front seats forwards		
2	Pull rear seat cushion (1) upwards out of the guide sleeves (arrows A)	For vehicles without code (248) Rear seat with integrated child seat ⓘ In model 212 with code (864) Rear entertainment system, catch rear seat cushion (1) while pulling it out. Otherwise the DVD player will be damaged.	
3	Extend child seat cushions (4)	For vehicles with code (248) Rear seat with integrated child seat	
4	Remove left and right footrests (5)	For vehicles with code (248) Rear seat with integrated child seat ⓘ At the marks (arrows B) on the footrests (5) insert a suitable screwdriver, alternately push back the catch hooks (arrows C), then remove the footrests (5) horizontally from the seat frame (7). ⓘ Installation: Insert guides (arrows D) of footrest (5) in cutouts (arrows E) of seat frame (7).	
5	Remove bolts (6) on left and right seat frame (7) of rear seat cushion (1)	For vehicles with code (248) Rear seat with integrated child seat Nm Bolt, rear seat cushion to body	*BA91.12-P-1010-03I
6	Remove DVD player paneling	MODEL 212 with CODE 864 (Rear entertainment system) without CODE 224 (Rear individual seat design)	AR82.60-P-7505-01EW
7	Push rear seat cushion (1) far enough back to enable the retaining brackets on the bottom of the rear seat cushion (1) to be extended from the mounts (2)	ⓘ Installation: Ensure that mounting frame bow is seated correctly in mounts (2).	
8	Guide rear seat cushion (1) forward and disconnect left and right rear seat heater pad electrical connectors (X54/11)	MODEL 212 with CODE 872 (Electrically heated left and right rear seats)	

9	Remove rear seat cushion (1)	<p>⚠ Carefully remove rear seat cushion (1) from vehicle. Otherwise components in vehicle interior or at rear doors will be damaged.</p> <p>⚠ Installation: Note routing and fastening of electrical wiring harness (3) in front of mounts (2). Otherwise the electrical wiring harness (3) will be damaged.</p> <p>i Installation: Note position of center seat belt buckle.</p>	
10	Install in the reverse order		

Nm Rear seats

Number	Designation	MODEL 204	MODEL 212
BA91.12-P-1010-03I	Bolt, rear seat cushion to body Nm	8	10