
Model 204, 207, 212, 218

Modification notes


| 17.04.2014 | New picture inserted | Picture numberP82.30-3209-08 | |
|------------|--------------------------|-------------------------------------|--|
| 17.04.2014 | Specialist note inserted | AS 4.2 factual information inserted | |

Model 204.0/2, 207, 212.0/2, 218, shown on model 204.0

- 1 Driver-side wiper arm
- 2 Passenger-side wiper arm
- 3 Сар
- 4 Caps

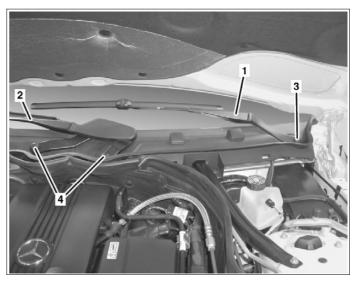

P82.30-2630-11

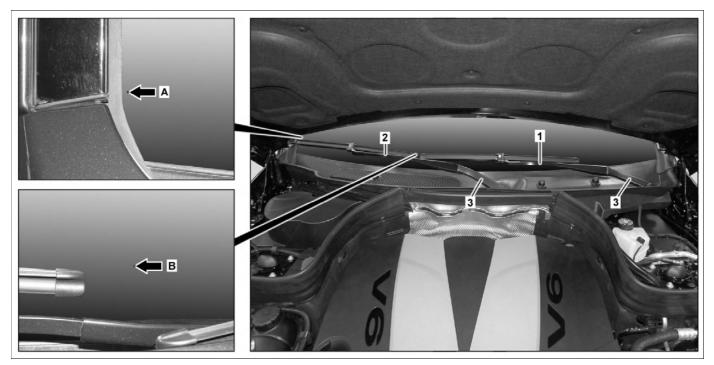

P82.30-2856-09

MODEL 204.9

1 Driver-side wiper arm

2 Passenger-side wiper arm

3 Сар



P82.30-3209-08

4 Passenger-side wiper arm

| | Injury hazard from pinching and crushing, in extreme cases extremities can even be cut off when caught in windshield wiper mechanism. | When working on the windshield wiper mechanism, always switch off the ignition and store transmitter key outside of transmission range (at least 2 m). | AS82.30-Z-0001-01A |
|--|---|---|---------------------|
| 23 23 | Remove/install | range (at least 2 m). | |
| 1 | Bring wiper system into park position | | |
| 2.1 | Switch off ignition and remove transmitter key from ignition lock | Model 204, 207, 212, 218 except code 889 (KEYLESS-GO) | |
| 2.2 | Switch off ignition, remove KEYLESS-GO start/stop button from electronic ignition lock control unit | Model 204, 207, 212, 218 with code 889 (KEYLESS-GO) | |
| Remove cap (3), unscrew nut and detach driver-side wiper arm (1) | | Model 204, 207 Installation: Position tip of wiper blade on driver-side wiper arm (1) onto assembly marking (arrow B) in the windshield's silkscreen print. | |
| | | Model 212, 218 Installation: Position tip of wiper blade on driver-side wiper arm (1) 60 mm above the water collector. | |
| | | Nm Nut to wiper arm | *BA82.30-P-1001-01M |
| | | 9 Puller | *201589143300 |
| | | Thrust washer M 10x1.5 | *210589046300 |
| 6.1 | Detach caps (4), unscrew nuts and remove passenger-side wiper arm (2) | Model 204.0/2, 207, 212, 218 | |
| | | i Installation: Position front passenger side wiper blade (2) onto assembly marking in windshield's silk-screen print. | |
| | | Nm Nut to wiper arm | *BA82.30-P-1001-01M |
| | Y Puller | | *201589143300 |
| | | Thrust washer M 10x1.5 | *210589046300 |
| 6.2 | Remove cap (3), unscrew nut and remove passenger-side wiper arm (2) | Model 204.9 | |
| | | i Model 204.9 up to 1/31/14 Installation: Position front passenger side wiper blade (2) onto assembly marking (arrow A) in windshield's silk-screen print. i Model 204.9 as of 2/1/14 Installation: Position front passenger side | |
| | | wiper blade (4) approx. 21 mm (space a) over the assembly marking (arrow A) in the windshield's silk-screen print. | |
| | | Nut to wiper arm | *BA82.30-P-1001-01M |


| | | i dilci | *201589143300 *210589046300 |
|---|------------------------------|---------|--------------------------------|
| 7 | Install in the reverse order | | |


Nm Windshield wiper

| Number | Designation | Model 204 | Model 207 |
|--------------------|---------------------|-----------|-----------|
| BA82.30-P-1001-01M | Nut to wiper arm Nm | 30 | 30 |

Nm Windshield wiper

| Number | Designation | | Model 212 | Model 218 |
|--------------------|------------------|----|-----------|-----------|
| BA82.30-P-1001-01M | Nut to wiper arm | Nm | 30 | 30 |

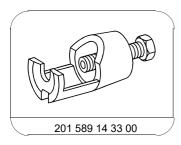

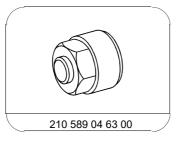

Puller

Thrust washer M 10x1.5