Document title Remove and install wiper arm

Document number ar8230p6100cw


Model 204, 207, 212, 218

Modification notes


| 17.04.2014 | New picture inserted | Picture numberP82.30-3209-08 | |
|------------|--------------------------|-------------------------------------|--|
| 17.04.2014 | Specialist note inserted | AS 4.2 factual information inserted | |

Model 204.0/2, 207, 212.0/2, 218, shown on model 204.0

- 1 Driver-side wiper arm
- 2 Passenger-side wiper arm
- 3 Cap
- 4 Caps

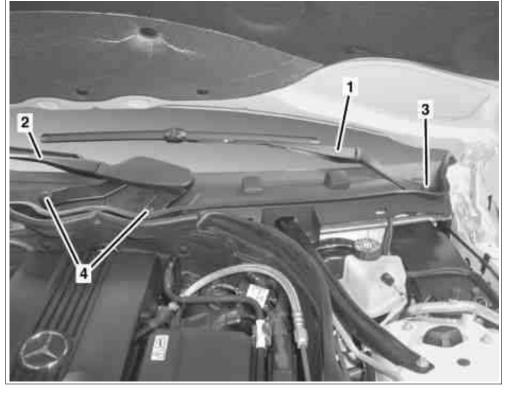

P82.30-2630-11

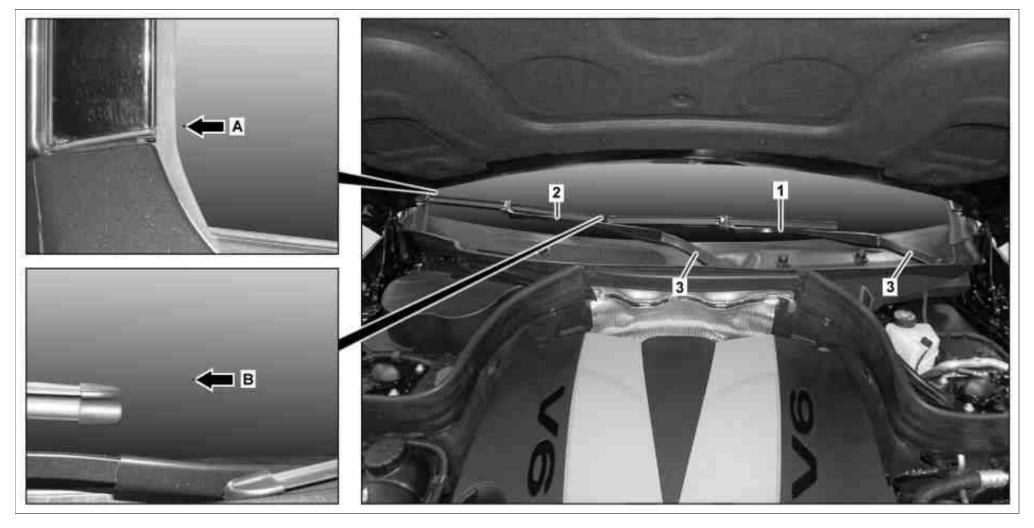


P82.30-2856-09

MODEL 204.9

1 Driver-side wiper arm

2 Passenger-side wiper arm

3 Сар

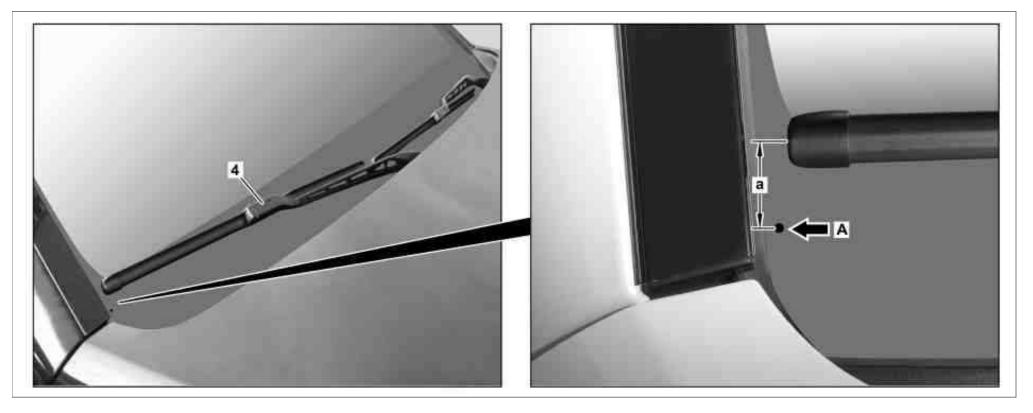

P82.30-3209-08

4 Passenger-side wiper arm


| | Injury hazard from pinching and crushing, in extreme cases extremities can even be cut off when caught in windshield wiper mechanism. When working on the windshield wiper mechanism, always switch off the ignition and store transmitter key outside of transmission range (at least 2 m). | | |
|-----|---|---|---------------------|
| X | Remove/install | | |
| 1 | Bring wiper system into park position | | |
| 2.1 | Switch off ignition and remove transmitter key from ignition lock | Model 204, 207, 212, 218 except code 889 (KEYLESS-GO) | |
| 2.2 | Switch off ignition, remove KEYLESS-GO start/ stop button from electronic ignition lock control unit | Model 204, 207, 212, 218 with code 889 (KEYLESS-GO) | |
| 5 | Remove cap (3), unscrew nut and detach driver-side wiper arm (1) | i Model 204, 207 Installation: Position tip of wiper blade on driver-side wiper arm (1) onto assembly marking (arrow B) in the windshield's silk-screen print. i Model 212, 218 | |
| | | Installation: Position tip of wiper blade on driver-side wiper arm (1) 60 mm above the water collector. | |
| | | Nm Nut to wiper arm | *BA82.30-P-1001-01M |
| | | Y Puller | *201589143300 |
| | | Thrust washer M 10x1.5 | *210589046300 |
| 6.1 | Detach caps (4), unscrew nuts and remove passenger-side wiper arm (2) | Model 204.0/2, 207, 212, 218 | |
| | | i Installation: Position front passenger side wiper blade (2) onto assembly marking in windshield's silk-screen print. | |
| | | Nm Nut to wiper arm | *BA82.30-P-1001-01M |
| | | Y Puller | *201589143300 |
| | | Thrust washer M 10x1.5 | *210589046300 |
| 6.2 | Remove cap (3), unscrew nut and remove passenger-side wiper arm (2) | Model 204.9 | |
| | | i Model 204.9 up to 1/31/14 Installation: Position front passenger side wiper blade (2) onto assembly marking (arrow A) in windshield's silk-screen print. | |
| | | i Model 204.9 as of 2/1/14 Installation: Position front passenger side wiper blade (4) approx. 21 mm (space a) over the assembly marking (arrow A) in the windshield's silk-screen print. | |
| | | Nm Nut to wiper arm | *BA82.30-P-1001-01M |
| | | Y Puller | *201589143300 |
| | | Thrust washer M 10x1.5 | *210589046300 |


Nm Windshield wiper

| Number | Designation | | Model 204 | Model 207 |
|--------------------|------------------|----|-----------|-----------|
| BA82.30-P-1001-01M | Nut to wiper arm | Nm | 30 | 30 |

Nm Windshield wiper

| Number | Designation | | Model 212 | Model 218 |
|--------------------|------------------|----|-----------|-----------|
| BA82.30-P-1001-01M | Nut to wiper arm | ١m | 30 | 30 |

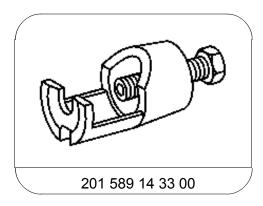

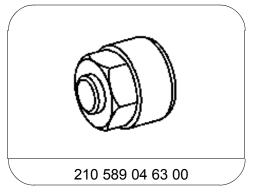

Puller

Thrust washer M 10x1.5