


MODEL 212





P68.10-4090-09


- | | | | | | |
|---|------------------|-------|-------------------|--------|-------------------------------|
| 1 | Glove box lid | 5 | Glove compartment | X39/45 | AUX jack electrical connector |
| 2 | Right trim strip | 6 | Screw | X58/31 | Glove box socket |
| 3 | Side cover | 7 | Screw | | |
| 4 | Screw | E13/1 | Glove box lamp | | |

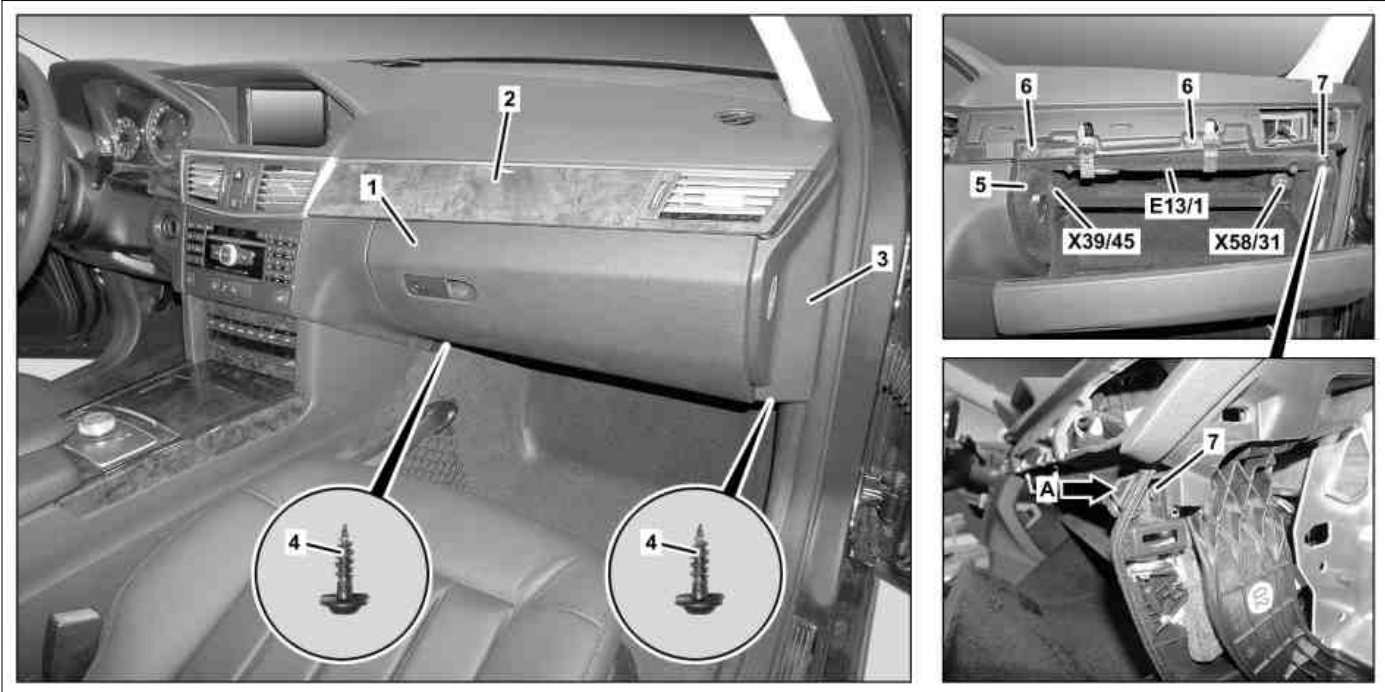

P68.10-4091-08

- | | | | | | |
|---|-------------------|---|----------------|----|---------------|
| 1 | Glove box lid | 8 | Bolts | 10 | Support strap |
| 5 | Glove compartment | 9 | Shock absorber | 11 | Hinge bolt |

1	Remove cover below right dashboard		AR68.10-P-1520CW
2	Remove side cover (3) from instrument panel	 Clip remover	*452589016300
3	Unscrew bolts (4) at bottom of glove box (5)		
4	Remove right trim strip (2) from instrument panel		AR68.10-P-1180EW
5.1	Remove AUX jack electrical connector (X39/45) from glove box (5)	MODEL 212 up to model year 2014 without CODE 518 (Media Interface)	AR68.10-P-1400-01CW Vehicles without code (518) Media Interface
5.2	Disconnect electrical connector on media interface on glove box (5)	MODEL 212 up to model year 2014 with CODE 518 (Media Interface)	AR68.10-P-1400-02CW Vehicles with code (518) Media Interface
6	Remove screw/bolts (6)		
7	Unclip cover (arrow A)		
8	Unscrew bolt (7)		
9	Lower glove box (5) until electrical connectors can be disconnected		
10	Disconnect electrical connector from glove compartment lamp (E13/1)		
11	Disconnect electrical connector from glove compartment socket (X58/31)		
12	Remove glove box (5) and lay down on suitable protective surface	 Installation: Ensure that bracket (arrow C) is seated correctly in associated lug on crossmember on instrument panel.	
13	Unscrew bolts (8) and pivot damper (9) to side		
14	Unhook support strap (10) on damper (9) from pin (arrow B) and remove damper (9)		
15	Knock hinge bolt (11) out of guide (arrow D) on glove box lid (1) in direction of arrow and pull out of glove box lid (1)		
16	Remove glove compartment lid (1) from glove compartment (5)		
17	Install in the reverse order		

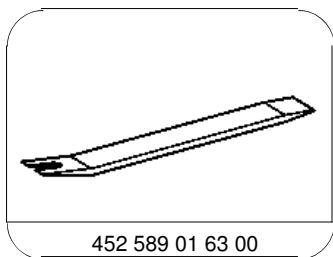

452 589 01 63 00

Clip remover