



Model 205.0/1
 Model 213.0

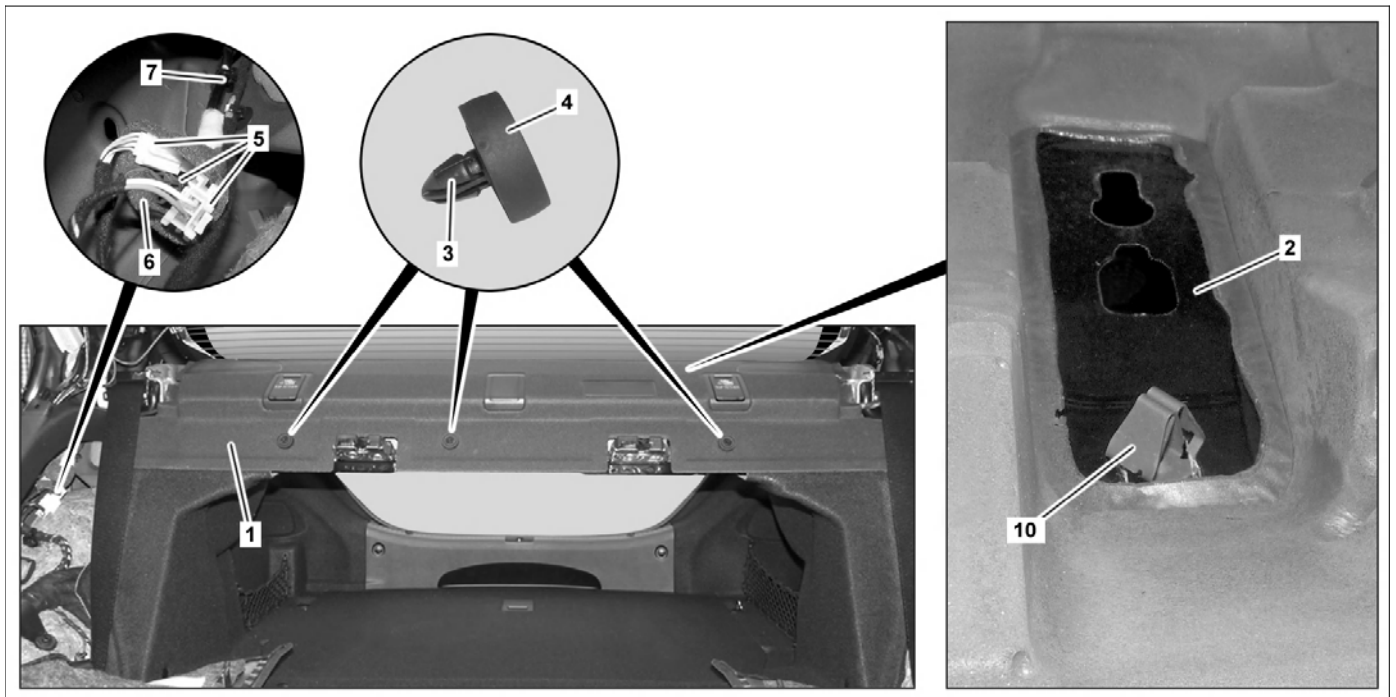

P68.30-3743-09

Shown on model 205.0 with code 287 (Folding seat backrest in rear), code 540 (Electric roller sun blind for rear window) and code 810 (Sound system)

- | | | | |
|---|---------------|----|-----------------------|
| 1 | Rear shelf | 5 | Electrical connectors |
| 2 | Bodywork | 6 | Foam material |
| 3 | Mounting clip | 7 | Mounting clip |
| 4 | Spacer | 10 | Sheet metal clip |

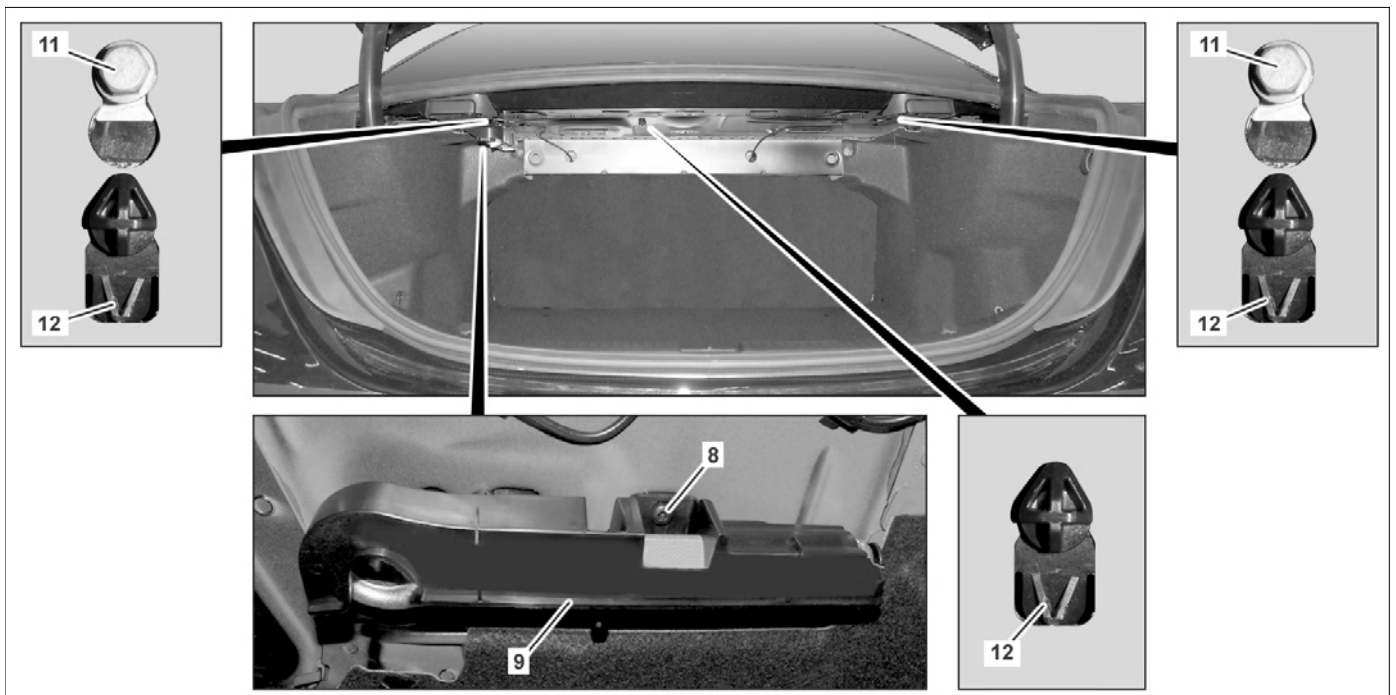


P68.30-3744-09

Shown on model 205.0 with code 287 (Folding seat backrest in rear), code 540 (Electric roller sun blind for rear window) and code 810 (Sound system)

- 8 Screw
- 9 Towing eye bracket

- 11 Screw
- 12 Catch

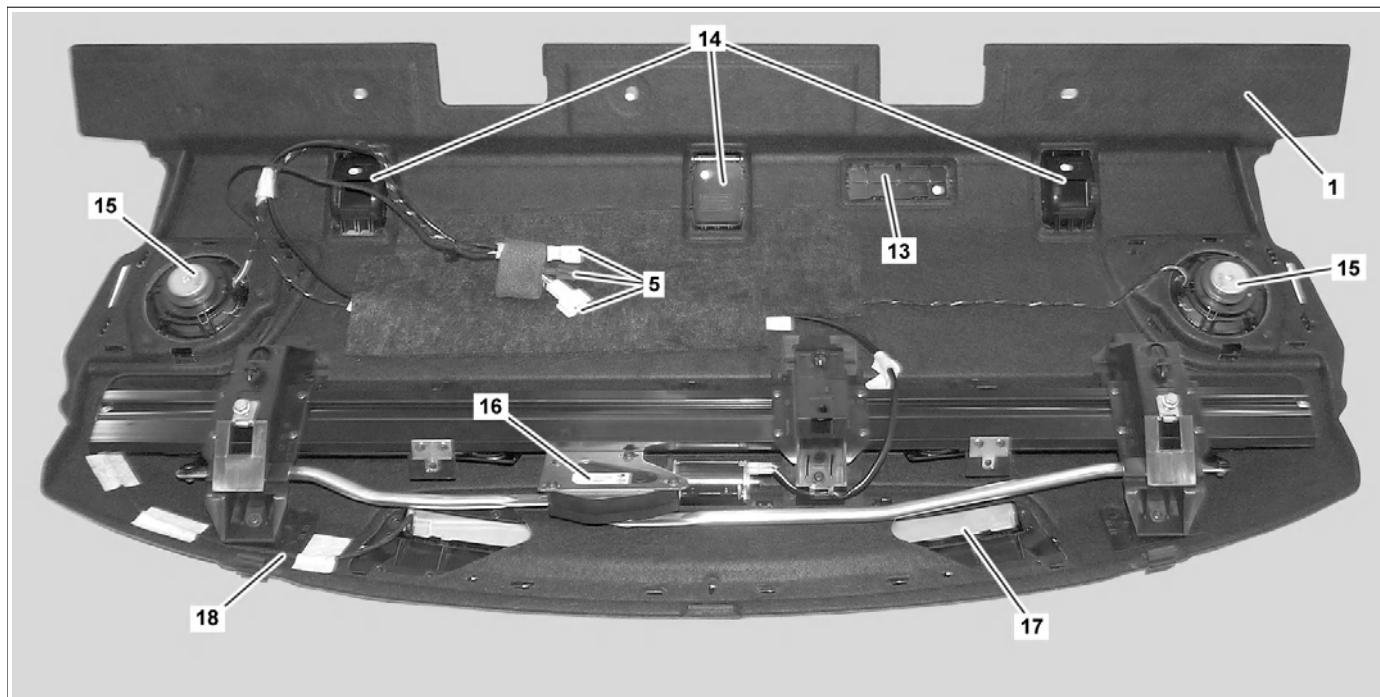

P68.30-3745-09

Shown on model 205.0 with code 287 (Folding seat backrest in rear), code 540 (Electric roller sun blind for rear window) and code 810 (Sound system)

- 1 Rear shelf
- 5 Electrical connectors
- 13 Cover
- 14 Isofix coverings

- 15 Speaker
- 16 Roller sun blind
- 17 Additional brake lamp
- 18 Electrical wiring harness

	Warning	Risk of injury caused by fingers being jammed or pinched when removing, installing or aligning hoods, doors, trunk lid/rear-end door or sliding roof.	No parts of the body or limbs should be within the operating area when the components are moving.	AS00.00-Z-0011-01A
		Notes on sensor system for trunk lid opening/closing		AH80.61-P-0001-01A
		Remove/install		
1		Remove both side bolsters	Model 205.0/1 with code 287 (Sitzlehnen im Fond klappbar) Model 213.0 with code 287 (Sitzlehnen im Fond klappbar)	AR91.12-P-1710LW
2		Unlock all backrests and fold over	Model 205.0/1 with code 287 (Sitzlehnen im Fond klappbar) Model 213.0 with code 287 (Sitzlehnen im Fond klappbar)	
3		Remove seat backrest	Model 205.0/1 except code 287 (Sitzlehnen im Fond klappbar) Model 213.0 except code 287 (Sitzlehnen im Fond klappbar)	AR91.12-P-1620LW

4	Remove anchor fitting on center seat belt	Model 205.0/1 except code 287 (Sitzlehnen im Fond klappbar) Model 213.0 except code 287 (Sitzlehnen im Fond klappbar) i Installation: Ensure bulb is correctly installed. Nm Bolt, rear belt end fitting	*BA91.40-P-1005-01U
5	Remove both C-pillar trims and guide out of working area along seat belts	Model 205.0/1 Model 213.0 i Belt end fittings must not be detached.	AR68.30-P-4490LW AR68.30-P-4490LWE
6	Remove retaining clips (3) together with spacers (4)	S Clip remover	*452589016300
7	Slightly fold back foam material (6) and disconnect electrical connectors (5)	i Installation: Completely fold back foam material (6) over electrical connectors (5). Otherwise noise may occur. i The number of electrical connectors (5) may vary depending on the equipment.	
8	Unclip retaining clip (7)	S Clip remover	*452589016300
9	Unscrew bolt (8) from towing eye bracket (9) and remove towing eye bracket (9)	Model 205.0/1 i Installation: Hook towing eye bracket (9) into body (2) together with sheet metal clip (10) and clip in.	
10	Loosen screws (11)	Model 205.0/1 with code 540 (Electric sunblind for rear window) Model 213.0 with code 540 (Electric sunblind for rear window)	
11	Unlock catches (12) on rear shelf (1) and slightly push rear shelf (1) toward front	i Installation: Ensure that arrests (12) are seated correctly.	
12	Lift rear shelf (1) and guide center seat belt with anchor fitting through cover (13) of center belt guide	Model 205.0/1 except code 287 (Sitzlehnen im Fond klappbar) Model 213.0 except code 287 (Sitzlehnen im Fond klappbar)	
13	Remove rear shelf (1) from vehicle	i Helper required.	
14	Remove sheet metal clip (10) from body (2)	Model 205.0/1 i Installation: Screw sheet metal clip (10) to towing eye bracket (9) with bolt (8).	
15	Remove cover (13)	When replacing rear shelf (1).	
16	Remove Isofix coverings (14)	When replacing rear shelf (1).	
17	Disconnect electrical connectors from speakers (15)	Model 205.0/1 with code 810 (Sound system) Model 213.0 with code 810 (Sound system) Model 213.0 with code 811 (Advanced sound system) When replacing rear shelf (1).	
18	Remove cover above speakers (15)	Model 205.0/1 with code 810 (Sound system) Model 213.0 with code 810 (Sound system) Model 213.0 with code 811 (Advanced sound system) When replacing rear shelf (1).	
19	Remove speakers (15)	Model 205.0/1 with code 810 (Sound system) Model 213.0 with code 810 (Sound system) Model 213.0 with code 811 (Advanced sound system) When replacing rear shelf (1).	
20	Remove tweeters	Model 213.0 with code 811 (Advanced sound system)	
21	Remove roller sun blind (16)	When replacing rear shelf (1). Model 205.0/1 with code 540 (Electric sunblind for rear window) Model 213.0 with code 540 (Electric sunblind for rear window)	AR68.50-P-3400LW AR68.50-P-3400LWV


22	Remove additional brake lamp (17)	When replacing rear shelf (1). i Installation: Replace adhesive strips for fastening electrical wiring harness (18) on additional brake lamp (17).	
23	Install in the reverse order		

Nm Seat belts/emergency tensioning retractors

Number	Designation		Model 205.0	Model 205.1
BA91.40-P-1005-01U	Bolt, rear belt end fitting	Nm	35	35

Nm Seat belts/emergency tensioning retractors

Number	Designation		Model 213
BA91.40-P-1005-01U	Bolt, rear belt end fitting	Nm	35

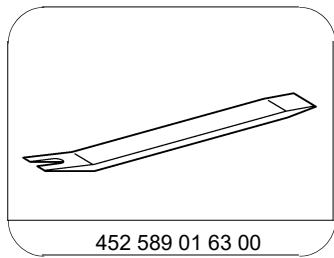

452 589 01 63 00

Clip remover