


Dashboard / Instrument Panel: Service and Repair

AR68.10-P-1030GH Remove/Install Center Section of Instrument Panel

Remove/Install Center Section Of Instrument Panel

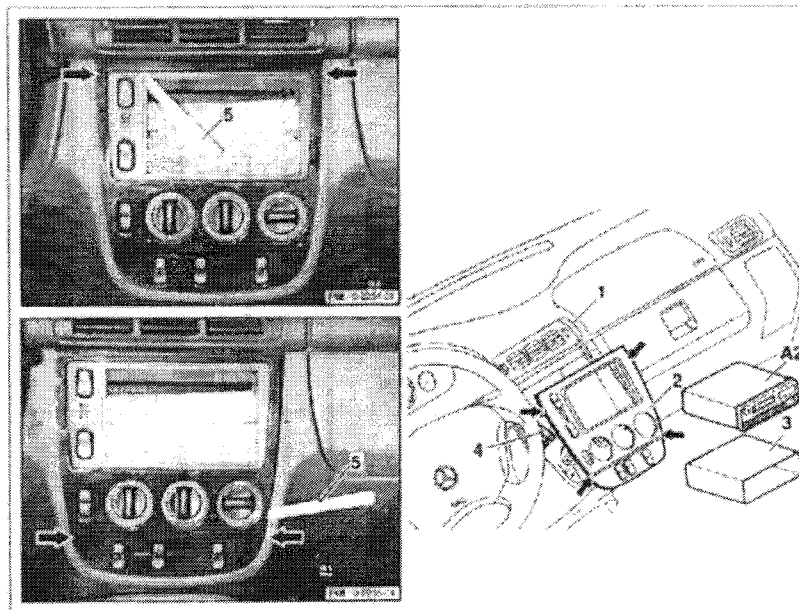

Illustrated on Model 163 up to VIN
A289564, X754619

P68.10-2358-06

- 1 Instrument panel
- 2 Instrument panel center section
- 3 Stowage compartment
- 4 In-car temperature sensor intake hose
- 5 Long wedge
- A2 Radio
- Arrows Retaining clips

Remove/Install

- 1 Remove radio (A2)
- 2.1 Remove stowage compartment (3)

NOTE: Only if present

- 3 Pry off top retaining clips (arrows) at center section of instrument panel (2) out of instrument panel (1)

NOTE:

- Risk of cracks and fracture!
- Put long wedge (5) behind center section of instrument panel (2) on the top edges of the opening and carefully pry off top retaining clips (arrows).
- Long Wedge: See **Special Tools** below.

- 4 Insert long wedge (5) into gap between instrument panel center section (2) and instrument panel (1) and pull down to rotary switches
 - Long Wedge: See **Special Tools** below.

- 5 Carefully pry off bottom retaining clips (arrows) at center section of instrument panel (2) out of instrument panel (1)

NOTE: Risk of cracks and fracture!

- Long Wedge: See **Special Tools** below.

- 6.1 Pull off interior temperature sensor intake hose (4)


NOTE: Up to VIN A289564, X754619.

- 7 Unplug all connectors from center section of instrument panel (2)
- 8.1 Separate connectors from AAC pushbutton control module

NOTE: As of VIN A289565, X754620.

- 9 Remove instrument panel center section (2)
- 10 Install in the reverse order

Special Tools

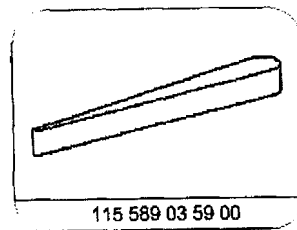

Long wedge

Long Wedge P/N # 115 589 03 59 00