

**MODEL 129**  
with single-block unit, 2nd generation two-component unit control element and MB radios

**MODEL 163**  
with CODE (257) Hi-Line radio  
with CODE (259) Premium radio with Bose sound system  
with CODE (352) COMAND operating and display system  
with CODE (353) Audio 30 APS  
with CODE (357) Navigation system - additional unit  
with CODE (522) Modular control system (MCS) radio USA  
with CODE (750) MB Audio 30 RDS radio  
with CODE (752) Becker Mexico 2000 radio with traffic news decoder  
with CODE (753) MB Audio 30 RDS radio  
with CODE (756) MB Audio 10 RDS radio with CD compartment

**MODEL 168**  
with CODE (353) Audio 30 APS  
with CODE (750) MB Audio 30 radio with TP/RDS  
with CODE (752) MB Audio 30 radio without TP/RDS  
with CODE (753) MB Audio 10 CC radio with TP/RDS  
with CODE (754) MB Audio 10 CC radio without TP/RDS  
with CODE (756) MB Audio 10 CD radio with TP/RDS  
with CODE (758) MB Audio 5 radio  
with CODE (759) MB Audio 5 TP radio with RDS

**MODEL 170**  
with CODE (510) MB Exquisit radio with traffic news decoder, with RDS (Becker)  
with CODE (512) MB Special radio with traffic news decoder, with RDS  
with CODE (515) MB Classic radio with traffic news decoder, with RDS  
with CODE (516) MB Classic radio without traffic news decoder  
with CODE (755) MB Special radio with CD tray

**MODEL 202**  
with CODE (510) MB Exquisit radio with traffic news decoder, with RDS (Becker)  
with CODE (512) MB Special radio with traffic news decoder, with RDS  
with CODE (515) MB Classic radio with traffic news decoder, with RDS  
with CODE (516) MB Classic radio without traffic news decoder  
with CODE (750) Becker Europa 2000 radio  
with CODE (751) Becker Grand Prix 2000 radio with RDS

**MODEL 208**  
with CODE (510) MB Exquisit radio with traffic news decoder, with RDS (Becker)  
with CODE (512) MB Special radio with traffic news decoder, with RDS  
with CODE (515) MB Classic radio with traffic news decoder, with RDS  
with CODE (516) MB Classic radio without traffic news decoder


**MODEL MODEL 210**  
with CODE (510a) MB Exquisit radio with traffic news decoder, with RDS (Becker)  
with CODE (512a) MB Special radio with traffic news decoder, with RDS  
with CODE (515a) MB Classic radio with traffic news decoder, with RDS  
with CODE (516a) MB Classic radio without traffic news decoder  
with CODE (750a) MB Audio 30 RDS radio  
with CODE (753) MB Audio 30 RDS radio  
with CODE (756a) MB Audio 10 RDS radio with CD compartment

**MODELS 463.200 /204 /206 /207 /208 /209 /220 /221 /224 /225 /227 /228 /230 /231 /232 /233 /240 /241 /243 /244 /245 /246 /247 /248 /249 /250 /254 /300 /304 /307 /308 /309 /320 /321 /322 /323 /324 /325 /327 /328 /330 /331 /332 /333**  
with CODE (ER5) MB "Classic" radio or standard class stereo cassette radio  
with CODE (ER6) MB "Special" radio or mid-class stereo cassette radio  
with CODE (ER7) MB "Exquisit" radio or comfort class stereo cassette radio

**MODEL 414.700**  
with CODE (EF8) Sound 10 radio  
with CODE (EF9) Sound 20 radio  
with CODE (EG5) Sound 30 radio  
with CODE (EG6) Audio 10 comfort radio, D2B networked  
with CODE (EU0) Sound 30 radio with single CD drive  
with CODE (EF2) Audio 10 RDS with CD insertion slot


The figure shows removal of radio in model 202

- 51 Removal assembly
- A2 Radio

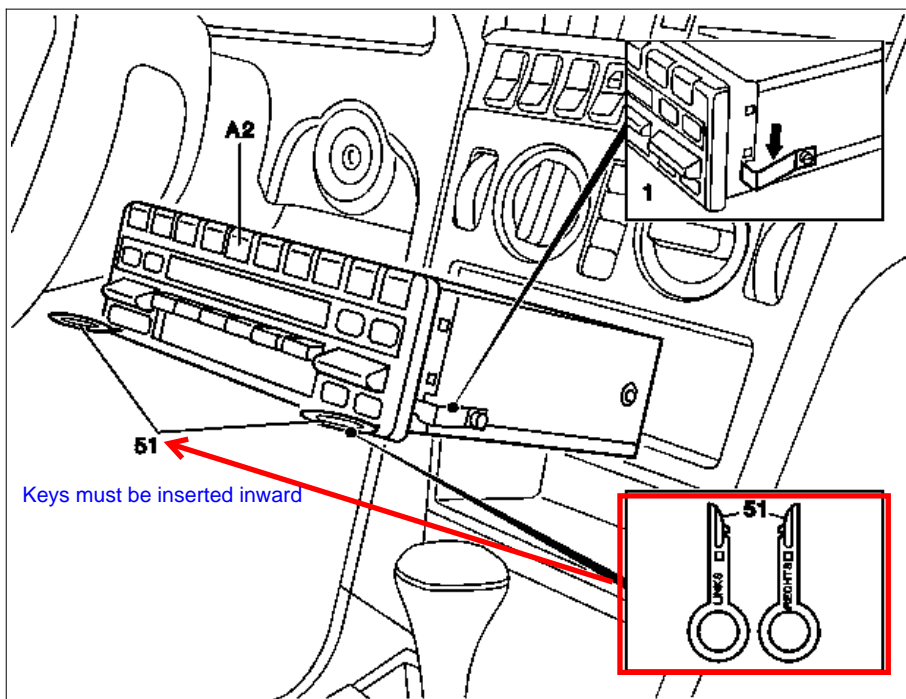

P82.60-0001-06

☒☒	Remove/Install		
1	Disconnect battery ground cable	<p>⚠ On model 163, 210, insulate cable terminal for ground lead to prevent unintentional contact between disconnected ground lead and ground point W10</p> <p>Model 463 except 463.241 with code 979</p> <p>Model 463.241 with code 979</p>	<p>AR54.10-P-0003A</p> <p>AR54.10-P-0003G</p> <p>AR54.10-P-0003PV</p>
2	Pull out radio (A2)	<p><b>i</b> Insert removal fixture (51) for this purpose.</p> <p><b>S</b></p> <p>Push back retaining springs (arrow) on removed radio (A2) and pull out removal fixture (51).</p> <p>Model 202</p> <p>as of 02/97</p> <p>MODEL 129 as of 02/91</p>	<p>*000589886300</p> <p>BT82.60-P-9309-01A</p> <p>BT82.60-P-9309-01B</p> <p>BT82.60-P-9309-01C</p>
<p><b>BT</b></p> <p><b>BT</b></p> <p><b>BT</b></p>	<p>MB radio</p> <p>MB radio</p> <p>MB radio</p>		
3	Disconnect electrical connectors		
4	Install in the reverse order		
5	Enter radio code	<p>Code 750, 751</p> <p>Code 510a, 512a, 515a, 516a, 755, ER5, ER6, ER7</p> <p>Model 129</p> <p>Model 168, 414</p> <p>Model 163</p>	<p>AR82.60-P-7502-01A</p> <p>AR82.60-P-7502-01B</p> <p>AR82.60-P-7502-01C</p> <p>AR82.60-P-7502-01GC</p> <p>AR82.60-P-7502-01GH</p>

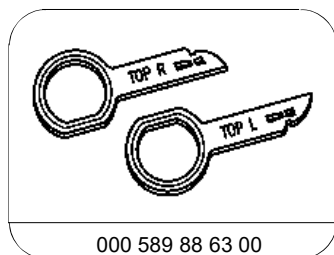

000 589 88 63 00

Removal assembly