
MODEL 164

up to Model Year 2009 with CODE (470) Tire pressure monitor (base) with CODE (475) Tire pressure monitor (Siemens) with CODE (477) Tire pressure loss warning Tire pressure monitor central antenna

- Bolts Nuts 2 3 Cover
- 5 Electrical connector
- 6 Bolts

A2/97 Central TPM [RDK] antenna

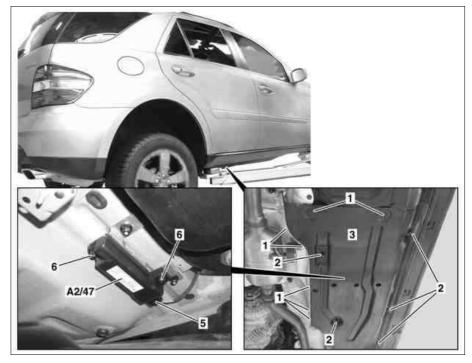

P40.15-2201-06

X	Remove/install	
1	Switch off ignition	
2	Raise vehicle with vehicle lift	AR00.60-P-1000GZ
3	Remove bolt (1)	
4	Unscrew nuts (2)	
5	Lower cover (3)	
6	Release and disconnect electrical connector (5).	
7	Remove bolts (6)	
8	Remove central TPM [RDK] antenna (A2/97)	
9	Install in the reverse order	
10	Read out fault memory and erase if necessary	
A D		AD00.00-P-2000-04A