



MODEL 166

- 1 Cover
- 2 Bolts

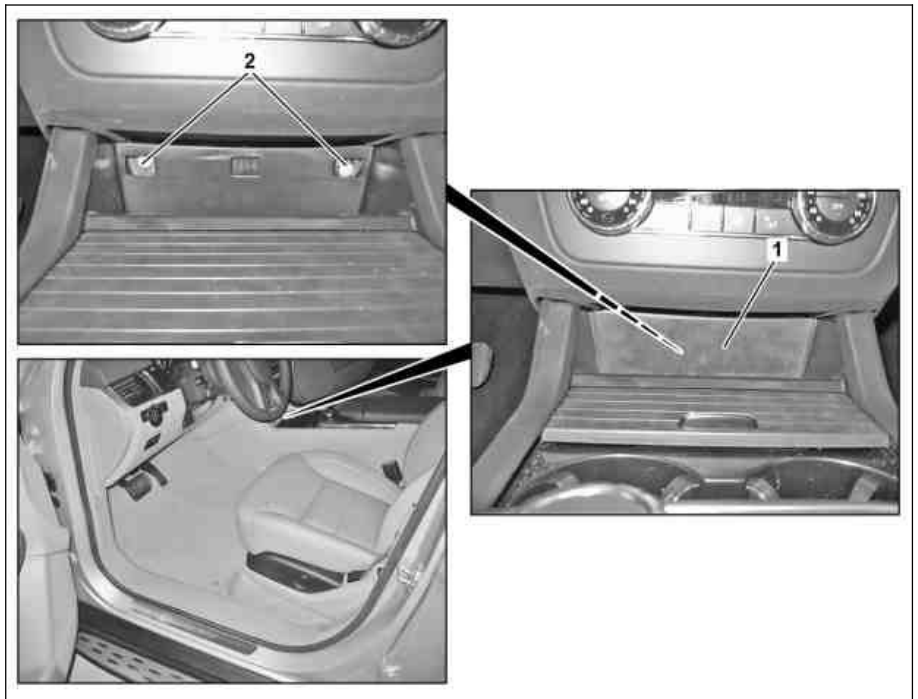


P68.20-4434-06

- 3 Cover
- 4 Bolts
- 5 Bolts
- 6 Cover
- 7 Electrical connectors
- 8 Electrical connectors

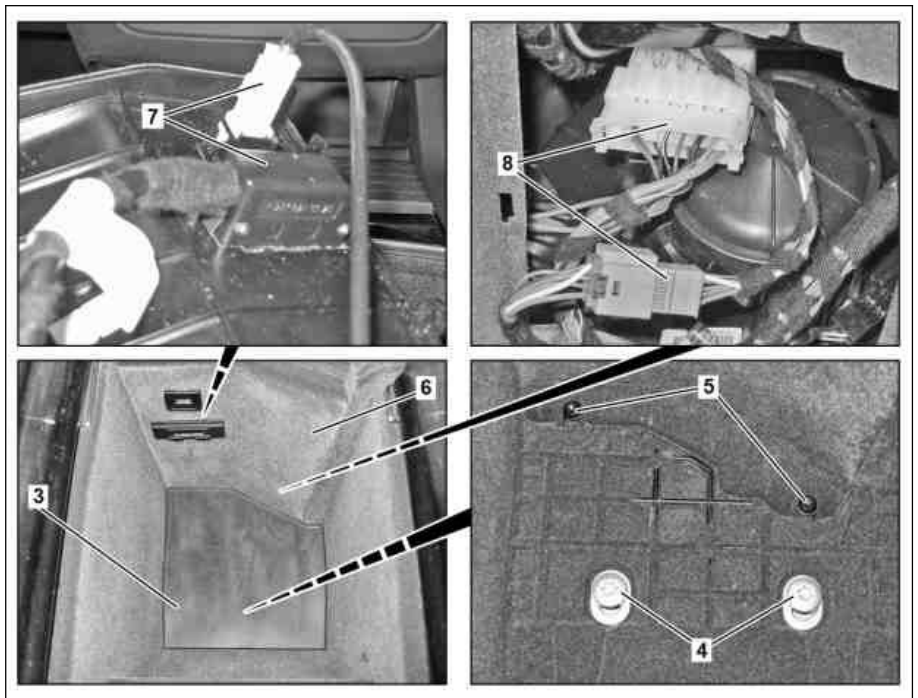

P68.20-4436-06

- 9 Cover
- 10 Bolts
- 11 Electrical connectors

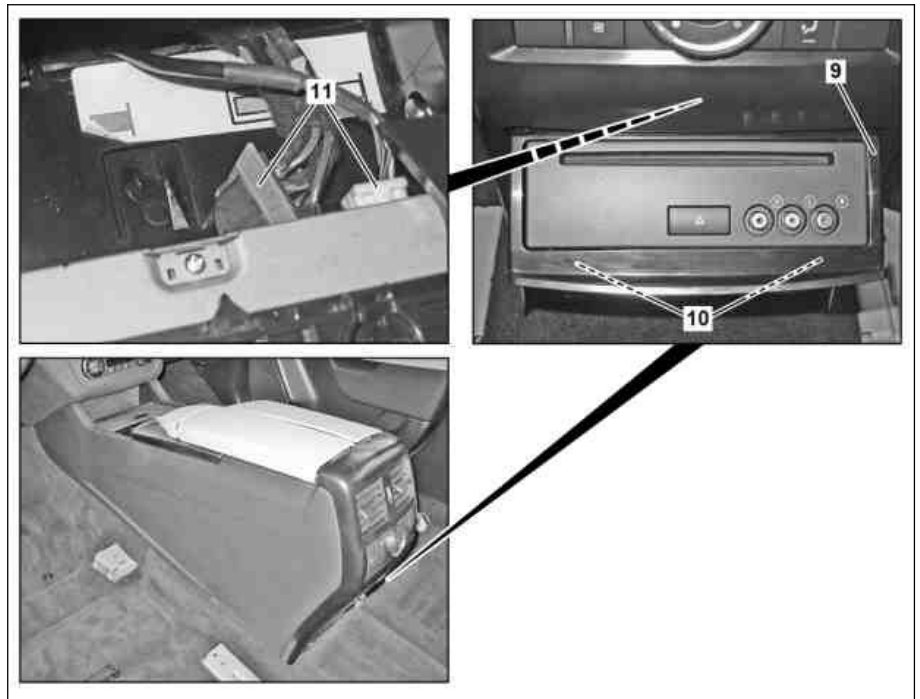

P68.20-4437-06

| | Remove/install | | |
|-----------|--|--|--------------------|
| 1 | Switch off ignition and remove transmitter key from EIS control unit Information on preventing damage to electronic components due to electrostatic discharge | On vehicles with code (889) Keyless-Go: Press Keyless-Go start/stop button repeatedly until ignition is switched off. Remove transmitter key from vehicle and store it in a location beyond its transmission range (at least 2 m). | AH54.00-P-0001-01A |
| | 2 Remove cover (1) | | |
| | 3 Unscrew bolts (2) below. | | |
| | 4 Remove cover (3) | | |
| | 5 Unscrew bolts (4, 5) below | | |
| | 6 Slightly pull paneling (6) upward and remove toward rear | | |
| | 7 Unclip electrical connectors (7) | Guide lower connector toward front through opening and then guide backwards through opening | |
| | 8 Disconnect electrical connectors (8) | | |
| | 9 Pull DVD player downwards | Only on vehicles with code (864) Rear entertainment system Installation: Ensure that catch tabs arrest audibly. | |
| | 10 Unclip cover (9). | Only on vehicles with code (864) Rear entertainment system Installation: Ensure that clips are seated correctly. | |
| | 11 Unscrew bolts (10) below | Only on vehicles with code (864) Rear entertainment system | |
| | 12 Slightly pull out DVD player | Only on vehicles with code (864) Rear entertainment system To gain access to electrical connectors (11) | |
| | 13 Disconnect electrical connectors (11) | Only on vehicles with code (864) Rear entertainment system | |
| | 14 Install in the reverse order | | |
| | 15 Connect STAR DIAGNOSIS, read out fault memory and erase if necessary | STAR DIAGNOSIS diagnosis system | AD00.00-P-2000-04A |