


Model 222

Shown with code 413 (Panoramic sliding sunroof)

- 2 Cover
 3 Screw
 5 Retaining bracket
 A28/11 Multifunction antenna

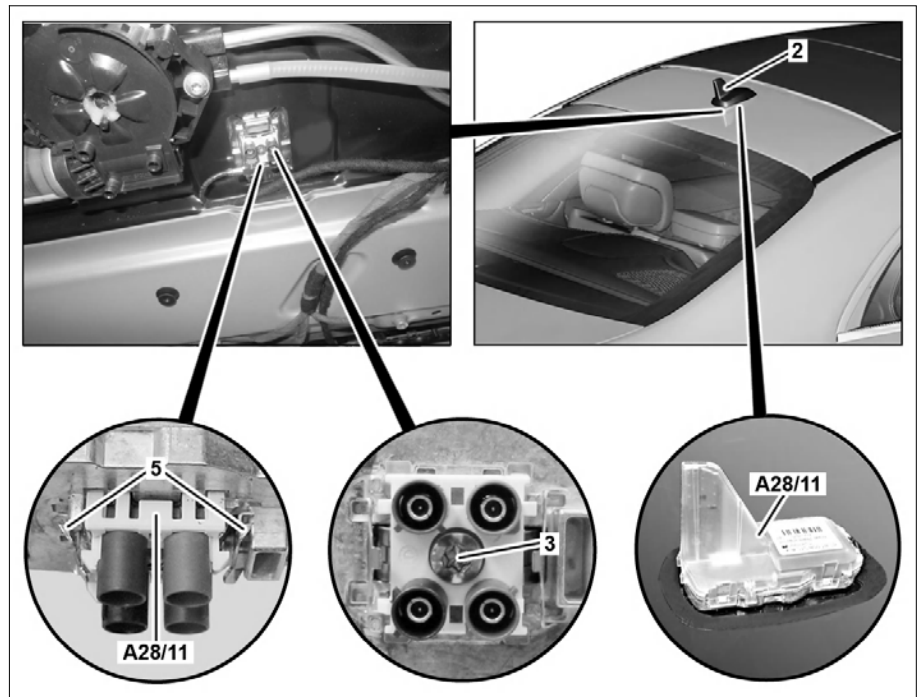

P82.70-7692-06

☒ ☒	Remove/install		
1	Remove cover (2) for multifunction antenna (A28/11)		AR82.70-P-8952EW
2.1	Remove headliner	Model 222.0 Model 222.1 Model 222.9 except code Z07 (Top protection) Model 222.1 Model 222.9 except code Z07 (Top protection) Model 222.0 ⓘ Do not kink headliner or bend excessively. Otherwise cracks and breaks may occur at the headliner. ⓘ The headliner remains in the vehicle.	AR68.30-P-4300LFN AR68.30-P-4300LF
2.2	Remove rear section of roof lining	Model 222.9 with code Z07 (Top protection) ⓘ Do not kink rear section of roof lining or bend it excessively. Otherwise cracks and breaks may occur in the rear section of the roof lining. ⓘ The headliner remains in the vehicle.	AR68.30-P-4307LFS
3	Disconnect electrical connectors on the multifunction antenna (A28/11)	ⓘ The number of electrical connectors at the multifunction antenna (A28/11) may vary depending on the equipment installed.	
4	Unscrew screw/bolt (3) until retaining brackets (5) are released	ⓘ Bolt (3) remains at multifunction antenna (A28/11). Nm Screw/bolt, antenna base to roof	*BA82.62-P-1001-01D
5	Remove multifunction antenna (A28/11) toward top		
6	Install in the reverse order		

Nm Antenna

Number	Designation	Model 222
BA82.62-P-1001-01D	Screw/bolt, antenna base to roof	Nm 3