


MODEL 221.0

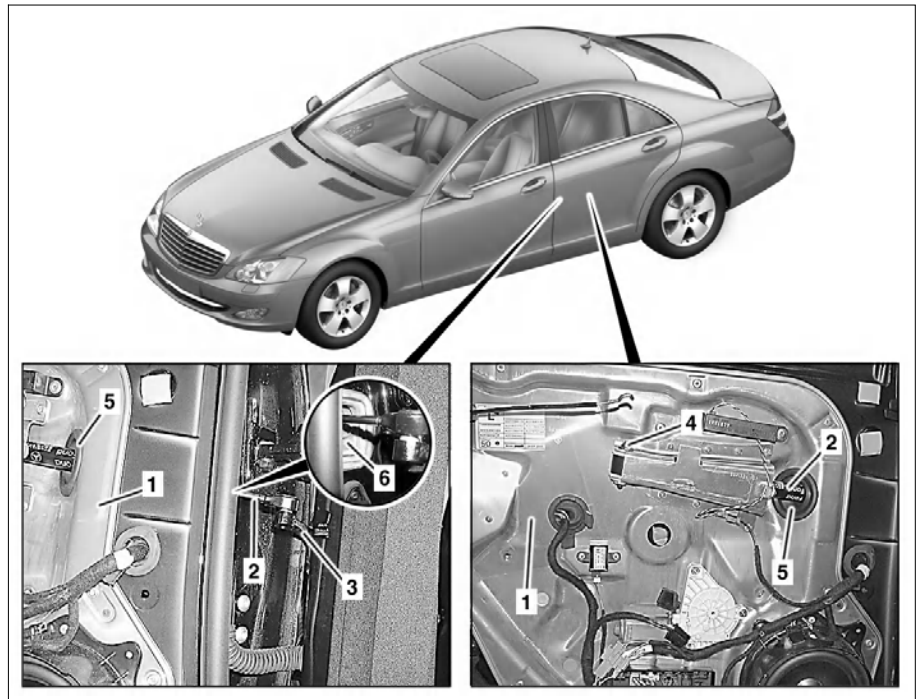




MODEL 221.1 except CODE (Z07) Top protection

Shown on model 221.0

- 1 Door module
- 2 Door holder
- 3 Bracket
- 4 Bolt
- 5 Grommet
- 6 Grommet



P72.12-2682-06

 	Remove/install		
1	Remove door lining from rear door		AR72.12-P-1010SX
2	Press door holder (2) off of bracket (3) on B-pillar with suitable screwdriver.	 Carefully unclip door holder (2); if necessary, use rag to protect against paint damage.	
3	Unscrew screw (4)	 Loctite 262	*BA72.12-P-1008-01M *BR00.45-Z-1059-02A
4	Remove door holder (2) toward rear from door module (1).	 <b>Installation:</b> Moisten grommets (5, 6) with lubricant to facilitate installation. Antifriction agent	*BR00.45-Z-1010-06A
5	Install in the reverse order		

 Rear door

Number	Designation		Model 221
BA72.12-P-1008-01M	Bolt, door holder to door module	Nm	25

## Repair materials

Number	Designation	Order number
BR00.45-Z-1059-02A	Loctite 262	Henkel Loctite Deutschland GmbH Arabellastrasse 17 81925 München Germany Tel. +49 899268-0 Fax + 49 899101978 www.Loctite.de
BR00.45-Z-1010-06A	Lubricant, rubber assembly 1 l	A 000 989 03 67