


## TRANSMISSION 722.6 in MODEL 211.0 /2



- 1 Floor covering  
 2 Impact absorber  
 3 Nut  
 4 Step plate  
 5 Bolt  
 6 Electrical connector  
 7 Electrical connector  
 8 Detent  
 N15/3 ETC control unit

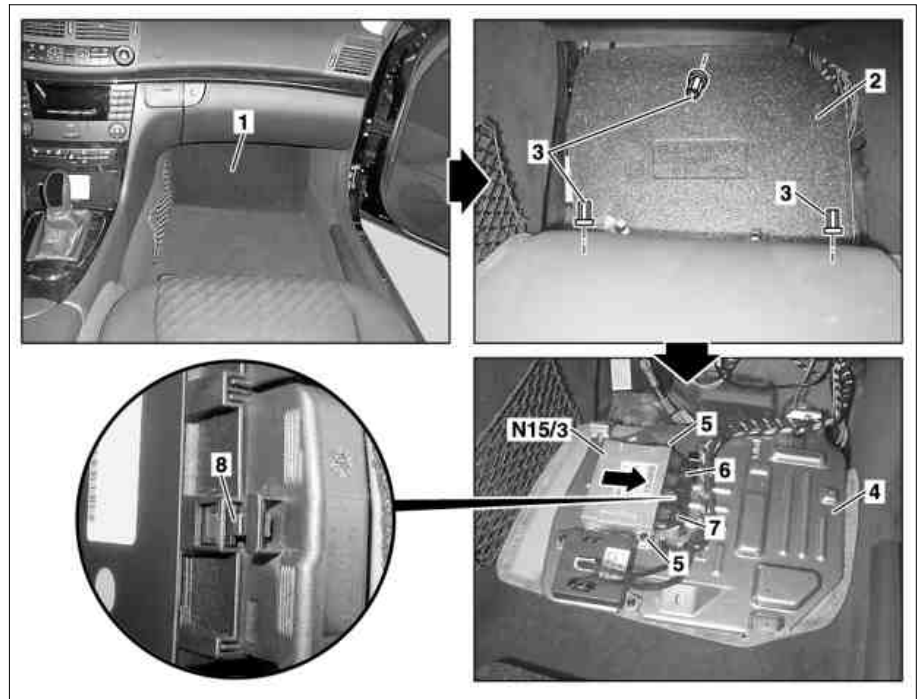

P27.19-2102-06

## Modification notes

14.5.03	Disconnect battery ground strap, due to SI54.18-P-0003A	Step 2	
22.9.03	Disconnect battery ground strap, deleted		

 	Removing, installing		
1	Remove key from electronic ignition switch (EIS)	<b>i</b> Vehicles with Keyless Go code 889: Press start/stop button repeatedly until the ignition is switched off.	
2	Move front passenger seat to rearmost position		
3	Remove floor mat and fold back floor covering (1) in passenger footwell		
4	Remove impact absorber (2)		
5	Unscrew nuts (3) and fold over step plate (4)		
6	Unscrew bolts (5)		
7	Remove ETC control unit (N15/3) in direction of arrow		
8	Unplug electrical connectors (6, 7)	<b>i</b> Press detent (8) of connector lock.	
9	Install in the reverse order		
10	Read out fault memory with STAR DIAGNOSIS and erase if necessary	Diagnostic system STAR DIAGNOSIS <b>i</b> Stored faults must be processed and erased in the fault memories after completing the work. The stored faults may result from faulty components, removal and installation work or cables disconnected during test operations or from a simulation.	*WH58.30-Z-1048-13A

## Commercially available tools

Number	Designation	
WH58.30-Z-1048-13A	STAR DIAGNOSIS diagnosis system, Compact Passenger Car	6511 1801 00