
Model 222 as of model year 2018

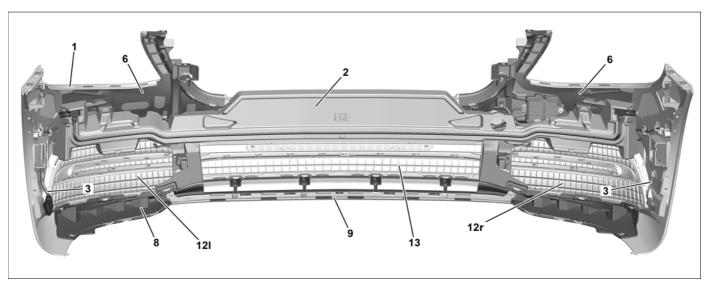


P88.20-4814-08

Shown on model 222.0 with engine 256, with code U60 (Active hood (Pedestrian protection)), with code 235 (Active Parking Assist with PARKTRONIC) and with code 258 (COLLISION PREVENTION ASSIST)

- 1 Front bumper
- 2 Impact absorber
- 3 Electrical wiring harness
- 6 Basic carrier
- 8 Center lower bumper basic bracket

- 9 Reinforcement
- 12I Left cover
- 12r Right cover
- 13 Center air grille

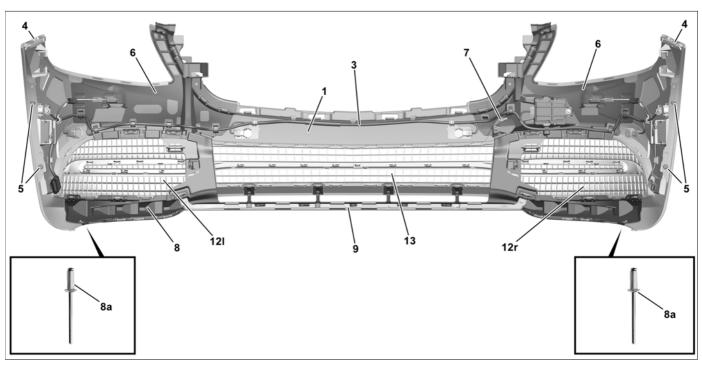

P88.20-4815-09


Shown on model 222.0 with engine 256, with code U60 (Active hood (Pedestrian protection)), with code 235 (Active Parking Assist with PARKTRONIC) and with code 258 (COLLISION PREVENTION ASSIST)

- 1 Front bumper
- 3 Electrical wiring harness

- 8 Center lower bumper basic bracket
- 8a Rivet

- Reinforcing bar
- 5 Expansion rivet
- 6 Basic carrier
- Tow hook cover


- 9 Reinforcement Left cover 121
- 12r Right cover
- 13 Center air grille

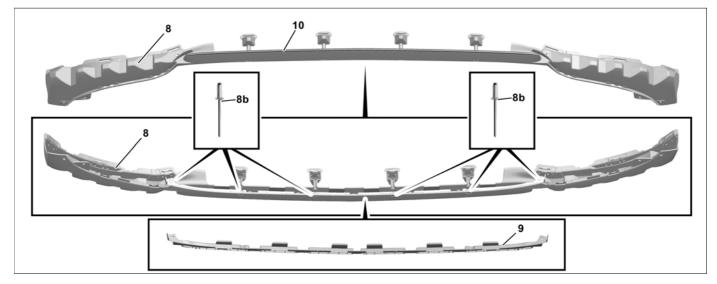

P88.20-4816-08

- Center lower bumper basic bracket 8
- 8b Rivet

- 9 Reinforcement
- 10 Lower trim piece

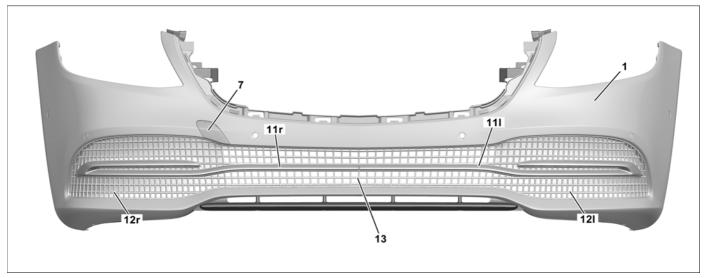

P88.20-4817-08

## Shown on model 222.0 with engine 256, with code U60 (Active hood (Pedestrian protection)) and with code 235 (Active Parking Assist with PARKTRONIC)

Front bumper


Left trim piece 111 Right trim piece

Tow hook cover

121 Left cover

Right cover 12r

13 Center air grille

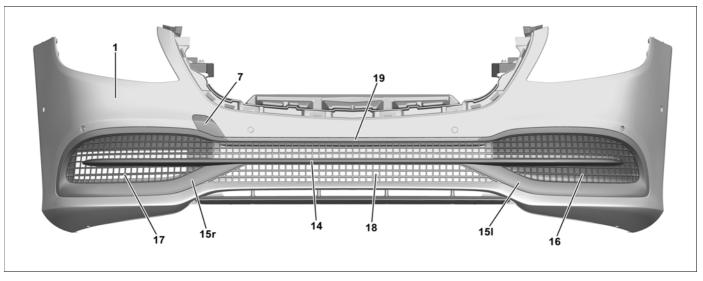

P88.20-4818-08

## Shown on model 222.9 with engine 279 and with code 235 (Active Parking Assist with PARKTRONIC)

Front bumper

Tow hook cover 7

14 Lower center trim element

Left outer trim element 151

15r Right outer trim element 16


Left cover Right air grille 17

18 Center air grille

19 Upper center trim element

⚠ Caution	Risk of injury caused by scraping or cutting body parts on sharp vehicle parts	Always wear protective gloves when working on or near sharp and non-deburred vehicle parts. Deburr repair panels.	AS00.00-Z-0017-01A
<b>\( \)</b>	Remove		
1	Remove front bumper (1)		AR88.20-P-2000LF
<u>, , , , , , , , , , , , , , , , , , , </u>	Disassemble/assemble		
2	Remove license-plate number		
3	Remove license plate bracket		
4	Remove pedestrian protection sensor	Model 222 as of model year 2018 with code U60 (Active Bonnet (Pedestrian protection))	
	Notes on pedestrian protection sensor		AH91.60-P-0001-01A AR91.60-P-0950EWM
5	Remove impact absorber (2)		
	General information on the impact absorber		AH88.20-P-1000-01A
6	Remove sensors from PARKTRONIC system (PTS)	Model 222 as of model year 2018 with code 235 (Active Parking Assist with PARKTRONIC)	
			AR54.65-P-0001LF
7	Remove radar sensor	Model 222 as of model year 2018 with code 258 (COLLISION PREVENTION ASSIST)	
			AR30.30-P-1210LFM
8	Detach electrical wiring harness (3) from front bumper (1) and remove	i Electrical wiring harness (3) varies depending on the vehicle equipment.	
9	Remove left reinforcing bar (4)	Mounting wedge	*110589035900
10	Remove right reinforcing bar (4)	Mounting wedge	*110589035900
11	Remove expansion rivet (5)		
12	Remove left basic bracket (6)	Left basic bracket (6) consists of two single parts.	е
		Remove single parts together.   Mounting wedge	*110589035900
13	Remove right basic bracket (6)	i Right basic bracket (6) consists of two single parts. Remove single parts together.	

		Mounting wedge	*110589035900
14	Remove tow hook cover (7)	3 3	
15	Drill out rivets (8a)		
16	Remove center lower bumper basic bracket (8) together with reinforcement (9) and lower trim element (10)	Mounting wedge	*110589035900
7	Drill out rivets (8b)		
8	Remove reinforcement (9) from center lower bumper basic bracket (8)	Mounting wedge	*110589035900
9	Remove lower trim element (10) from center lower bumper basic bracket (8)	Mounting wedge	*110589035900
20.1	Remove right trim element (11r) and left trim element (11l)	Model 222.0/1 as of model year 2018  i Removal: Start with right trim element (11r).	
		Mounting wedge	*110589035900
20.2	Remove lower center trim element (14), left outer trim element (15l) and right outer trim element (15r)	Model 222.9 as of model year 2018  i Removal: Start with lower center trim element (14).	
		Mounting wedge	*110589035900
14.4	Damas a left agree (401) and winkt agree (402)		1100000000
21.1	Remove left cover (12I) and right cover (12r)  Remove left cover (16) and right air grille (17)	Model 222.0/1 as of model year 2018  i Model 222.0/1 with engine 176 as of model year 2018  Model 222.1 with engine 277 as of model year 2018  An air grille is installed instead of right cover (12r).  Mounting wedge  Model 222.9 as of model year 2018	*110589035900
		i Model 222.9 with engine 256 as of model year 2018 Model 222.9 with engine 276 as of model year 2018 Model 222.9 with engine 278 as of model year 2018 A cover is installed instead of right air grille (17).  Mounting wedge	*110589035900
22.1	Remove center air grille (13)	Model 222.0/1 as of model year 2018  Mounting wedge	*110589035900
2.2	Remove center air grille (18) together with upper center trim element (19)	Model 222.9 as of model year 2018  Mounting wedge	*110589035900
23	Remove upper center trim element (19) from center air grille (18)	Model 222.9 as of model year 2018  Mounting wedge	*110589035900
24	Assemble in the reverse order		
K .	Install		
	1	I .	1

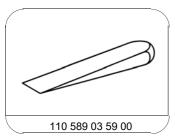

Mounting wedge