
Model 217, 222.0/1/9

Shown on model 222 except code 582 (Air conditioning system in rear) and except code 224 (Design individual rear seat system)

- 1 Center console
- 2 Top cover
- 3 Electrical connector
- 4 Bottom cover
- 5 Electrical connector

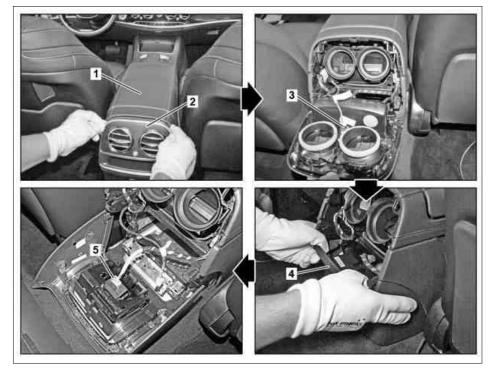

P68.20-4619-06

Shown on model 222 with code 864 (Rear entertainment system) and except code 224 (Design individual rear seat system)


3.1 DVD drive cover



P68.20-4625-01

	Risk of death from touching live components with AC voltages over 30 V	Do not touch live parts. People who have electronic implants (e.g. cardiac pacemakers) must not perform any work on live components conducting alternating voltage greater than 30 V.	AS54.00-Z-0001-05A
XX	Remove/install		
1	Detach ground line from battery	Model 222.0/1/9 with code U67 (230 V socket in interior compartment) Model 222.0/1 with code U80 (115 V socket)	AR54.10-P-0003LF
2	Manually unclip upper cover (2) toward rear from center console (1) and tilt downward		
3	Disconnect electrical connector from rear air conditioning system operating unit	Model 222.0/1/9 with code 582 (Rear air conditioner)	

4	Disconnect electrical connector (3) and remove		
	upper cover (2)	Model 222.0	
		with code 864 (Rear compartment	
		entertainment package)	
		Model 222.1/9 with code 864 (Rear compartment	
		entertainment package)	
		except code 224 (Rear individual seat design)	
5	Unclip DVD drive cover (3.1)	Model 217	
		Model 222.0	
		with code 864 (Rear compartment	
		entertainment package)	
		Model 222.1/9	
		with code 864 (Rear compartment entertainment package)	
		except code 224 (Rear individual seat design)	
6	Manually unclip lower cover (4) toward rear	Model 222.0	
0	from center console (1) and tilt downward	Model 222.1/9	
		except code 224 (Rear individual seat design)	
		i Model 222.0	
		with code 301 (Package SMOKER)	
		Model 222.1/9	
		with code 301 (Package SMOKER)	
		except code 224 (Rear individual seat design)	
		Disconnect electrical connector from cigarette	
		lighter.	
		S Clip remover	*452589016300
7.1	Disconnect electrical connector (5) from 230 V	Model 222.0	
	socket	with code U67 (230 V socket in interior	
		compartment) Model 222.1/9	
		with code U67 (230 V socket in interior	
		compartment)	
		except code 224 (Rear individual seat design)	
7.2	Disconnect electrical connector (5) from 115 V	Model 222.0	
	socket	with code U80 (115 V socket)	
		Model 222.1	
		with code U80 (115 V socket)	
0		except code 224 (Rear individual seat design)	
8	Remove lower cover (4)	Model 222.0 Model 222.1/9	
		except code 224 (Rear individual seat design)	
9	Remove ashtray housing or stowage	Model 222.0	
5	compartment	Model 222.0 Model 222.1/9	
		except code 224 (Rear individual seat design)	
		When replacing lower cover (4)	
10	Install in the reverse order		

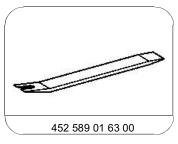

Clip remover