


MODEL 220, 215

Shown on model 220 up to VIN: 316716


- 1 Paneling
- 2 Bottom catch spring
- 3 Turn signals
- 4 Outside mirrors
- 5 Turn signal connector on outside rearview mirror
- 6 Turn signal connector in outside rearview mirror covering

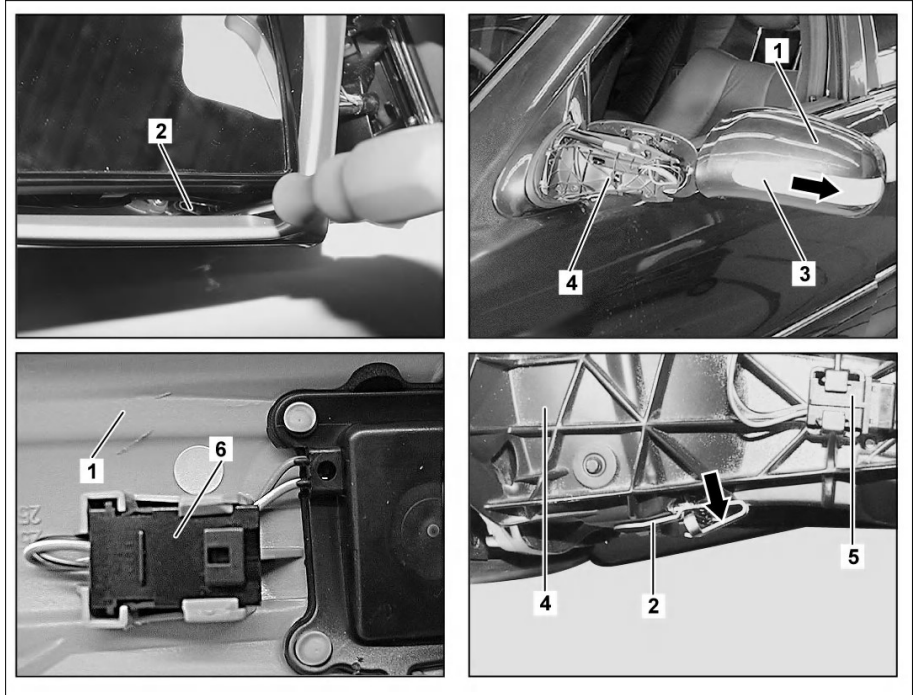

P88.70-2033-06

Shown on model 220 as of VIN: 316717

- 1 Paneling
- 4 Outside mirrors
- 7 Upper catch spring

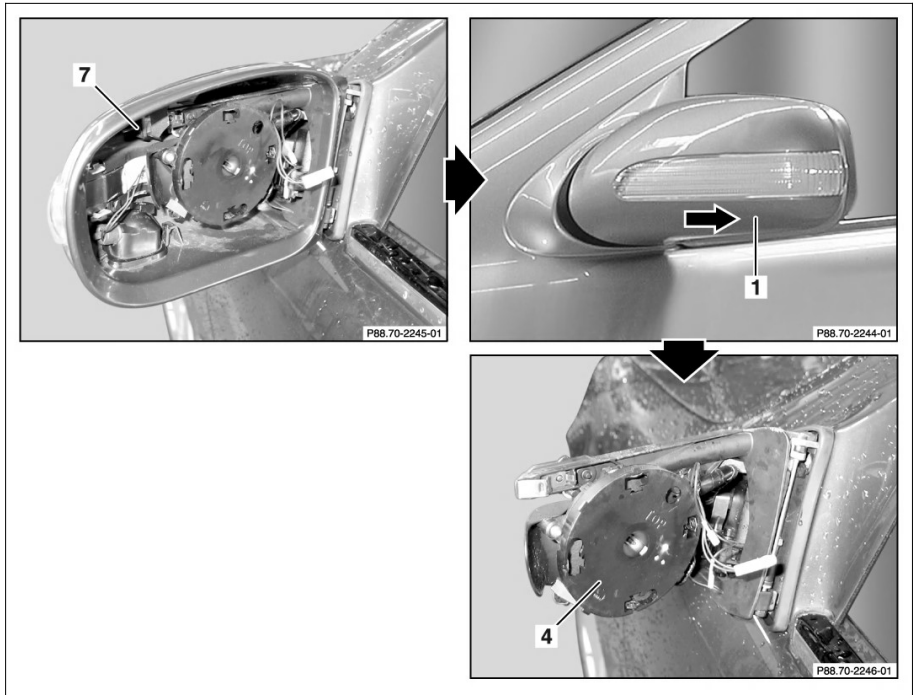

P88.70-2243-06

| ☒   | Remove  |   |                 |
|-----|---|---|-----------------|
| 1.1 | Remove mirror glass   | Model 220 as of VIN: 316717   | AR88.70-P-9020M |
| 2.1 | Release bottom catch spring (2)   | Model 220 up to VIN: 316716<br><b>i</b> Do not damage paintwork.  |                 |
| 2.2 | Release top catch spring (7)  | Model 220 as of VIN: 316717<br><b>i</b> Avoid damaging paint.   |                 |
| 3   | Remove paneling (1)   |   |                 |
| ☒   | Install   |   |                 |
| 4.1 | Move bottom catch spring (2) to initial position  | Model 220 up to VIN: 316716   |                 |
| 5.1 | Check position of connector for turn signal on outside rearview mirror (5) and turn signal connectors in outside rearview mirror covering (6) | Model 220 up to VIN: 316716<br><b>⚠</b> If the connectors are not in the correct position, damage can occur when the covering (1) is installed. |                 |

|   |                           |   |  |
|---|---------------------------|---|--|
| 6 | Push on paneling (1)      | <p>Ensure that the covering (1) is arrested in the end position by the bottom catch spring (2) or top catch spring (7).</p> <p>Model 220 up to VIN: 316716</p> <p>ⓘ Ensure that the turn signal connector is connected properly to the outside rearview mirror (5).</p> |  |
| 7 | Check for proper function |   |  |