


P72.12-2754-09

**Shown on model 204.0**

- |                            |                                   |                                    |
|----------------------------|-----------------------------------|------------------------------------|
| 1 Door lining              | 5 Bowden cable end safety cap     | N69/3 Left rear door control unit  |
| 2 Screws/bolts (model 204) | 6 Inside door opener Bowden cable | N69/4 Right rear door control unit |
| 3 Mounting clip            | 7 Electrical connectors           |                                    |
| 4 Rear door                | 8 Inner door handle               |                                    |

**Model 212**


- 1 Door lining
- 9 Assembly wedge
- 10 Cover
- 11 Bolts

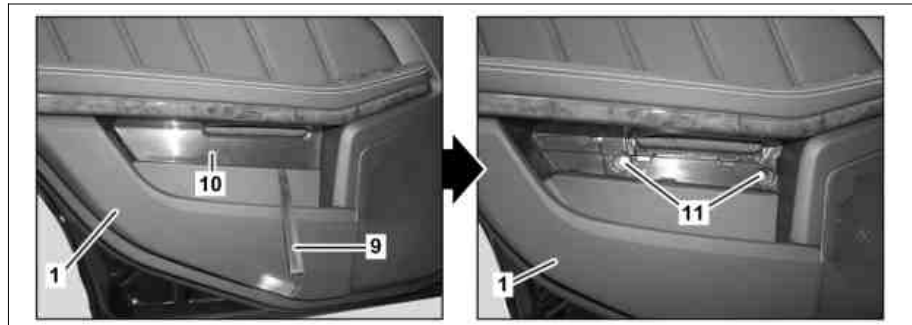

P72.12-2811-04

	Remove/install		
1.1	Remove bolts (2)	Model 204.0/2	
1.2	Unclip covers and unscrew bolts (2)	Model 204.9	
1.3	Unclip cover (10) with assembly wedge (9) and unscrew bolts (11)	Model 212	
2	Unclip door liner (1) from mounting clips (3)	<ul style="list-style-type: none"> <li> Assembly wedge</li> <li> Move assembly wedge directly to mounting clips (3). Otherwise the retaining tabs on the mounting clips (3) of the door liner (1) cannot tear out.</li> <li> Assembly wedge</li> </ul>	<p>*110589035900</p> <p>*110589035900</p>
3	Detach door lining (1) from rear door (4) horizontally to side until electrical connectors (7) on left rear door control unit (N69/3), right rear door control unit (N69/4), inside door opener Bowden cable (6) and Bowden cable end safety cap (5) are accessible.	<ul style="list-style-type: none"> <li> Carefully detach door lining (1). Danger of breaking mount on Bowden cable end safety cap (5).</li> </ul>	
4	Press shackles together (arrows) and unclip Bowden cable end safety cap (5) from door lining (1)	<ul style="list-style-type: none"> <li> <b>Installation:</b> Ensure that door lining (1) is seated correctly in inner sealing rails.</li> </ul>	

5  ⚠	Disconnect electrical connectors (7) from left rear door control unit (N69/3) and right rear door control unit (N69/4) Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
6	Unhook inside door opener Bowden cable (6) from inner door handle (8).		
7	Disconnect electrical connector on left rear door sound system tweeter or right rear door sound system tweeter	Model 212 with code (810) Sound system	
8	Install in the reverse order		

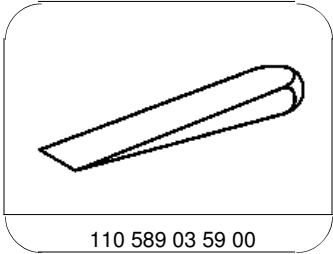

110 589 03 59 00

Mounting wedge