
MODEL 212.0## /2## (except 212.077 /277) 1#

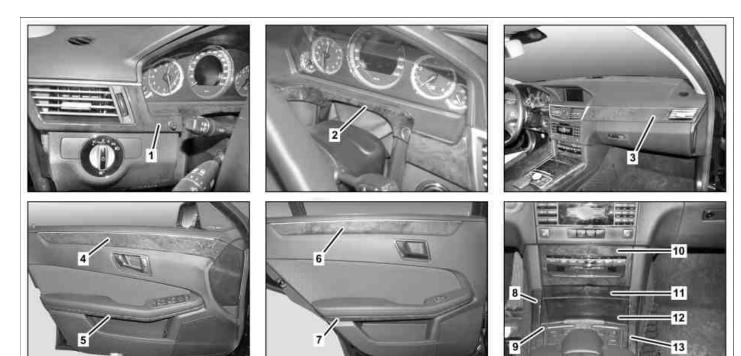


P68.30-3476-09

Shown on vehicle with code (279) Electronic drive selection stage

- Left air vent trim part
- Instrument cluster trim part
- 2 3 Passenger side trim part
- 4 Upper front door trim part
- 5 Lower front door trim part
- Upper rear door trim part 6
- 7 Lower rear door trim part
- 8 Left center console trim part
- Center middle console trim part
- Control and operating unit trim part 10
- Front stowage compartment trim part 11
- Rear stowage compartment trim part 12
- Right stowage compartment trim part

×	Remove		
(!)	General notes on retrofitting trim parts		AH68.00-P-0004-01EW
1	Remove front door liner		AR72.10-P-1000CW
2	Remove rear door lining		AR72.12-P-1010CW
3	Remove automatic air conditioning control and operating unit		AR83.40-P-6350EW
4	Remove trim strip on dashboard		AR68.10-P-1180EW
X	Install		
5	Retrofit trim parts (4, 5, 6 and 7) on doors		AN68.30-P-0004-01EW
		3,	*110589035900
6	Retrofit trim parts (8, 9, 10, 11, 12 and 13) on center console		AN68.30-P-0004-02EW
		3	*110589035900
7	Retrofit trim parts (1, 2 and 3) on instrument panel		AN68.30-P-0004-03EW
8	Install remaining parts		
9	Clean installed trim parts with cleaning agent approved by Daimler AG		
10	Connect STAR DIAGNOSIS		

11	Enter special equipment on the vehicle data card and the online vehicle data card	i Enter code (731) Wood finish burred walnut veneer trim parts or code (736) Wood finish ash tree black trim parts or code (H09) Wood finish ash tree brown trim parts or code (H76) Brushed aluminum trim part and delete code for removed trim parts
12	Close STAR DIAGNOSIS	

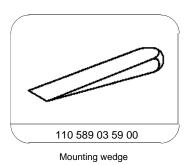

Parts ordering notes

Part no.	Designation	Quantity
DG 99 (see EPC)	Scope of delivery for trim parts	1